

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



1/43: Odometer Reading



2/43: Chassis Number



3/43: General View



4/43: General View

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



5/43: General View



6/43: General View



7/43: General View



8/43: General View

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



9/43: General View



10/43: General View



11/43: General View

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



13/43: General View



15/43: General View

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



17/43: Reinspection Photo



19/43: Reinspection Photo

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



12/43: General View



14/43: General View



16/43: Reinspection Photo



18/43: Reinspection Photo



20/43: Reinspection Photo



21/43: Reinspection Photo



23/43: Reinspection Photo

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



25/43: Reinspection Photo



27/43: Reinspection Photo

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



29/43: Reinspection Photo



22/43: Reinspection Photo



24/43: Reinspection Photo



26/43: Reinspection Photo



28/43: Reinspection Photo



30/43: Reinspection Photo



GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



33/43: Reinspection Photo



34/43: Reinspection Photo



35/43: Reinspection Photo



36/43: Reinspection Photo

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



37/43: Reinspection Photo



38/43: Reinspection Photo



39/43: Reinspection Photo

GX3476G [SLA3809S] - Submitted by: LKK Auto Consultants Pte Ltd (HQ)



40/43: Reinspection Photo



41/43: Reinspection Photo



42/43: Reinspection Photo



43/43: Reinspection Photo