

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC3/AIG20007086/KRA3Q2

Date: 30/04/2021

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900159593

Claimant
Vehicle No : SHB7928Y **Insured Vehicle No :** SCH8823L

Date of Loss: 04/07/2020 Nature of Claim: TP Claim No: 0747733141SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHB7928Y		
Make & Model:	TOYOTA PRIUS, 1.8 5DR HATCHBACK (A)	Engine No:	2ZR2C32021
Reg. Date:	27/06/2019 (Man. Year: 2018)	Chassis No:	JTDKB3FU003081806
Colour:	Metallic Pearl White/Red	Odometer:	202459 km
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Sailun 9 mm	Rear Left Side:	Sailun 9 mm
Front Right Side:	Sailun 9 mm	Rear Right Side:	Sailun 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,177.45	1,077.45	100.00	8.49
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,340.00	130.00	6,210.00	97.95
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	7,517.45	1,207.45	6,310.00	83.94
+ GST 7.00/7.00% (\$\$)	526.22	84.52	441.70	83.94
Nett Amount (\$\$)	8,043.67	1,291.97	6,751.70	83.94
+ Loss of Use (3.0 x S\$50.00/day) (\$\$)		150.00		
+ Car Rental (3.0 x S\$113.40/day) (\$\$)		340.20		
+ Doc/Search Fee (\$\$)		7.49		
Nett Liability (\$\$)		1,789.66		

INSPECTION

Date of Assignment: 07/07/2020

Date Inspected: 07/07/2020 Inspected At: Trans-cab Auto Services Pte Ltd
2 Ang Mo Kio Street 63
Singapore 569111

Estimated Period of Repair: 1.0 days

Adjuster: KENNETH KONG

Manager: Jaslin Kok Chin Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RIGHT SIDE VIEW MIRROR	Cracked	1,436.60 FL	*1,436.60 FL
2	1		*FRONT DOOR STICKER TRANS-CAB	Not Necessary	100.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	1,536.60	1,436.60
- List Item Discount on L Items 25.00/25.00% (\$)	359.15	359.15
Total Parts (\$)	1,177.45	1,077.45

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING ,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME.	New	3,000.00	50.00
2	TO RUST-PROOFING OF THE AFFECTED AREAS	New	170.00	0.00
3	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	3,000.00	60.00
4	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	170.00	20.00
Gross Labour Cost (\$\$)			6,340.00	130.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >