MOVA Automotive Pte Ltd Blk 1008, Bukit Merah Lane 3, #01-04/06/08. Singapore 159722

Insurer Reference:

Repairer Reference: CK138577

Date calculated: 14/07/2020 6:06 PM

Full Report Registration: SJY5519M Printed: 14/07/2020 6:06 PM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

India International

Insurance SGD

Printed by:

Claim Reference: Estimated Repair Time: Actual Repair Days:

GOH CHAI HOCK

Currency: Date of Incident: Hire Car Start: Hire Car End:

13/07/20

Vehicle Details

Vehicle

Manufacturer:

Model: Sub Model:

Model Sheet Number: Registration:

VIN number: Odometer:

HYUNDAI

SANTA FE (CM10) BASE MODEL

30 43 01 SJY5519M

KMHSH81BMAU59Q216

Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All

Underbody

LKK Auto Consultants hence notify the Repairer of the following:

To resurvey before/after spray painting

To display damaged part(s) during resurvey

Parts prices are subject to confirmation

Third party survey is on a "Without Prejudice" basis

No illegal modification(s) is allowed

 Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer Signatubea bour

Date:

Time Base 10 WU/h

Price = 50.00 SGD/h

| The state of the s | Code | Description | | WU PI | rice SGD |
|--|----------|--|-------|-------------|------------------|
| ľ | | | | 8.0 | 40.00 |
| F | 86520R00 | RENEW REAR BUMPER CPL | | | |
| f. | | INCLUDES: REAR BUMPER, REINFORCEMENT | | | |
| | | REAR BUMPER AND REQUIRED TRIMS REMOVE AND REFIT. | | | |
| | | ATTACH PARTS ASSEMBLE AND IF NEC RENEW. | | | 150.00 |
| | 72700000 | RENEW TAILGATE | | 30.0 | 150.00 |
| | 73700R00 | INCLUDES: R + R TAILGATE, | | | |
| | | CONVERT ATTACHED PARTS, RENEW IF | | | |
| | | NECESSARY | | | / 10.00 |
| | 81210R00 | R + R TAILGATE LOCK STRIKER PIN | | 2.0 5.0* | / 10.00 25.00 |
| | 2711 | REAR PANEL REPAIR | | 5.0+/ | 25.00 |
| | 2617 | L/R LWR BUMPER BRKT CHECK | | | |
| | 2618 | R/R LWR BUMPER BRKT CHECK | | | |
| | 2619 | L/R BUMPER BRACKET CHECK | | | |
| | 2620 | R/R BUMPER BRACKET CHECK | | | |
| | 2621 | L/R BUMPER BRACKET CHECK | | | |
| | 3361 | NUMBER PLATE LAMP CHECK | | | |
| | 3403 | L/R FOG LAMP CHECK | | | |
| | 3404 | R/R FOG LAMP CHECK | | | |
| | | Labour Cost | Hrs | wu | |
| | | | 4.50 | 45.0 | 225.00 |
| | | Panel / Mechanical Labour | 11.50 | . 3.0 | |
| | | Total of Labour | | | 225.00 |

| Paint Work | SYSTEM AZT | Time Basis 10 WU/h | |
|------------|---|--------------------|-----------|
| Code | Description | wu | Price SGD |
| | BOOTLID/TAILGATE NEW PART PAINTING | 18.0 | |
| | REAR BUMPER NEW PART PAINT K1R | 11.0 | |
| | REAR PANEL REPAIR PAINTING <50% | 8.0 | |
| | TOWING EYE COVER SURFACE PAINT PLAST. | 3.0 | |
| | BOOT/T-GATE MOULDING SURFACE PAINT PLAST. | 3.0 | |
| | L/R SIDE PANEL CPL SURFACE PAINT | 7.0 | |
| | R/R SIDE PANEL CPL SURFACE PAINT | 7.0 | |
| | L/R WHEELHOUSE SURFACE PAINT | 6.0 | |
| | R/R WHEELHOUSE SURFACE PAINT | 6.0 | |

Paint Material Per Part

| Code | Description | Price SGD |
|------|---|-----------|
| 2931 | BOOTLID/TAILGATE NEW PART PAINTING | 44.73 |
| 2583 | REAR BUMPER NEW PART PAINT K1R | 43.97 |
| 2711 | REAR PANEL REPAIR PAINTING <50% | 4.50 |
| 2585 | TOWING EYE COVER SURFACE PAINT PLAST. | 0.26 |
| 2987 | BOOT/T-GATE MOULDING SURFACE PAINT PLAST. | 2.87 |
| 3451 | L/R SIDE PANEL CPL SURFACE PAINT | 13.02 |
| 3452 | R/R SIDE PANEL CPL SURFACE PAINT | 13.02 |
| 4101 | L/R WHEELHOUSE SURFACE PAINT | 11.44 |
| 4102 | R/R WHEELHOUSE SURFACE PAINT | 11.44 |

| Labour Cost - Paint Factor | 50.00 SGD/h | Hrs | WU | Price SGD |
|---|-------------|----------------------|-----|--------------------------|
| Time Paint Preparation Main Work Metal Preparation Comp. Work Plastic Total | 10 WU/h | 1.70 0.30 8.90 | 3.0 | 85.00 15.00 445.00 |
| Material Cost - Paint | | | | Price SGD 44.73 |
| New Part Painting | | | | 43.97 |
| New Part Painting - Plastic K1R Repair Painting | | | | 4.50 |
| Surface-/Blend Paint | | | | 48.92 |
| Surface Painting Plastic | | | | 3.13 |
| Material-constant Metal | | | | 18.10 |
| Material-constant Plastic | | | | 9.00 |
| Total | | | | 172.35 |

| Spare Parts | | | | rices as at 2015-06-01 |
|-----------------|---------------------------|-------------|--------------------|------------------------|
| Code | Description | Part Number | Part Source | Price SGD |
| 3013 | BADGE HYUNDAI | 863102B500 | Original / M | 65.00 |
| 3020 | BADGE SANTA FE | 863102B900 | Original / //(| 68.00 |
| 2977 | BOOT/TAILGATE LOCK | 812302B000 | Original / BT | 120.00 |
| 2987 | BOOT/T-GATE MOULDING | 873112B500 | Original V BR | 155.00 |
| 2931 | BOOTLID/TAILGATE | 737002B600 | Original 🖊 🔑 | 1,750.00 |
| 3015 | REAR BADGE | 863002B000 | Original / M | 59.00 |
| 1000 | REAR BOOM EMBLEM | CROSSOVER | Original - M | 68.00 |
| 2583 | REAR BUMPER | 866112B700 | Original \sim 00 | 589.00 |
| 2644 | REAR BUMPER DAMPING | 866202B700 | Original 🗸 🗸 BR | 108.00 |
| 2640 | REAR BUMPER SUPPORT | | Original V BT | 270.00 |
| 3151 | REAR SCREEN | 871102B000 | Original X NN | 657.00 |
| 3160 | REAR SCREEN BOND KIT | | 3 30 1414 | 0.00 |
| 2650 | RR BUMPER CLAMP KIT | | RTS Original / M | 35.00 |
| 2600 | RR BUMPER WIND DEFL | | Original / CH | 342.00 |
| 979 | TAILGATE HANDLE | 812602B000 | Original X NN | 96.00 |
| OEM Parts | Savings | | | 0.00 |
| : Non-OEM Parts | Subtotal | | | 4,382.00 |
| Used parts | Subtotal Discount(+ | 20.00%) | | -876.40 |
| | Total | | | 3,505.60 |

| Code | Description | Price SGD |
|------------------------------|--|---|
| 1001 1002 1003 1004 | REAR SCREEN SEALANT REVERES SENSOR Shorted REAR NO PLATE NN AUDATEX FEE Total Extras | 60.00*/ 200.00*/ 40.00*/ 40.00*/ 340.00 |

| 4,382.00 -876.40 | |
|---------------------|----------------------------|
| | |
| -8/0.40 | |
| | 3,505.60 |
| | |
| 225.00. / | |
| 223.000 | 225.00 |
| | |
| | 340.00 |
| | |
| 445.00/ | |
| 172.25. | |
| 1/2.33 | 617.35 |
| | 017.55 |
| | 4,687.95 |
| | 328.16 |
| | 5,016.11 |
| • | 225.00 445.00 172.35 |

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.