

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTAIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120**Our File No:** CC3/AIG20007446/AVF3E2**Date:** 19/11/2020**REFERENCE**

Insured/Claimant:	MARIO TRAEBER	Policy No:	1800049110
Date of Loss:	17/07/2020	Nature of Claim:	OD
		Claim No:	3254759657SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKG5268U		
Make & Model:	AUDI Q5 SPORT, 2.0 TFSI QU S TRONIC (A)	Engine No:	DAX032618
Reg. Date:	15/05/2018 (Man. Year: 2018)	Chassis No:	WAUZZZFV6J2136117
Colour:	White	Odometer:	18038 km
Engine Capacity:	1984 cc		
Market Value/New Car Price:	S\$155,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	235/55 R19	Rear Tyre Size:	235/55 R19
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	38,906.00	9,975.92	28,930.08	74.36
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,572.00	5,422.00	3,150.00	36.75
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	47,478.00	15,397.92	32,080.08	67.57
- Excess (\$\$)	1,000.00	1,000.00	0.00	0.00
(\$\$)	46,478.00	14,397.92	32,080.08	69.02
+ GST 7.00/7.00% (\$\$)	3,253.46	1,007.85	2,245.61	69.02
Nett Amount (\$\$)	49,731.46	15,405.77	34,325.69	69.02

INSPECTION

Date of Assignment:	20/07/2020	
Date Inspected:	20/07/2020	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	7.0 days	

Adjuster: ADRIAN LING**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	2,595.00 FS	*2,075.60 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	267.00 FS	*- FS
3	2		*FRONT BUMPER CLOSING ELMENT-LH/RH	Not Necessary	222.00 FS	*- FS
4	1		*FRONT BUMPER GRILLE-CENTRE	Cracked	142.00 FS	*113.60 FS
5	1		*FRONT SPOILER	Deformed	754.00 FS	*603.20 FS
6	1		*FRONT BUMPER UNDERRUN BAR	Deformed	474.00 FS	*379.20 FS
7	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	171.00 FS	*- FS
8	1		*RADIATOR GRILLE	Cracked	3,490.00 FS	*2,792.00 FS
9	1		*RADIATOR GRILLE STRIKER PLATE	Not Necessary	241.00 FS	*- FS
10	1		*FRONT BUMPER AIR GUIDE GRILLE-LH	Not Necessary	574.00 FS	*- FS
11	1		*FRONT BUMPER END CAP-LH	Not Necessary	91.00 FS	*- FS
12	1		*FRONT BUMPER AIR GUIDE GRILLE-RH	Cut	574.00 FS	*458.80 FS
13	1		*FRONT BUMPER END CAP-RH	Not Necessary	91.00 FS	*- FS
14	4		*LOCKING CLIP	Not Necessary	15.00 FS	*- FS
15	2		*FRONT PARKING AID SENSOR-INNER (NPA)	Not Necessary	0.00 FS	*- FS
16	1		*FRONT BUMPER FOAM FILLER PIECE	Cracked	285.00 FS	*228.00 FS
17	1		*FRONT BUMPER CARRIER	Bent	911.00 FS	*728.40 FS
18	1		*FRONT BUMPER SIGHT SHIELD	Not Necessary	127.00 FS	*- FS
19	1		*CAUTION SIGN STICKER	Not Necessary	14.00 FS	*- FS
20	1		*AIRCON STICKER	Not Necessary	20.00 FS	*- FS
21	2		*FRONT WHEEL COVER-LH/RH	Necessary	1,250.00 FS	*1,000.00 FS
22	2		*LED HEADLIGHT-LH/RH	Not Necessary	22,722.00 FS	*- FS
23	2		*HEADLIGHT MOUNTING-LH/RH	O/S Cracked	234.00 FS	*93.60 FS
24	1		*RADIATOR AIR GUIDE-RH	Deformed	58.00 FS	*45.76 FS
25	1		*CHARGE AIR COOLER	Not Necessary	785.00 FS	*- FS
26	2		*PRESSURE PIPE SEAL	Not Necessary	88.00 FS	*- FS
27	1		*FRONT NO PLATE	Dented	40.00 FS	*40.00 FS
28	1		*SUNDRIES	Necessary	200.00 FS	*70.40 FS
29	1		*LOCK CARRIER	Cracked	1,384.00 FS	*1,107.20 FS
30	1		*RADIATOR COOLANT	Necessary	91.00 FS	*72.32 FS
31	1		*CHARGE AIR COOLER	Not Necessary	785.00 FS	*- FS
32	1		*WHEEL SPOILER RHS	Cracked	153.00 FS	*122.40 FS
33	1		*TEMPERATURE SENSOR BRACKET	Cracked	16.00 FS	*12.56 FS
34	1		*RADIATOR AIR GUIDE CENTRE	Deformed	42.00 FS	*32.88 FS

F=Franchise part. S=SpcNett.

Total Parts (\$\$) **38,906.00** **9,975.92**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO REMOVE AND TRANSFER FRONT BUMPER WIRE HARNESS FOR FRONT PARKING AID.	New	280.00	280.00
2	TO REMOVE AND TRANSFER HEADLIGHT CONTROL UNITS,POWER MODULES,ELECTRICAL FANS AND CONNECTORS.	New	900.00	500.00
3	TO DISMANTLE FRONT BUMPER,INSPECT FRONT LOCK CARRIER FOR DAMAGES.RENEW CHARGE AIR COOLER,FRONT BUMPER ASSY AND BOTH FRONT HEADLIGHTS.RE-ORGANISE FRONT CRASH MANAGEMENT COMPONENTS.REINSTALL ALL PARTS REMOVED.	New	1,200.00	500.00
4	TO RESPRAY FRONT BUMPER,LOWER SPOILER AND WHEEL ARCH TRIMS.	New	2,200.00	1,300.00
5	TO CARRY OUT DIAGNOSTIC CHECK.	New	192.00	192.00
6	TO REMOVE AND REINSTALL AIRCON CONDENSER,CHARGED AIR COOLER AND RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNITS. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS.	New	1,400.00	1,400.00
7	TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION.	New	2,400.00	1,250.00
Gross Labour Cost (S\$)			8,572.00	5,422.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >