



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2005841
INV Date 26/08/2020
Reference CS/AGI20007470/Utf3n2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SLV 3347Y
Insured Veh. SML 6191A
Claim No. C10006735
Policy No.
Accident Date 16/07/2020
Inspection Date 21/07/2020

Description	Total
Survey Inspection	450.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	450.00
GST (7%)	31.50
Grand Total	481.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

HYN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AUTO & GENERAL INSURANCE (S) PL

Ref : CS/AGI20007470/Utf3n2

(BUDGET DIRECT INSURANCE)

190 CLEMENCEAU AVENUE #03-01

SINGAPORE SHOPPING CENTRESINGAPORE

239924

Date : 26-08-2020



Code : AGI

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SML 6191A	Veh. Inspected	SLV 3347Y
Policy No.		Coverage (\$)	0.00
Claim No.	C10006735	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	20/07/2020

2. Vehicle Particulars & Condition

Make & Model	KIA CARENS (A)	c.c	1685
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	KNAHU815VJ7195302	Colour	BROWN
Odometer	176584	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	GRENLANDER COMFORT	6 mm
L/H Front Tyre	205/55 R16	GRENLANDER COMFORT	6 mm
R/H Rear Tyre	205/55 R16	GRENLANDER COMFORT	6 mm
L/H Rear Tyre	205/55 R16	GRENLANDER COMFORT	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S FRONT PORTION AND O/S BODY.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	16/07/2020	Inspection Date	21/07/2020
Survey held at	TAN LIM MOTOR PTE LTD 51 DEFU LANE 10 SINGAPORE 539216		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	5 Working Days
--	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLV 3347Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	DEEP CUT	576.00	576.00
8	REAR BUMPER CLIPS @\$4.50	NECESSARY	36.00	36.00
1	REAR BUMPER SIDE RETAINER O/S	NOT NECESSARY	28.00	-
1	O/S REAR FENDER	DENTED / BENT	1,223.00	1,223.00
1	O/S REAR FENDER INNER COWLING	NOT NECESSARY	224.00	-
6	O/S REAR FENDER INNER COWLING CLIPS @\$4.50	NOT NECESSARY	27.00	-
1	O/S REAR FENDER STICKER	NOT NECESSARY	28.00	-
1	O/S REAR DOOR	DENTED / BENT	1,309.00	1,309.00
1	O/S REAR DOOR LOCK	NOT NECESSARY	229.00	-
1	O/S REAR DOOR LOCK CATCH	NOT NECESSARY	55.00	-
2	O/S REAR DOOR HINGES @\$65.00	NOT NECESSARY	130.00	-
1	O/S REAR DOOR CHECKER	NOT NECESSARY	35.00	-
1	O/S REAR DOOR TOP MOULDING	NOT NECESSARY	85.00	-
1	O/S REAR DOOR WEATHERSTRIP	NECESSARY	105.00	105.00
1	O/S REAR DOOR FRAME STICKER	NECESSARY	28.00	28.00
1	O/S FRONT DOOR	DENTED / BENT	1,409.00	1,409.00
1	O/S FRONT DOOR OUTER HANDLE	NOT NECESSARY	187.00	-
1	O/S FRONT DOOR OUTER HANDLE EXTENSION	NOT NECESSARY	85.00	-
1	O/S FRONT DOOR LOCK	NOT NECESSARY	229.00	-
1	O/S FRONT DOOR CATCH	NOT NECESSARY	55.00	-
2	O/S FRONT DOOR HINGES @\$65.00	TWISTED	130.00	130.00
2	O/S FRONT DOOR CHECKER @\$35.00	TWISTED (1 PC ONLY)	70.00	35.00
1	O/S FRONT DOOR POWER WINDOW MOTOR	SHORTED	310.00	310.00
1	O/S FRONT DOOR POWER WINDOW REGULATOR	NOT NECESSARY	229.00	-
1	O/S FRONT DOOR WEATHERSTRIP	NECESSARY	105.00	105.00
1	O/S FRONT DOOR INNER TRIM BOARD	TORN	235.00	235.00
1	O/S FRONT DOOR FRAME STICKER	NECESSARY	28.00	28.00
1	O/S FRONT DOOR TOP MOULDING	NOT NECESSARY	85.00	-
1	O/S FRONT FENDER	BADLY DENTED	1,223.00	761.00
1	O/S FRONT FENDER WIND DEFLECTOR	NOT NECESSARY	28.00	-

Report Ref No. CS/AGI20007470/Utf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	O/S FRONT FENDER INNER COWLING	DEFORMED / TORN	224.56	187.00
6	O/S FRONT FENDER INNER COWLING CLIPS @\$4.50	NOT NECESSARY	27.00	-
1	FRONT BUMPER SIDE RETAINER RIGHT	NOT NECESSARY	46.00	-
1	O/S SIDE MIRROR ASSY	NOT NECESSARY	652.00	-
1	O/S FRONT WHEEL BEARING WITH HUB	NOT NECESSARY	467.80	-
1	O/S FRONT KNUCKLE ARM	NOT NECESSARY	314.40	-
	LESS 20% DISCOUNT		-2,051.55	-1,295.40
			8,206.21	5,181.60
	<u>SPECIAL NETT ITEMS</u>			
1	O/S FRONT SPORT WHEEL RIM (SN)	CUT / BENT	750.00	400.00
1	O/S FRONT WHEEL TYRE (SN)	SERVICEABLE	250.00	-
1	O/S REAR SPORT WHEEL RIM (SN)	CUT / BENT	750.00	400.00
1	O/S REAR WHEEL TYRE (SN)	SERVICEABLE	250.00	-
1	ROCKER PANEL-STONE CHIP (SN)	NOT NECESSARY	350.00	-
			2,350.00	800.00
	<u>LABOUR</u>			
	TO TRANSFER OF RIGHT BOTH DOOR FITTINGS AND PERFORM WATER SEEPAGE TEST.		260.00	100.00
	TO REPLACE O/S SIDE MIRROR.	NOT NECESSARY	200.00	-
	TO TRANSFER OF TYRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	60.00	-
	TO DROP FRONT SUSPENSION UNDERCARRIAGE PARTS,REMOVE AND RENEWAL OF THE NECESSARY PARTS,TO PERFORM FINAL CHECKING AND TESTING.	NOT NECESSARY	200.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		80.00	60.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		350.00	100.00
	TO REPLACE DOOR FRAME STICKER (2 DOOR).	NOT NECESSARY	60.00	-
	USING ONBOARD SCAN TOOL (OBD) PERFORM FULL ENGINE DIAGNOSTIC CHECK,TO CONFIGURE AND CLEAR,RESET SRS SERVICE LIGHT.		250.00	50.00
	PANEL BEATING,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME.		1,500.00	800.00

Report Ref No. CS/AGI20007470/Utf3n2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		1,600.00	1,100.00
			4,560.00	2,210.00
GRAND TOTAL			15,116.21	8,191.60
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				6,550.00

Report Ref No. CS/AGI20007470/Utf3n2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 3347Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

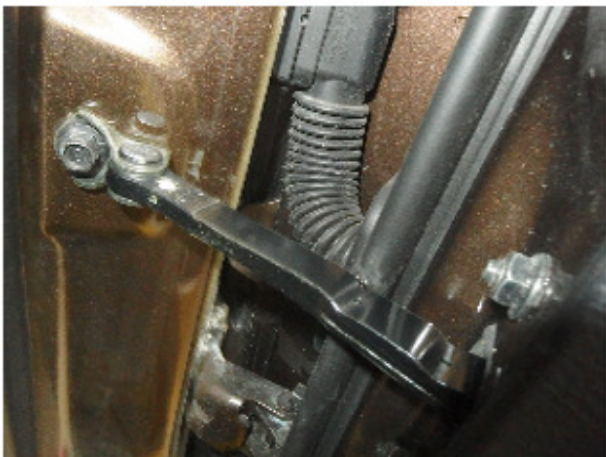




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

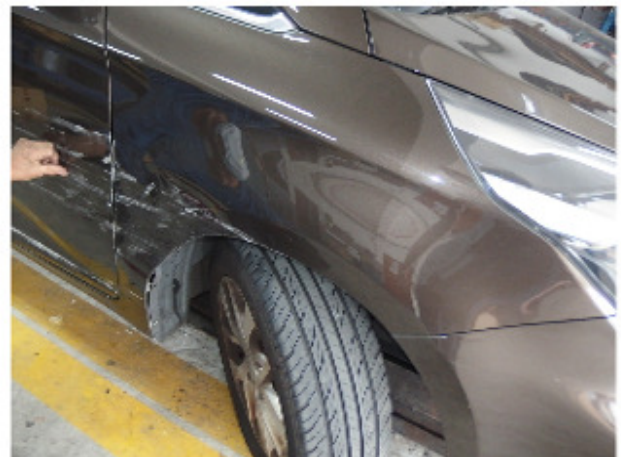



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLV 3347Y

RE-INSPECTION

