

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SME 8657Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	RHF DOOR	DENTED	1,426.70	1,324.70
1	RHF DOOR BLACK TAPE	NECESSARY	41.60	41.60
1	RHF DOOR FRAME GARNISH	NECESSARY	85.90	85.90
1	RHF DOOR OUTER HANDLE	DENTED / CUT	202.65	202.65
1	RHF DOOR KEY INSERT	SERVICEABLE	200.35	-
1	RHF DOOR KEY INSERT COVER	DENTED / CUT	23.70	23.70
1	RHF DOOR HANDLE BRACKET	CRACKED	79.60	79.60
1	RHF DOOR LOCK	DISTORTED	570.71	570.71
1	RHF DOOR WEATHER-STRIP	NECESSARY	184.70	184.70
1	RHF DOOR GLASS REGULATOR	DISTORTED	294.50	294.50
1	RHF DOOR GLASS REGULATOR MOTOR	MALFUNCTIONED	593.79	593.79
1	RHF DOOR SPEAKER	LOOP BROKEN	155.70	155.70
1	RHF DOOR TRIM BOARD	SERVICEABLE	971.40	-
1	RHR DOOR	DENTED	1,312.45	1,201.50
1	RHR DOOR BLACK TAPE	NECESSARY	45.90	45.90
1	RHR DOOR FRAME GARNISH	NECESSARY	85.90	85.90
1	RHR WEATHER-STRIP	SERVICEABLE	179.67	-
2	RHR DOOR HINGE @\$78.34	TO REPAIR SEE LABOUR	156.68	-
1	RHR DOOR CHECKER	SERVICEABLE	195.64	-
1	RH WING MIRROR ASSY	CRACKED	577.40	577.40
	LESS 25% DISCOUNT		-1,846.24	-1,367.06
			5,538.70	4,101.19
	<u>LABOUR</u>			
	CHECK LIGHTINGS & WIRINGS.		50.00	30.00
	TRANSFER RHF & RHR DOOR COMPONENTS.		250.00	100.00
	ANTI RUST PROOFING ON AFFECTED PANELS.		100.00	30.00
	RENEW DAMAGED PARTS, PANEL BEAT REFORM		750.00	500.00
	AFFECTED PANELS, ALIGN AFFECTED PORTION.			



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CONDUCT SPRAY PAINTING ON AFFECTED PANELS. INCLUSIVE OF THE REPAIR OF RHR DOOR HINGE.		800.00	500.00
			1,950.00	1,160.00
GRAND TOTAL			7,488.70	5,261.19
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,200.00

Report Ref No. CS1/LPC20007620/Eqf3e2

CHEN TSUE YEE

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.