

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	27 Jul 2020 Sendback Est	27 Jul 2020 16:10 \$59,671.50	28 Jul 2020 12:44 Edit Adj Rpt	\$46,200.00 Edit Estimates	\$46,200.00 View Rpt		Pending for Survey Report Cancel Case
Supp #1	17 Sep 2020 19:33	17 Sep 2020 19:35 \$1,060.84	17 Sep 2020 19:35			(Combined)	Combined with Main Uncombine Suppl.

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

Insured:	WU LI TRANSPORTATION , Co. Reg. No.: 38999200C		
Vehicle Reg. No.:	XD6080Z	Date of Loss:	24/07/2020 11:00 - :59 [96 Months and 6 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / SNM20D202599/C01/TANGHL2	Policy/Cover Note No.:	DMCVSNA00061472000 (Comprehensive) Coverage: 18/07/2020 - 17/07/2021
		Excess:	\$3,000.00
Repairer:	Goldbell Engineering Pte Ltd (Tuas) 10 Tuas Ave 18, 638894 Tuas - Tel: 6864 0695 / 6864 0698		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Ben Tang]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 07/08/2020]		
Driver/Custodian:	MA LIJIN (32 / Male) , NRIC: G6855837, Tel: +6587782018 Email: Wulitptn@gmail.com		
		Vehicle Source:	Tow-in/Call-man
Adj Asg. Remarks:	Excess \$3,000.00 applicable.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

- CHINA_TAIPING (13/10/2020): **Alert - Adj Mandate Approved (\$46200.00) - XD6080Z - Claim Handler: Ben Tang**
- CHINA_TAIPING (30/07/2020): **Alert - Adj Mandate Approved (\$43600.00) - XD6080Z - Claim Handler: Ben Tang**

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date Priority Type Task Group Subject Handler Assigned By Completed On Created On Done?

No results.

Claim Documents

**XD6080Z (SNM20D202599/C01/TANGHL2)
OD**

**Jul 24 2020 11:00AM
[WU LI TRANSPORTATION]
Goldbell Engineering Pte Ltd**

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View
[View in Browser](#)

Assessment Reports

1 per page ☒

No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)		Thumbnail	Print
1	27/07/20 16:10	Repairer Estimates		Load HTM	
2	17/09/20 19:35	Repairer Estimates Suppl. #1		Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	29/07/20 15:49	Adjuster Immediate Advice		Load HTM	
2	08/10/20 14:53	Adjuster Immediate Advice		Load HTM	

Photos/Images

3 per page ☒

No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)		Thumbnail	Print
1	27/07/20 16:08	Photos - Before		Load JPG	☒
2	27/07/20 16:08	Photos - Before		Load JPG	☒
3	27/07/20 16:08	Photos - Before		Load JPG	☒
4	27/07/20 16:08	Photos - Before		Load JPG	☒
5	27/07/20 16:08	Photos - Before		Load JPG	☒
6	27/07/20 16:08	Photos - Before		Load JPG	☒
7	27/07/20 16:08	Photos - Before		Load JPG	☒
8	27/07/20 16:08	Photos - Before		Load JPG	☒
9	27/07/20 16:08	Photos - Before		Load JPG	☒
10	27/07/20 16:08	Photos - Before		Load JPG	☒
11	27/07/20 16:08	Photos - Before		Load JPG	☒
12	27/07/20 16:08	Photos - Before		Load JPG	☒
13	27/07/20 16:08	Photos - Before		Load JPG	☒
14	27/07/20 16:08	Photos - Before		Load JPG	☒
15	27/07/20 16:08	Photos - Before		Load JPG	☒
16	27/07/20 16:08	Photos - Before		Load JPG	☒
17	27/07/20 16:08	Photos - Before		Load JPG	☒
18	27/07/20 16:08	Photos - Before		Load JPG	☒
19	27/07/20 16:08	Photos - Before		Load JPG	☒
20	27/07/20 16:08	Photos - Before		Load JPG	☒
21	27/07/20 16:08	Photos - Before		Load JPG	☒
22	27/07/20 16:08	Photos - Before		Load JPG	☒
23	27/07/20 16:08	Photos - Before		Load JPG	☒
24	27/07/20 16:08	Photos - Before		Load JPG	☒
25	27/07/20 16:08	Photos - Before		Load JPG	☒
26	27/07/20 16:08	Photos - Before		Load JPG	☒
27	27/07/20 16:08	Photos - Before		Load JPG	☒
28	27/07/20 16:08	Photos - Before		Load JPG	☒
29	27/07/20 16:08	Photos - Before		Load JPG	☒
30	27/07/20 16:08	Photos - Before		Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)		Thumbnail Print
31	27/07/20 16:08	Photos - Before		Load JPG ☒
32	27/07/20 16:08	Photos - Before		Load JPG ☒
33	27/07/20 16:08	Photos - Before		Load JPG ☒
34	27/07/20 16:08	Photos - Before		Load JPG ☒
35	27/07/20 16:08	Photos - Before		Load JPG ☒
36	27/07/20 16:08	Photos - Before		Load JPG ☒
37	27/07/20 16:08	Photos - Before		Load JPG ☒
38	27/07/20 16:08	Photos - Before		Load JPG ☒
39	27/07/20 16:08	Photos - Before		Load JPG ☒
40	27/07/20 16:08	Photos - Before		Load JPG ☒
41	27/07/20 16:08	Photos - Before		Load JPG ☒
42	27/07/20 16:08	Photos - Before		Load JPG ☒
43	27/07/20 16:08	Photos - Before		Load JPG ☒
44	27/07/20 16:08	Photos - Before		Load JPG ☒
45	27/07/20 16:08	Photos - Before		Load JPG ☒
46	27/07/20 16:08	Photos - Before		Load JPG ☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail Print
1	28/07/20 21:11	General View		Load JPG ☒
2	28/07/20 21:11	General View		Load JPG ☒
3	28/07/20 21:11	General View		Load JPG ☒
4	28/07/20 21:11	General View		Load JPG ☒
5	28/07/20 21:11	General View		Load JPG ☒
6	28/07/20 21:11	General View		Load JPG ☒
7	28/07/20 21:11	General View		Load JPG ☒
8	28/07/20 21:11	General View		Load JPG ☒
9	28/07/20 21:11	General View		Load JPG ☒
10	28/07/20 21:11	General View		Load JPG ☒
11	28/07/20 21:11	General View		Load JPG ☒
12	28/07/20 21:11	General View		Load JPG ☒
13	28/07/20 21:11	General View		Load JPG ☒
14	28/07/20 21:11	General View		Load JPG ☒
15	28/07/20 21:11	General View		Load JPG ☒
16	28/07/20 21:11	General View		Load JPG ☒
17	28/07/20 21:11	General View		Load JPG ☒
18	28/07/20 21:11	General View		Load JPG ☒
19	28/07/20 21:11	General View		Load JPG ☒
20	28/07/20 21:11	General View		Load JPG ☒
21	28/07/20 21:11	General View		Load JPG ☒
22	28/07/20 21:11	General View		Load JPG ☒
23	28/07/20 21:11	General View		Load JPG ☒
24	28/07/20 21:11	General View		Load JPG ☒
25	28/07/20 21:11	General View		Load JPG ☒
26	28/07/20 21:11	General View		Load JPG ☒
27	28/07/20 21:11	General View		Load JPG ☒
28	28/07/20 21:11	General View		Load JPG ☒
29	28/07/20 21:11	General View		Load JPG ☒
30	28/07/20 21:11	General View		Load JPG ☒
31	28/07/20 21:11	General View		Load JPG ☒

Assessment Reports			1 per page ▾	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)	Thumbnail	Print
32	28/07/20 21:11	General View	 Load JPG	☒
33	28/07/20 21:11	General View	 Load JPG	☒
34	28/07/20 21:11	General View	 Load JPG	☒
35	28/07/20 21:11	General View	 Load JPG	☒
36	28/07/20 21:11	General View	 Load JPG	☒
37	28/07/20 21:11	General View	 Load JPG	☒
38	28/07/20 21:11	General View	 Load JPG	☒
39	28/07/20 21:11	General View	 Load JPG	☒
40	28/07/20 21:11	General View	 Load JPG	☒
41	28/07/20 21:11	General View	 Load JPG	☒
42	28/07/20 21:11	General View	 Load JPG	☒
43	28/07/20 21:11	General View	 Load JPG	☒
44	28/07/20 21:11	General View	 Load JPG	☒
45	28/07/20 21:11	General View	 Load JPG	☒
46	28/07/20 21:11	General View	 Load JPG	☒
47	28/07/20 21:11	General View	 Load JPG	☒
48	28/07/20 21:11	General View	 Load JPG	☒
49	28/07/20 21:11	General View	 Load JPG	☒
50	28/07/20 21:11	General View	 Load JPG	☒
51	28/07/20 21:11	General View	 Load JPG	☒
52	28/07/20 21:11	General View	 Load JPG	☒
53	28/07/20 21:11	General View	 Load JPG	☒
54	28/07/20 21:11	General View	 Load JPG	☒
55	28/07/20 21:11	General View	 Load JPG	☒
56	28/07/20 21:11	General View	 Load JPG	☒
57	28/07/20 21:11	General View	 Load JPG	☒
58	28/07/20 21:11	General View	 Load JPG	☒
59	28/07/20 21:11	General View	 Load JPG	☒
60	28/07/20 21:11	General View	 Load JPG	☒
61	28/07/20 21:11	General View	 Load JPG	☒
62	28/07/20 21:11	General View	 Load JPG	☒
63	28/07/20 21:11	General View	 Load JPG	☒
64	28/07/20 21:11	General View	 Load JPG	☒
65	28/07/20 21:11	General View	 Load JPG	☒
66	28/07/20 21:11	General View	 Load JPG	☒
67	28/07/20 21:11	General View	 Load JPG	☒
68	28/07/20 21:11	General View	 Load JPG	☒
69	28/07/20 21:11	General View	 Load JPG	☒
70	28/07/20 21:11	General View	 Load JPG	☒
71	28/07/20 21:11	General View	 Load JPG	☒
72	28/07/20 21:11	General View	 Load JPG	☒
73	28/07/20 21:11	General View	 Load JPG	☒
74	28/07/20 21:11	General View	 Load JPG	☒
75	28/07/20 21:11	General View	 Load JPG	☒
76	28/07/20 21:11	General View	 Load JPG	☒
77	28/07/20 21:11	General View	 Load JPG	☒
78	28/07/20 21:11	General View	 Load JPG	☒
79	28/07/20 21:11	General View	Load JPG	☒

Assessment Reports			1 per page	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)	Thumbnail	Print
80	28/07/20 21:11	General View	 Load JPG	☒
81	28/07/20 21:11	General View	 Load JPG	☒
82	28/07/20 21:11	General View	 Load JPG	☒
83	28/07/20 21:11	General View	 Load JPG	☒
84	28/07/20 21:11	General View	 Load JPG	☒
85	28/07/20 21:11	General View	 Load JPG	☒
86	28/07/20 21:11	General View	 Load JPG	☒
87	28/07/20 21:11	General View	 Load JPG	☒
88	28/07/20 21:11	General View	 Load JPG	☒
89	28/07/20 21:11	General View	 Load JPG	☒
90	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
91	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
92	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
93	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
94	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
95	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
96	18/09/20 10:02	Photographs of Damaged Parts	 Load PDF	
97	18/09/20 10:02	Photographs of Damaged Parts	 Load PDF	
98	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
99	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
100	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
101	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
102	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
103	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
104	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
105	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
106	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
107	18/09/20 10:02	Reinspection Photo	 Load JPG	☒
108	18/09/20 10:02	Photographs of Damaged Parts	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)	Thumbnail	Print
1	08/10/20 09:51	Signed DV	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	29/07/20 15:53	ESTIMATE	 Load PDF	
2	08/10/20 14:48	estimate and supplementary	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)	Thumbnail	Print
1	27/07/20 11:29	Accident Statement	 Load HTM	
Photos/Images			3 per page	☒
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)	Thumbnail	Print
1	27/07/20 11:29	Accident Photo	 Load JPG	☒
2	27/07/20 11:29	Accident Photo	 Load JPG	☒
3	27/07/20 11:29	Accident Photo	 Load JPG	☒
4	27/07/20 11:29	Accident Photo	 Load JPG	☒

Assessment Reports			1 per page		
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)		Thumbnail	Print
5	27/07/20 11:29	Accident Photo		Load JPG	
6	27/07/20 11:29	Accident Photo		Load JPG	
7	27/07/20 11:29	Accident Photo		Load JPG	
8	27/07/20 11:29	Accident Photo		Load JPG	
9	27/07/20 11:29	Accident Photo		Load JPG	
10	27/07/20 11:29	Accident Photo		Load JPG	
11	27/07/20 11:29	Accident Photo		Load JPG	
12	27/07/20 11:29	Accident Photo		Load JPG	
13	27/07/20 11:29	Accident Photo		Load JPG	
14	27/07/20 11:29	Accident Photo		Load JPG	
15	27/07/20 11:29	Accident Photo		Load JPG	
16	27/07/20 11:29	Accident Photo		Load JPG	
17	27/07/20 11:29	Accident Photo		Load JPG	
18	27/07/20 11:29	Accident Photo		Load JPG	
19	27/07/20 11:29	Accident Photo		Load JPG	
Documentation			1 per page		
No	Finalized On	Goldbell Engineering Pte Ltd (Tuas)		Thumbnail	Print
1	27/07/20 11:24	Sketch Plan		Load TIF	
2	27/07/20 11:24	Sketch Plan #2		Load TIF	
3	27/07/20 11:25	Identification Card		Load TIF	
4	27/07/20 11:25	Driving License		Load TIF	
5	27/07/20 11:25	police report pg1		Load TIF	
6	27/07/20 11:25	police report pg2		Load TIF	
7	27/07/20 11:25	police report pg3		Load TIF	
8	27/07/20 11:25	CI		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST

Reset

Save

Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To:

☐ Repairer

☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI20007764/R1TF3S2**Date:** 20/10/2020REFERENCE

Insured/Claimant: WU LI TRANSPORTATION Policy No: DMCVSNA00061472000

Date of Loss: 24/07/2020

Nature of Claim: OD

Claim No: SNM20D202599/C01/TANGHL2

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **XD6080Z**

Make & Model: NISSAN GKB45CLBHN, 13.1 D (A)

Engine No: GE13339410B

Reg. Date: 18/07/2012 (Man. Year: 2011)

Chassis No: GKB4CLB00390

Colour: Blue

Odometer: 0 km

Engine Capacity: 13074 cc

Market Value/New Car Price: S\$66,000.00

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Fair Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 295/80 R22.5

Rear Tyre Size: 295/80 R22.5 (D)

Front Left Side: AUFINE 8 mm

Rear Left Side: AUFINE 8/8 mm

Front Right Side: AUFINE 8 mm

Rear Right Side: AUFINE 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	52,737.04	52,484.54	252.50	0.48
Miscellaneous Items	640.30	550.80	89.50	13.98
Labour	7,355.00	4,785.00	2,570.00	34.94
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	60,732.34	57,820.34	2,912.00	4.79
Approved Total (Overridden) (S\$)		46,200.00		
- Excess (S\$)	0.00	3,000.00	-3,000.00	
(S\$)	60,732.34	43,200.00	17,532.34	28.87
+ GST 7.00/7.00% (S\$)	4,251.27	3,024.00	1,227.27	28.87
Nett Amount (S\$)	64,983.61	46,224.00	18,759.61	28.87

INSPECTION

Date of Assignment: 28/07/2020 Present Location: Goldbell Engineering Pte Ltd (Tuas)
Date Inspected: 28/07/2020 Inspected At: 8 TUAS AVE 18 Singapore 638892
Estimated Period of Repair: 10.0 days Repairer: Goldbell Engineering Pte Ltd

Adjuster: MOHD RASUL**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 20 Oct 2020)	
Parts:	N/A	NISSAN GKB45CLBHNB 13.1 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for XD6080Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*CABIN ASSY	Buckled	34,617.00 F	*34,617.00 F
2	1		*UD EMBLEM	Necessary	50.50 F	*50.50 F
3	1		*INSTRUMENT PANEL (DASHBOARD)	Deformed	1,992.00 F	*1,992.00 F
4	1		*HEADLINING TOP	Deformed	1,650.40 F	*1,650.40 F
5	1		*TRIM , CAB RR END	Deformed	925.00 F	*925.00 F
6	1		*RH MIRROR STAY ASSY	Missing	313.54 F	*313.54 F
7	1		*RH MIRROR	Missing	150.00 F	*150.00 F
8	1		*LH MIRROR STAY ASSY, MOTOR TYPE	Distorted	550.00 F	*550.00 F
9	1		*LH ROUND MIRROR	Cracked	125.60 F	*125.60 F
10	1		*LH REAR VIEW MIRROR	Scratched	150.00 F	*150.00 F
11	1		*LH UNDER VIEW MIRROR	Scratched	135.50 F	*135.50 F
12	1		*RH FENDER ASSY	Deformed	780.00 F	*780.00 F
13	2		*CABIN FRONT SHOCK ABSORBER	Bent	636.00 F	*636.00 F
14	1		*CLUTCH/ BRAKE OIL RESERVOIR	Not Necessary	87.50 F	*- F
15	1		*BRAKE OIL	Not Necessary	15.00 F	*- F
16	1		*RH WIPER ARM WITH BLADE	Broken	110.00 F	*110.00 F
17	1		*WIPER LINKAGE	Bent	225.80 F	*225.80 F
18	1		*COOLANT SURGE TANK	Bent	778.46 F	*778.46 F
19	1		*COOLANT	Necessary	48.90 F	*48.90 F
20	1		*BRIDGE , CAB RR MOUNTING	Bent	3,320.00 F	*3,320.00 F
21	2		*CABIN REAR PNEUMATIC ABSORBER	Not Working	1,665.80 F	*1,665.80 F
22	1		*STEERING SHAFT	Bent	1,760.00 F	*1,760.00 F
23	1		*SENSOR ASSY,ACCELERATION PEDAL CONTROL	Bent	1,420.00 F	*1,420.00 F
24	1		*RH SIDE STEP LOWER GARNISH	Cracked	175.00 F	*175.00 F
25	1		*RH SIDE STEP	Old Damage	150.00 F	*- F
Supplementary #1						
26	2		*SHOCK ABSORBER ,CAB RR MOUNTING	Bent	651.40 F	*651.40 F
27	1		*ROD CAB RR MOUNTING LATERAL	Bent	253.64 F	*253.64 F
Total Parts (\$\$)					52,737.04	52,484.54

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	COMPANY STICKER (FRONT PANEL) (NECESSARY)	75.00	75.00
2	1	COMPANY STICKER (LH DOOR PANEL) (NECESSARY)	75.00	75.00
3	1	COMPANY STICKER (LH REAR PILLAR) (NECESSARY)	75.00	75.00
4	1	COMPANY STICKER (RH DOOR PANEL) (NECESSARY)	75.00	75.00
5	1	COMPANY STICKER (ROOF TOP) (NECESSARY)	75.00	75.00
6	1	ERP BRACKET (NECESSARY)	20.00	20.00
7	1	UD SPEED LIMITER STICKER (WINDSCREEN)	89.50	0.00
Supplementary #1				
8	1	IU UNIT (NOT WORKING)	155.80	155.80
Sub Total (\$\$)			640.30	550.80

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIX DAMAGED PARTS, CUT, WELD,PANEL BEAT,STRAIGHTEN & REALIGN,ETC	New	3,800.00	1,750.00
2	TO CHECK FOR AND RECTIFY WIRING FAULTS,TO CONDUCT DIAGNOSTICS CHECK. (PRE REPAIR CHECK AND POST REPAIR CHECK)	New	180.00	120.00
3	TO TRANSFER/REMOVE/INSTALL DOOR LOCK MECHANISM,CUSHION SEAT/GEAR LEVER/WIRING HARNESS	New	450.00	400.00
4	TO REFIX DASHBOARD	New	250.00	250.00
5	TO REMOVE & REFIX POWER STEERING TANK ASSY/COOLANT SPARE TANK/ BRAKE SYSTEM, TO CHECK FUNCTION	New	600.00	350.00
6	TO ADJUST ALIGNMENT	New	75.00	75.00
7	TO REMOVE AND REFIX AIRCON SYSTEM. TO CHECK FUNCTION	New	450.00	400.00
8	SUNDRIES	New	55.00	55.00
9	TO APPLY TUFF COAT	New	85.00	85.00
10	TO PUTTY, CLEAN,SPRAY PAINT AND POLISH,ETC (WHOLE CAB)	New	1,350.00	1,300.00
11	ROAD TEST FOR WORTHINESS AND SPEED LIMITER CUT OFF	New	60.00	0.00
Gross Labour Cost (\$\$)			7,355.00	4,785.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >