

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI20007794/BVF3E2

Date: 09/09/2020

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSN30585519022
Claimant Vehicle No :	GBJ9049A	Insured Vehicle No :	GBF2362L
Date of Loss:	24/07/2020	Nature of Claim:	TP
		Claim No:	SNM20D202584/C02/TAYHP

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBJ9049A	Engine No:	1KD2868404
Make & Model:	TOYOTA HIACE, 2.0 (M)	Chassis No:	JTFHT02P800249481
Reg. Date:	25/09/2019 (Man. Year: 2019)	Odometer:	24062 km
Colour:	White		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195 R15	Rear Tyre Size:	195 R15
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	33,636.37	13,545.74	20,090.63	59.73
Miscellaneous Items	0.00	0.00	0.00	
Labour	9,910.00	4,060.00	5,850.00	59.03
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	43,546.37	17,605.74	25,940.63	59.57
Approved Total (Overridden) (S\$)		14,000.00		
Nett Amount (S\$)	43,546.37	14,000.00	29,546.37	67.85

INSPECTION

Date of Assignment:	28/07/2020	
Date Inspected:	28/07/2020 Inspected At:	Team Auto Pro Pte Ltd - Sin Ming (HQ) 160 Sin Ming Drive #01-14 Sin Ming Autocity Singapore 575722
Estimated Period of Repair:	14.0 days	

Adjuster: Lim Teow Guan

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 09 Sep 2020)	
Parts:	N/A	TOYOTA HIACE 2.0 (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBJ9049A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Dented	2,154.60 FL	*1,700.00 FL
2	1		*TAILGATE OUTER HANDLE GARNISH	Broken	364.70 FL	*220.00 FL
3	2		*TAILGATE NUMBER PLATE LAMP	Not Damaged	249.00 FL	*- FL
4	1		*TAILGATE LOGO	Necessary	80.00 FL	*61.00 FL
5	1		*TAILGATE EMBLEM TOYOTA	Necessary	79.00 FL	*79.00 FL
6	1		*TAILGATE EMBLEM HIACE	Necessary	72.30 FL	*72.30 FL
7	2		*TAILGATE STOPPER	Not Damaged	56.00 FL	*- FL
8	2		*TAILGATE DAMPER	Not Damaged	116.00 FL	*- FL
9	1		*TAILGATE TOP TRIM	Broken	198.50 FL	*198.50 FL
10	1		*TAILGATE INNER TRIMBOARD	Not Damaged	272.60 FL	*- FL
11	1		*TAILGATE INNER LOCK	Jammed	285.00 FL	*285.00 FL
12	1		*TAILGATE OUTER KEY LOCK	Not Damaged	398.40 FL	*- FL
13	1		*TAILGATE OUTER LOCK HANDLE	Not Damaged	469.00 FL	*- FL
14	1		*TAILGATE OUTER SWITCH BUTTON	No such part	396.60 FL	*- FL
15	1		*TAILGATE LOCK MOTOR	No such part	426.70 FL	*- FL
16	2		*TAILGATE HINGE	Not Damaged	179.00 FL	*- FL
17	1		*TAILGATE WEATHERSTRIP	Distorted	379.10 FL	*289.00 FL
18	1		*TAILGATE WEATHERSTRIP PROTECTOR	Dented	194.00 FL	*175.70 FL
19	1		*TAILGATE WIPER ARM	Not Damaged	114.40 FL	*- FL
20	1		*TAILGATE WIPER ARM MOTOR	Bent	569.80 FL	*569.80 FL
21	1		*TAILGATE WINDSCREEN	Broken	1,304.20 FL	*790.00 FL
22	1		*TAILGATE WINDSCREEN MOULDING	Necessary	185.20 FL	*185.20 FL
23	2		*TAILLAMP	Broken	975.20 FL	*777.00 FL
24	2		*TAILLAMP LOWER GARNISH	Broken	258.60 FL	*258.60 FL
25	2		*TAILLAMP LOWER GARNISH RETAINER	Not Necessary	130.00 FL	*- FL
26	2		*TAILLAMP BASE PANEL	Not Damaged	709.60 FL	*- FL
27	2		*REAR SIDE PANEL (OUTER)	Repair	3,864.80 FL	*- FL
28	2		*REAR SIDE INNER LOWER PANEL	Dented	1,509.60 FL	*1,509.60 FL
29	2		*REAR SIDE LOWER CORNER INNER PANEL	No such part	375.00 FL	*- FL
30	1		*REAR BUMPER STEP PANEL	No such part	457.00 FL	*- FL
31	1		*REAR END PANEL (INNER)	Not Damaged	1,140.00 FL	*- FL
32	1		*REAR END PANEL (OUTER)	Dented	597.00 FL	*597.00 FL
33	1		*REAR FLOOR PANEL	Dented	1,960.00 FL	*1,000.00 FL
34	1		*REAR FLOOR PANEL MAT	Not Damaged	1,591.50 FL	*- FL
35	1		*REAR SPARE TYRE BRACKET	Bent	587.40 FL	*395.00 FL
36	1		*REAR SPARE TYRE BRACKET BOLT	Not Damaged	106.30 FL	*- FL
37	1		*SIDE BODY PANEL LH	Repair	2,219.50 FL	*- FL
38	1		*REAR BUMPER	Dented	479.00 FL	*357.50 FL
39	2		*REAR BUMPER SIDE RETAINER	Necessary	130.60 FL	*130.60 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	4		*REAR BUMPER LOWER BRACKET	Necessary	312.80 FL	*312.80 FL
41	1		*REAR AIR VENT	Not Damaged	87.60 FL	*- FL
42	1		*REAR EXHAUST PIPE	Not Damaged	1,764.80 FL	*- FL
43	2		*REAR EXHAUST PIPE MOUNTING	Not Damaged	116.00 FL	*- FL
44	1		*BONNET	Dented	784.20 FL	*784.20 FL
45	1		*BONNET LOGO	Necessary	80.00 FL	*66.00 FL
46	1		*BONNET LOCK	Bent	95.80 FL	*95.80 FL
47	1		*BONNET LOCK STICKER	Not Necessary	55.80 FL	*- FL
48	2		*BONNET HINGE	Not Damaged	130.40 FL	*- FL
49	1		*FRONT BUMPER	Repair	634.50 FL	*- FL
50	1		*FRONT BUMPER BRACKET	Not Damaged	490.00 FL	*- FL
51	1		*FRONT BUMPER SIDE RETAINER	Necessary	195.80 FL	*118.45 FL
52	1		*FRONT BUMPER REINFORCEMENT	Not Damaged	329.20 FL	*- FL
53	1		*FRONT CORNER PANEL LH	Not Damaged	347.80 FL	*- FL
54	1		*FRONT SUPPORT PANEL	Dented	384.20 FL	*384.20 FL
55	1		*FRONT SUPPORT PANEL TOP CAVER	No such part	187.40 FL	*- FL
56	1		*FRONT SUPPORT PANEL TOP CAVER RUBBER	No such part	132.00 FL	*- FL
57	2		*HEADLAMP	Broken	1,308.60 FL	*1,308.60 FL
58	2		*HEADLAMP LOWER BRACKET	No such part	156.00 FL	*- FL
59	1		*RADIATOR	Dented	2,007.50 FL	*1,495.00 FL
60	1		*A/C CONDENSER	Dented	1,430.50 FL	*987.70 FL
61	1		*INTERCOOLER	Dented	1,108.60 FL	*1,108.60 FL
62	1		*WIPER WASHER TANK	Dented	324.70 FL	*89.70 FL
63	1		*RADIATOR SPARE TANK	Dented	195.80 FL	*195.80 FL
64	1		*SUNDRIES	Not Necessary	80.00 FS	*- FS
65	1		*TAILGATE SEALANT	Necessary	100.00 FS	*30.00 FS
66	1		*TAILGATE OUTER HANDLE GARNISH CLIPS	Necessary	50.00 FS	*30.00 FS
67	1		*TAILGATE TOP TRIM CLIPS	Necessary	50.00 FS	*30.00 FS
68	1		*TAILGATE INNER TRIMBOARD CLIPS	Necessary	50.00 FS	*30.00 FS
69	1		*TAILGATE STICKER 70KM/H	Necessary	40.00 FS	*20.00 FS
70	1		*TAILGATE WINDSCREEN GLASS SEALANT	Necessary	120.00 FS	*80.00 FS
71	1		*TAILGATE WINDSCREEN GLASS INNER SEAL	No such part	60.00 FS	*- FS
72	1		*TAILGATE WINDSCREEN PRIMER AND CLEANER	Not Necessary	80.00 FS	*- FS
73	1		*TAILGATE WINDSCREEN GLASS SOLAR FILM	Not Necessary	280.00 FS	*- FS
74	2		*TAILLAMP CLIPS	Necessary	100.00 FS	*30.00 FS
75	2		*TAILLAMP SEAL	Necessary	120.00 FS	*30.00 FS
76	2		*TAILLAMP LOWER GARNISH CLIPS	No such part	100.00 FS	*- FS
77	2		*TAILLAMP BASE PANEL SEALANT	Necessary	200.00 FS	*50.00 FS
78	2		*REAR SIDE PANEL (OUTER) SEALANT	Not Necessary	200.00 FS	*- FS
79	2		*REAR SIDE INNER LOWER PANEL SEALANT	Not Necessary	200.00 FS	*- FS
80	2		*REAR SIDE LOWER CORNER INNER PANEL SEALANT	Not Necessary	200.00 FS	*- FS
81	1		*REAR BUMPER STEP PANEL SEALANT	Not Necessary	100.00 FS	*- FS
82	1		*REAR END PANEL SEALANT	Necessary	100.00 FS	*30.00 FS
83	1		*REAR FLOOR PANEL SEALANT	Necessary	100.00 FS	*30.00 FS
84	1		*REAR FLOOR PANEL WOODEN BOARD	Not Damaged	800.00 FS	*- FS
85	1		*SIDE BODY PANEL SEALANT	Not Necessary	120.00 FS	*- FS
86	1		*REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
87	2		*REVERSE SENSOR	Short Circuit	500.00 FS	*200.00 FS
88	1		*REAR NUMBER PLATE	Bent	80.00 FS	*30.00 FS
89	1		*BONNET SEALANT	Necessary	100.00 FS	*30.00 FS
90	1		*FRONT BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
91	1		*FRONT BUMPER GRILLE CLIPS	Necessary	50.00 FS	*30.00 FS
92	1		*FRONT SUPPORT PANEL SEALANT	Not Necessary	100.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
93	1		*FRONT SUPPORT PANEL TOP CAVER CLIPS	Not Necessary	50.00 FS	*- FS
94	1		*COOLANT	Necessary	80.00 FS	*40.00 FS
95	1		*A/C FLUID	Necessary	80.00 FS	*80.00 FS
96	1		*FRONT NUMBER PLATE	Bent	80.00 FS	*20.00 FS
97	1		*TAILGATE LOWER LOCK	Not Necessary	45.00 FL	*- FL
98	1		*FRONT BUMPER GRILLE	Broken	548.30 FL	*290.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	43,358.50	17,767.65
- List Item Discount on L Items 25.00/25.00% (\$\$)	9,722.13	4,221.91
Total Parts (\$\$)	33,636.37	13,545.74

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	R&R TAILGATE WINDSCREEN	New	150.00	120.00
2	R&R TAILGATE COMPONENT	New	150.00	70.00
3	R&R REVERSE SENSOR	New	120.00	60.00
4	R&R REAR EXHAUST PIPE	New	150.00	0.00
5	R&R REAR FLOOR BOARD	New	300.00	0.00
6	REAR CHECK WIRING	New	80.00	50.00
7	REAR UPHOLSTERY	New	300.00	0.00
8	REAR RUST PROOFING	New	200.00	60.00
9	REAR PANEL BEAT	New	2,000.00	1,200.00
10	REAR SPRAY PAINTING	New	2,000.00	800.00
11	R&R BONNET COMPONENT	New	150.00	50.00
12	R&R RADIATOR	New	150.00	70.00
13	R&R A/C CONDENSER	New	150.00	70.00
14	R& R INTERCOOLER	New	150.00	70.00
15	R&R WIPER WASHER TANK	New	80.00	40.00
16	R&R RADIATOR SPARE TANK	New	80.00	40.00
17	FRONT UPHOLSTERY	New	300.00	0.00
18	FRONT RUST PROOFING	New	200.00	60.00
19	FRONT PANEL BEAT	New	1,600.00	800.00
20	FRONT SPRAY PAINTING	New	1,600.00	500.00
Gross Labour Cost (S\$)			9,910.00	4,060.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >