



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV No. AC2006384
INV Date 16/09/2020
Reference CC3/FCI20007817/Kka3s2
Code FCI2



PROFESSIONAL SERVICE FEE

Vehicle No. SHD 9715X
Insured Veh. SHB 6390D
Claim No. D20003018MFSH
Policy No. D-18088937MFSH
Accident Date 26/07/2020
Inspection Date 28/07/2020

Description	Total
Survey Inspection	350.00
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD		Ref : CC3/FCI20007817/Kka3s2		
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 16-09-2020		
		Code : FCI2		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHB 6390D	Veh. Inspected	SHD 9715X	
Policy No.	D-18088937MFSH	Coverage (\$)	0.00	
Claim No.	D20003018MFSH	Excess (\$)	0.00	
Assign From		Assign Date	28/07/2020	
2. Vehicle Particulars & Condition				
Make & Model	RENAULT LATITUDE (A)	c.c	1995	
Engine No.	HIDDEN	Year of Reg.	2013	
Chassis No.	VF1ABL15AUC276046	Colour	METALLIC WHITE / RED	
Odometer	544594	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	215/60 R16	SAILUN	7 mm	
L/H Front Tyre	215/60 R16	SAILUN	7 mm	
R/H Rear Tyre	215/60 R16	SAILUN	8 mm	
L/H Rear Tyre	215/60 R16	SAILUN	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/07/2020	Inspection Date	28/07/2020	
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 9715X

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	MTG CRACKED	747.20	747.20
1	BUMPER SPOILER FRT	SERVICEABLE	344.70	-
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER BRACKET FRT LH (HEADLAMP LOWER)	SERVICEABLE	116.47	-
1	BUMPER RETAINER FRT LH	CRACKED	101.40	101.40
1	BUMPER UNDERTRAY FRT	SERVICEABLE	292.50	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	147.00	-
1	HEADLAMP LH	MTG CRACKED	743.60	743.60
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	128.30	-
1	FENDER PANEL FRT LH	BENT	437.10	437.10
1	WHEELARCH FRT LH	CRACKED	191.40	191.40
1	FENDER BRACKET FRT LH	SERVICEABLE	106.40	-
1	FENDER INSULATOR LH	SERVICEABLE	66.30	-
1	RADIATOR GRILLE	SERVICEABLE	969.90	-
1	RADIATOR GRILLE BADGE 'RENAULT'	SERVICEABLE	225.36	-
1	RADIATOR GRILLE FRAME	SERVICEABLE	686.00	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-
1	BONNET	TO REPAIR SEE LABOUR	1,312.70	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	236.50	-
1	AIR CLEANER LOWER	SERVICEABLE	271.26	-
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR MIRROR ASSY LH	CRACKED	1,483.40	1,483.40
1	DOOR HINGE UPPER LH	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRT LH	SERVICEABLE	90.90	-

Report Ref No. CC3/FCI20007817/Kka3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	DOOR FINISHER FRT LH	SERVICEABLE	258.90	-
1	DOOR FINISHER CLIP KIT FRT LH	NOT NECESSARY	94.00	-
1	DOOR HANDLE OUTER FRT LH	SERVICEABLE	169.50	-
1	DOOR PANEL REAR LH	TO REPAIR SEE LABOUR	2,844.66	-
1	LOWER ARM LH	SERVICEABLE	192.70	-
1	ABSORBER FRT LH	SERVICEABLE	274.10	-
1	KNUCKLE ARM LH	SERVICEABLE	481.50	-
1	DRIVESHAFT LH	TO REPAIR SEE LABOUR	1,355.70	-
1	KNUCKLE HUB+BEARING LH	NOT NECESSARY	272.30	-
1	SUBFRAME OUTER FRT	SERVICEABLE	1,094.20	-
	LESS 10% DISCOUNT		-2,078.31	-370.41
			18,704.78	3,333.69
	<u>SPECIAL NETT ITEMS</u>			
1	BUMPER CLIP FRT (SN)	NECESSARY	75.00	75.00
1	BUMPER BRACKET CLIP FRT LH (SN)	NOT NECESSARY	60.00	-
1	BUMPER RETAINER CLIP FRT LH (SN)	NOT NECESSARY	65.00	-
1	BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	69.00	-
1	BUMPER SPOILER CLIP (SN)	NOT NECESSARY	60.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	45.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	45.00	-
1	WHEELARCH CLIP FRT LH (SN)	NECESSARY	65.00	65.00
1	FRONT LEFT TYRE (SN)	SERVICEABLE	300.00	-
1	FRONT LEFT TYRE RIM (SN)	SERVICEABLE	380.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	100.00	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	50.00	-
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	55.00	-
1	FRONT DOOR STICKER 'TRANS-CAB' (SN)	NECESSARY	80.00	60.00
1	FRONT DOOR STICKER 'CLASSIC' (SN)	NECESSARY	80.00	15.00
1	REAR DOOR STICKER "6555-3333" (SN)	NECESSARY	100.00	60.00
			1,699.00	275.00

Report Ref No. CC3/FCI20007817/Kka3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		4,000.00	880.00
	TO TRANSFER OF REAR DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE REPAIR OF HEADLAMP PANEL FRT LH, BONNET, BONNET HINGE LH, DOOR PANEL FRT LH, DOOR HINGE UPPER LH, DOOR HINGE LOWER LH, DOOR PANEL REAR LH AND DRIVESHAFT LH.		4,000.00	500.00
	TO TRANSFER OF FRONT FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF BONNET FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF FRONT BUMPER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GARNISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO DISMANTLE AND REFIT FRONT END SUSPENSION, UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	30.00
	TO CHECK ABS AND BRAKE EFFICIENCY, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT ENGINE CROSS-MEMBER AND ENGINE MOUNTING.	NOT NECESSARY	380.00	-
			11,180.00	1,430.00
	GRAND TOTAL		31,583.78	5,038.69

Report Ref No. CC3/FCI20007817/Kka3s2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			4,050.00
---	--	--	----------

Report Ref No. CC3/FCI20007817/Kka3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 9715X

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

