

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTAIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way #07-16
Singapore 079120**Our File No:** CS/AIG20007938/R1VF3E2**Date:** 19/10/2020**REFERENCE**

Insured/Claimant:	YEO CHERN YE	Policy No:	1700010091
Date of Loss:	30/07/2020	Nature of Claim:	OD
		Claim No:	4879735774SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLP2348H		
Make & Model:	MITSUBISHI OUTLANDER, 2.4 CVT 4WD (A)	Engine No:	4B12SY4875
Reg. Date:	30/05/2017 (Man. Year: 2017)	Chassis No:	JMYXTGF3WHZ001810
Colour:	Red	Odometer:	72417 km
Engine Capacity:	2360 cc		
Market Value/New Car Price:	S\$74,500.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55 R18	Rear Tyre Size:	225/55 R18
Front Left Side:	Roadstone 6 mm	Rear Left Side:	Roadstone 6 mm
Front Right Side:	Roadstone 6 mm	Rear Right Side:	Roadstone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	23,155.99	16,076.03	7,079.96	30.58
Miscellaneous Items	0.00	0.00	0.00	
Labour	11,960.00	6,410.00	5,550.00	46.40
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	35,115.99	22,486.03	12,629.96	35.97
Approved Total (Overridden) (S\$)		22,000.00		
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	34,515.99	21,400.00	13,115.99	38.00
+ GST 7.00/7.00% (S\$)	2,416.12	1,498.00	918.12	38.00
Nett Amount (S\$)	36,932.11	22,898.00	14,034.11	38.00

INSPECTION

Date of Assignment:	03/08/2020
Date Inspected:	03/08/2020 Inspected At:

Cycle & Carriage Automotive Pte Ltd
(Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 13.0 days

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT WINDSCREEN SEALANT	Not Necessary	80.00 FS	*- FS
2	1		*FRONT WINDSCREEN SOLAR FILM	Not Necessary	220.00 FS	*- FS
3	1		*SUNDRIES	Necessary	50.00 FS	*30.00 FS
4	1		*PNL, HEADLAMP SUPT, UPR RH	Repair	58.00 FL	*- FL
5	1		*PANEL, HEADLAMP SUPPORT, UPR	Bent	229.00 FL	*229.00 FL
6	1		*PNL, HEADLAMP SUPT, UPR LH	Bent	58.00 FL	*58.00 FL
7	1		*PANEL, HEADLAMP SUPPORT, LWR	Bent	107.00 FL	*107.00 FL
8	1		*PANEL, HEADLAMP SUPPORT, LH	Bent	58.00 FL	*58.00 FL
9	1		*PANEL, HEADLAMP SUPPORT, RH	Bent	58.00 FL	*58.00 FL
10	1		*EXTENSION, FR SIDEMEMBER, LH	Serviceable	58.00 FL	*- FL
11	1		*EXTENSION, FR SIDE MEMBER, RH	Serviceable	58.00 FL	*- FL
12	1		*SENSOR, AIR BAG, LH	Activated	292.00 FL	*292.00 FL
13	1		*SENSOR, AIR BAG, RH	Activated	292.00 FL	*292.00 FL
14	1		*MOTOR, COOLING FAN, LH (120W)	Serviceable	479.00 FL	*- FL
15	1		*MOTOR, COOLING FAN, LH (120W)	Serviceable	479.00 FL	*- FL
16	1		*SHROUD, COOLING FAN	Cracked	258.00 FL	*258.00 FL
17	1		*FAN COOLING, LH	Serviceable	78.00 FL	*- FL
18	1		*TANK ASSY, RADIATOR COND	Deformed	103.00 FL	*103.00 FL
19	1		*RADIATOR ASSY	Bent	1,091.00 FL	*1,091.00 FL
20	1		*CONDENSER ASSY, A/C REFRIGE	Bent	857.00 FL	*857.00 FL
21	1		*HOSE, A/C COMPR DISCHARGE	Bent	191.00 FL	*191.00 FL
22	1		*PIPE, A/C CONDENSER OUTLET	Serviceable	262.00 FL	*- FL
23	1		*DUCT, A/C CLNR INTAKE	Scratched	187.00 FL	*187.00 FL
24	12		*CLIP, FR BUMPER	Necessary	48.00 FL	*48.00 FL
25	1		*MANIFOLD, INLET	Serviceable	932.00 FL	*- FL
26	1		*LLC 4L	Necessary	26.00 FL	*26.00 FL
27	1		*COVER, HEADLAMP SUPT PANEL	Deformed	50.00 FL	*50.00 FL
28	6		*CLIP, RR BUMPER	Not Necessary	18.00 FL	*- FL
29	1		*COVER, FR BUMPER	Serviceable	25.00 FL	*- FL
30	1		*GRILLE ASSY, RADIATOR	Cracked	569.00 FL	*569.00 FL
31	1		*BRACKET, RADIATOR GRILLE, RH	Necessary	17.00 FL	*17.00 FL
32	1		*BRACKET, RADIATOR GRILLE, LH	Necessary	13.00 FL	*13.00 FL
33	8		*CLIP, ENG ROOM COVER	Not Necessary	16.00 FL	*- FL
34	1		*BRACKET, FR BUMPER SIDE, LH	Necessary	18.00 FL	*18.00 FL
35	1		*BRACKET, FR BUMPER SIDE, RH	Necessary	18.00 FL	*18.00 FL
36	1		*COVER, FR BUMPER	Serviceable	5.00 FL	*- FL
37	10		*CLIP, ENG ROOM COVER	Serviceable	15.40 FL	*- FL
38	1		*FACE, FR BUMPER	Deformed	859.00 FL	*859.00 FL
39	1		*EXTENSION, FR BUMPER	Scratched	426.00 FL	*426.00 FL
40	1		*COVER, FR BUMPER	Deformed	280.00 FL	*280.00 FL
41	1		*BRKT, FR BUMPER SIDE, LWR LH	Necessary	6.00 FL	*6.00 FL
42	1		*BRKT, FR BUMPER SIDE, LWR RH	Necessary	5.00 FL	*5.00 FL
43	1		*GARNISH, FR BUMPER, LH	Serviceable	78.00 FL	*- FL
44	1		*GARNISH, FR BUMPER, RH	Serviceable	78.00 FL	*- FL
45	1		*COVER, FR FOG LAMP LH	Serviceable	20.00 FL	*- FL
46	1		*COVER, FR FOG LAMP RH	Serviceable	20.00 FL	*- FL
47	1		*LH GARNISH, FR BUMPER SIDE	Serviceable	48.00 FL	*- FL
48	1		*RH GARNISH, FR BUMPER SIDE	Serviceable	48.00 FL	*- FL
49	1		*LH GARNISH, FR BUMPER SIDE	Cracked	220.00 FL	*220.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	1		*RH GARNISH, FR BUMPER SIDE	Cracked	220.00 FL	*220.00 FL
51	1		*LH GARNISH, FR BUMPER SIDE	Serviceable	112.00 FL	*- FL
52	1		*RH GARNISH, FR BUMPER SIDE	Cracked	112.00 FL	*112.00 FL
53	1		*REINF, FR BUMPER SIDE, RH	Bent	69.00 FL	*69.00 FL
54	1		*REINFORCEMENT, FR BMPR SIDE	Serviceable	22.00 FL	*- FL
55	1		*REINF, FR BUMPER SIDE, LH	Bent	60.00 FL	*60.00 FL
56	1		*REINFORCEMENT, FR BUMPER	Bent	134.00 FL	*134.00 FL
57	1		*CTR REINFORCEMENT, FR BUMPER	Bent	503.00 FL	*503.00 FL
58	1		*HEADLAMP ASSY, LH	Cracked	810.00 FL	*810.00 FL
59	1		*HEADLAMP ASSY, RH	Cracked	810.00 FL	*810.00 FL
60	1		*LAMP ASSY, FOG, FR	Serviceable	223.00 FL	-
61	1		*LAMP ASSY, FOG, FR	Serviceable	223.00 FL	*- FL
62	1		*HOOD	Bent	975.00 FL	*975.00 FL
63	1		*HINGE, HOOD, LH	Bent	68.00 FL	*68.00 FL
64	1		*HINGE, HOOD, RH	Bent	68.00 FL	*68.00 FL
65	1		*INSULATOR, HOOD	Deformed	133.00 FL	*133.00 FL
66	1		*WEATHERSTRIP, HOOD	Necessary	40.00 FL	*40.00 FL
67	1		*WEATHERSTRIP, HOOD	Necessary	41.00 FL	*41.00 FL
68	1		*LATCH, HOOD	Bent	76.00 FL	*76.00 FL
69	2		*DAMPER, HOOD	Necessary	6.00 FL	*6.00 FL
70	1		*FENDER, FR LH	Buckled	688.00 FL	*688.00 FL
71	1		*FENDER, FR RH	Buckled	688.00 FL	*688.00 FL
72	1		*INSULATOR, FR FENDER, LH	Deformed	60.00 FL	*60.00 FL
73	1		*INSULATOR, FR FENDER, RH	Deformed	60.00 FL	*60.00 FL
74	1		*PANEL ASSY, FR DOOR, RH	Repair	977.00 FL	*- FL
75	1		*MLDG, F/DR WDO BELT LINE, RH	Serviceable	89.00 FL	*- FL
76	1		*TAPE, FR DOOR SASH, RH	Serviceable	42.00 FL	*- FL
77	1		*GLASS, WINDSHIELD	Serviceable	1,523.00 FL	*- FL
78	2		*STOPPER, WINDSHIELD GLASS	Not Necessary	6.00 FL	*- FL
79	1		*MOULDING, WINDSHIELD	Not Necessary	78.00 FL	*- FL
80	2		*MOULDING, WINDSHIELD SIDE	Not Necessary	184.00 FL	*- FL
81	3		*SPACER, QTR WINDOW	Not Necessary	24.00 FL	*- FL
82	1		*BRACKET, IU ADHESIVE	Not Necessary	26.00 FS	*- FS
83	1		*MODULE, AIR BAG	Activated	1,081.00 FL	*1,081.00 FL
84	1		*CONT UNIT, SRS DIAGNOSIS	Activated	1,040.00 FL	*1,040.00 FL
85	1		*MODULE, PASSENGER AIR BAG	Activated	2,337.00 FL	*2,337.00 FL
86	1		*PANEL, INSTRUMENT	Torn	1,121.00 FL	*1,121.00 FL
87	1		*MODULE, DRIVER KNEE AIR BAG	Activated	1,065.00 FL	*1,065.00 FL
88	1		*S/BELT, FR PRE-TENSIO, OTR R	Activated	667.00 FL	*667.00 FL
89	1		*S/BELT, FR PRE-TENSIO, OTR L	Activated	667.00 FL	*667.00 FL
90	1		*ADJUSTER, FR S/BELT ANCH, LH	Serviceable	67.00 FL	*- FL
91	1		*ADJUSTER, FR S/BELT ANCH, RH	Serviceable	67.00 FL	*- FL
92	1		*WHEELHOUSE, FR INR LH	Serviceable	590.00 FL	*- FL
93	1		*PANEL, INSTRUMENT, LWR	Cracked	58.00 FL	*58.00 FL
94	1		*COVER, INSTRUMENT PANEL, LWR	Cracked	56.00 FL	*56.00 FL
95	1		*PANEL, INSTRUMENT, LWR CTR	Serviceable	112.00 FL	*- FL
96	1		*THROTTLE BODY ASSY	Serviceable	1,501.00 FL	*- FL
97	1		*HARNESS, FOG LAMP	Serviceable	130.00 FL	*- FL
98	1		*COVER,ENG ROOM UNDER,FR	Cracked	348.00 FL	*348.00 FL
99	10		*CLIP,HOOD INSULATOR	Necessary	30.00 FL	*30.00 FL
100	1		*SPRING,AIR BAG SENDOR	Necessary	334.00 FL	*334.00 FL
101	6		*RIVET,FR BUMPER	Necessary	30.00 FL	*30.00 FL
102	1		*TUBE ASSY,T/M O/CLR LINE	Cut	48.00 FL	*48.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
F=Franchise part. S=SpcNett. L=ListItemDisc.							
					Sub Total (\$\$)	29,960.40	20,869.00
					- List Item Discount on L Items 23.00/23.00% (\$\$)	6,804.41	4,792.97
					Total Parts (\$\$)	23,155.99	16,076.03

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW ACCIDENT DAMAGED PARTS ON FRONT SUPPORT PANEL, FRONT BUMPER, RH FRONT FENDER, LH FRONT FENDER, RH FRONT DOOR, REPAIR LH FRONT DOOR, REPAIR FRONT CHASSIS MEMBER, CUT/WELD WHEELHOUSE, FR INR LH	New	4,500.00	2,700.00
2	REMOVE AND INSTALL RADIATOR AND A/CON CONDENSER	New	100.00	100.00
3	TOP UP AIR CON GAS AND CHECK A/CON SYSTEM	New	80.00	80.00
4	TO MOUNT VEHICLE ON CELETTE BENCH TO CONDUCT CHASSIS ALIGNMENT	New	1,250.00	0.00
5	TRANSFER RH FRONT DOOR GLASS, TRIM AND OTHERS ATTACHMENT TO NEW DOOR PANEL	New	150.00	0.00
6	PAINT WORK FRONT SUPPORT PANEL, FRONT BUMPER, FRONT BONNET, RH FRONT FENDER, LH FRONT FENDER, RH FRONT DOOR, LH FRONT DOOR, FRONT CHASSIS MEMBER, WHEELHOUSE, FR INR LH AND AFFECTED PORTION	New	3,850.00	2,800.00
7	TO REMOVE AND REPLACE FRONT WINDSCREEN GLASS (WHITE PATCHY AFTER AIR DEPLOY)	New	240.00	0.00
8	PERFORM RUST PREVENTION	New	80.00	40.00
9	REMOVE AND REPLACE INTAKE MANIFOLD AND THROTTLE BODY	New	450.00	0.00
10	TO REMOVE AND REPLACE DASHBOARD, AIR BAG AND AIR BAG CONTROL UNIT SYSTEM	New	450.00	225.00
11	TO REPLACE FRONT BODY SAFETY BELT AND BUCKLE SEAT	New	225.00	225.00
12	TO CARRY OUT DIAGNOSTIC CHECK USING H-I-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
13	CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
14	RENEW HARNESS FOG LAMP	New	225.00	0.00
15	SUPPLY FRONT NUMBER PLATE WITH FRAME	New	50.00	50.00
16	APPLY BODY SEALANT	New	160.00	40.00
Gross Labour Cost (S\$)			11,960.00	6,410.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >