

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20008057/QQF3E2

Date: 13/08/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100480076
Claimant Vehicle No : SBS6567T	Insured Vehicle No :	SDL8866E
Date of Loss: 30/07/2020	Nature of Claim:	TP Claim No: 7790466918SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SBS6567T		
Make & Model:	MERCEDES-BENZ CITARO O530, 6.4 L AT TURBO	Engine No:	902926C1086593
Reg. Date:	02/06/2015 (Man. Year: 2015)	Chassis No:	WEB62808323128602
Colour:	Multi-colour	Odometer:	319152 km
Engine Capacity:	6374 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	275/70 R22.5	Rear Tyre Size:	275/70 R22.5 (D)
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6/6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6/6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	04/08/2020	Inspected At:	SBS Transit Ltd (YCK) 3 Yio Chu Kang Crescent Singapore 786010
Date Inspected:	04/08/2020		
Estimated Period of Repair:	5.0 days		

Adjuster: OI SUN PIN

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
1	1		*REAR LH WHEEL FENDER	Crumpled	0.00 F	*- F	
2	1		*REAR LH PANEL (BIG)	Repair	0.00 F	*- F	
3	1		*REAR LH PANEL (SMALL)	Crumpled	0.00 F	*- F	
4	1		*REAR LH DOOR GLASS OUTER MOULDING	Scratched	0.00 F	*- F	
5	1		*REAR LH DOOR GLASS	Scratched	0.00 F	*- F	
6	1		*REAR BUMPER SIDE	Crumpled	0.00 F	*- F	
7	1		*REAR BUMPER REINFORCEMENT	Repair	0.00 F	*- F	
8	1		*REAR LH TAILLAMP	Crumpled	0.00 F	*- F	
9	2		*REAR LH REFLECTOR	Crumpled	0.00 F	*- F	
					Total Parts (S\$)	0.00	0.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >