

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	03 Aug 2020		04 Sep 2020 10:28 Edit Adj Rpt	S\$6,850.00 Edit Estimates	S\$6,850.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All																				
CLAIM SUBFOLDER DETAILS [Created by insurer]																								
Insured: 0 , Co. Reg. No.: 0 Main Claimant: LUSH LEASING PTE LTD																								
Vehicle Reg. No.: SML2390T		Date of Loss: 01/08/2020 17:00 - :59 [14 Months and 22 Days From LTA Reg Date (Man Yr)]																						
Claim Type: TP / SNM20D202706		Policy/Cover Note No.: DMPCSNW00093702000																						
Vehicle Reg. No. (Insured): SGX2429A		Policy No. (Claimant):																						
		Excess: S\$0.00																						
Repairer: RICO 60 AUTO SERVICES PTE LTD (HQ) 8, KAKI BUKIT AVENUE 4, #02-24, PREMIER @ KAKI BUKIT, 415875 Kaki Bukit - Tel:																								
Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Ben Tang]																								
Adjuster: LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by CHEN TSUE YEE] ... [Final Rpt due 15/09/2020]																								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail There are no mail for this case.																								
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>Due Date</th> <th>Priority</th> <th>Type</th> <th>Task Group</th> <th>Subject</th> <th>Handler</th> <th>Assigned By</th> <th>Completed On</th> <th>Created On</th> <th>Done?</th> </tr> </thead> <tbody> <tr> <td colspan="10">No results.</td> </tr> </tbody> </table>					Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?	No results.									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?															
No results.																								

Claim Documents

***SML2390T (SNM20D202706)**

[SGX2429A]

TP

LUSH LEASING PTE LTD

Aug 1 2020 5:00PM

[0]

RICO 60 AUTO SERVICES PTE LTD

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View
[View in Browser](#)

Assessment Reports			1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	04/09/20 11:13	Adjuster Immediate Advice	 Load HTM	
Photos/Images			3 per page	☒
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	04/09/20 10:36	General View	 Load JPG	☒
2	04/09/20 10:36	General View	 Load JPG	☒
3	04/09/20 10:36	General View	 Load JPG	☒
4	04/09/20 10:36	General View	 Load JPG	☒
5	04/09/20 10:36	General View	 Load JPG	☒
6	04/09/20 10:36	General View	 Load JPG	☒
7	04/09/20 10:36	General View	 Load JPG	☒
8	04/09/20 10:36	General View	 Load JPG	☒
9	04/09/20 10:36	General View	 Load JPG	☒
10	04/09/20 10:36	General View	 Load JPG	☒
11	04/09/20 10:36	General View	 Load JPG	☒
12	04/09/20 10:36	General View	 Load JPG	☒
13	04/09/20 10:36	General View	 Load JPG	☒
14	04/09/20 10:36	General View	 Load JPG	☒
15	04/09/20 10:36	General View	 Load JPG	☒
16	04/09/20 10:36	General View	 Load JPG	☒
17	04/09/20 10:36	General View	 Load JPG	☒
18	04/09/20 10:36	General View	 Load JPG	☒
19	04/09/20 10:36	General View	 Load JPG	☒
20	04/09/20 10:36	General View	 Load JPG	☒
21	04/09/20 10:36	General View	 Load JPG	☒
22	04/09/20 10:36	General View	 Load JPG	☒
23	04/09/20 10:36	General View	 Load JPG	☒
24	04/09/20 10:36	General View	 Load JPG	☒
25	04/09/20 10:36	General View	 Load JPG	☒
26	04/09/20 10:36	General View	 Load JPG	☒
27	04/09/20 10:36	General View	 Load JPG	☒
28	04/09/20 10:36	General View	 Load JPG	☒
29	04/09/20 10:36	General View	 Load JPG	☒
30	04/09/20 10:36	General View	 Load JPG	☒
31	04/09/20 10:36	General View	 Load JPG	☒
32	04/09/20 10:36	General View	 Load JPG	☒
33	04/09/20 10:36	General View	 Load JPG	☒
34	04/09/20 10:53	Reinspection Photo	 Load JPG	☒
35	04/09/20 10:53	Reinspection Photo	 Load JPG	☒
36	04/09/20 10:53	Reinspection Photo	 Load JPG	☒
37	04/09/20 10:53	Reinspection Photo	 Load JPG	☒

Assessment Reports				1 per page	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
38	04/09/20 10:53	Reinspection Photo		Load JPG	☒
39	04/09/20 10:53	Reinspection Photo		Load JPG	☒
40	04/09/20 10:53	Reinspection Photo		Load JPG	☒
41	04/09/20 10:53	Reinspection Photo		Load JPG	☒
42	04/09/20 10:53	Reinspection Photo		Load JPG	☒
43	04/09/20 10:53	Reinspection Photo		Load JPG	☒
44	04/09/20 10:53	Reinspection Photo		Load JPG	☒
45	04/09/20 10:53	Reinspection Photo		Load JPG	☒
46	04/09/20 10:53	Reinspection Photo		Load JPG	☒
47	04/09/20 10:53	Reinspection Photo		Load JPG	☒
48	04/09/20 10:53	Reinspection Photo		Load JPG	☒
49	04/09/20 10:53	Reinspection Photo		Load JPG	☒
50	04/09/20 10:53	Reinspection Photo		Load JPG	☒
51	04/09/20 10:53	Reinspection Photo		Load JPG	☒
52	04/09/20 10:53	Reinspection Photo		Load JPG	☒
53	04/09/20 10:53	Reinspection Photo		Load JPG	☒
54	04/09/20 10:53	Reinspection Photo		Load JPG	☒
55	04/09/20 10:53	Reinspection Photo		Load JPG	☒
56	04/09/20 10:53	Reinspection Photo		Load JPG	☒
57	04/09/20 10:54	Reinspection Photo		Load JPG	☒
58	04/09/20 10:54	Reinspection Photo		Load JPG	☒
59	04/09/20 10:54	Reinspection Photo		Load JPG	☒
60	04/09/20 10:54	Reinspection Photo		Load JPG	☒
61	04/09/20 10:54	Reinspection Photo		Load JPG	☒
62	04/09/20 10:54	Reinspection Photo		Load JPG	☒
63	04/09/20 10:54	Reinspection Photo		Load JPG	☒
64	04/09/20 10:54	Reinspection Photo		Load JPG	☒
65	04/09/20 10:54	Reinspection Photo		Load JPG	☒
66	04/09/20 10:54	Reinspection Photo		Load JPG	☒
67	04/09/20 10:54	Reinspection Photo		Load JPG	☒
68	04/09/20 10:54	Reinspection Photo		Load JPG	☒
69	04/09/20 10:54	Reinspection Photo		Load JPG	☒
70	04/09/20 10:54	Reinspection Photo		Load JPG	☒
71	04/09/20 10:54	Reinspection Photo		Load JPG	☒
72	04/09/20 10:54	Reinspection Photo		Load JPG	☒
73	04/09/20 10:54	Reinspection Photo		Load JPG	☒
74	04/09/20 10:54	Reinspection Photo		Load JPG	☒
75	04/09/20 10:54	Reinspection Photo		Load JPG	☒
76	04/09/20 10:54	Reinspection Photo		Load JPG	☒
77	04/09/20 10:54	Reinspection Photo		Load JPG	☒
78	04/09/20 10:54	Reinspection Photo		Load JPG	☒
79	04/09/20 10:54	Reinspection Photo		Load JPG	☒
80	04/09/20 10:54	Reinspection Photo		Load JPG	☒
81	04/09/20 10:54	Reinspection Photo		Load JPG	☒
82	04/09/20 10:54	Reinspection Photo		Load JPG	☒
83	04/09/20 10:54	Reinspection Photo		Load JPG	☒
84	04/09/20 10:54	Reinspection Photo		Load JPG	☒
85	04/09/20 10:54	Reinspection Photo		Load JPG	☒
86	04/09/20 10:54	Reinspection Photo		Load JPG	☒
87	04/09/20 10:54	Reinspection Photo		Load JPG	☒
88	04/09/20 10:54	Reinspection Photo		Load JPG	☒
89	04/09/20 10:54	Reinspection Photo		Load JPG	☒
90	04/09/20 10:54	Reinspection Photo		Load JPG	☒

Assessment Reports				1 per page ▾	☒
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
91	04/09/20 10:54	Reinspection Photo		Load JPG	☒
92	04/09/20 10:54	Reinspection Photo		Load JPG	☒
93	04/09/20 10:54	Reinspection Photo		Load JPG	☒
94	04/09/20 10:54	Reinspection Photo		Load JPG	☒
95	04/09/20 10:54	Reinspection Photo		Load JPG	☒

Documents Checklist

DOCUMENTS CHECKLIST

Reset

Save

Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI20008063/ETF3S2**Date:** 16/09/2020**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00093702000		
Claimant Vehicle No :	SML2390T	Insured Vehicle No :	SGX2429A		
Date of Loss:	01/08/2020	Nature of Claim:	TP	Claim No:	SNM20D202706

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SML2390T		Engine No:	2ZR2B99579
Make & Model:	TOYOTA NOAH HYBRID, 1.8 X CVT (A)		Chassis No:	ZWR800353927
Reg. Date:	10/05/2019 (Man. Year: 2018)		Odometer:	88798 km
Colour:	Brown			
Engine Capacity:	1797 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/55 R15	Rear Tyre Size:	195/55 R15
Front Left Side:	Goodyear 5 mm	Rear Left Side:	Goodyear 5 mm
Front Right Side:	Goodyear 5 mm	Rear Right Side:	Goodyear 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	37,623.25	6,944.52	30,678.73	81.54
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,990.00	1,590.00	3,400.00	68.14
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	42,613.25	8,534.52	34,078.73	79.97
Approved Total (Overridden) (\$\$)		6,850.00		
(\$\$)	42,613.25	6,850.00	35,763.25	83.93
+ GST 7.00/7.00% (\$\$)	2,982.93	479.50	2,503.43	83.93
Nett Amount (\$\$)	45,596.18	7,329.50	38,266.68	83.93

INSPECTION

Date of Assignment:	04/09/2020	
Date Inspected:	05/08/2020 Inspected At:	RICO 60 AUTO SERVICES PTE LTD (HQ) 8, KAKI BUKIT AVENUE 4, #02-24, PREMIER @ KAKI BUKIT Singapore 415875
Estimated Period of Repair:	5.0 days	

Adjuster: CHEN TSUE YEE**Manager:** DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 16 Sep 2020)

Parts: M1-MPV TOYOTA NOAH HYBRID 1.8 X CVT (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SML2390T)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET	Not Necessary	1,071.00 FL	*- FL
2	1		*FRONT BONNET INNER TRIM	Not Necessary	519.00 FL	*- FL
3	2		*FRONT BONNET HINGE L+R	Not Necessary	428.00 FL	*- FL
4	1		*FRONT HEADLAMP L+R	N/s Cut	14,830.00 FL	*3,400.80 FL
5	2		*FRONT HEADLAMP BRACKET L+R	Not Necessary	578.00 FL	*- FL
6	2		*FRONT HEADLAMP BALAST L+R C/W HEADLAMP TOP BRACKET	Not Necessary	2,640.00 FL	*- FL
7	1		*FRONT HEADLAMP GARNISH L+R	N/s Cut	428.00 FL	*140.00 FL
8	1		*FRONT GRILLE BASE (UPPER BASE)	Broken	978.00 FL	*978.00 FL
9	1		*SET FRONT GRILLE GARNISH (LOWER BASE)	Broken	1,078.00 FL	*1,036.20 FL
10	1		*FRONT GRILLE GARNISH CHROME C/WITH BASE	Not Necessary	1,484.00 FL	*- FL
11	1		*FRONT GRILLE LOGO	Not Necessary	107.00 FL	*- FL
12	1		*FRONT GRILLE LOGO PROXIMITY SENSOR (NPA)	Not Necessary	0.00 FL	*- FL
13	1		*FRONT BUMPER	Dented	1,877.00 FL	*1,568.70 FL
14	1		*FRONT BUMPER RETAINER	Broken	459.00 FL	*90.00 FL
15	1		*FRONT BUMPER FOG LAMP GARNISH L+R	N/s Cut	788.00 FL	*168.90 FL
16	1		*FRONT BUMPER REINFORCEMENT BAR	Bent	1,209.00 FL	*432.00 FL
17	2		*FRONT BUMPER BRACKET L+R (NPA)	Not Necessary	0.00 FL	*- FL
18	1		*FRONT BUMPER SPONGE (NPA)	Not Necessary	0.00 FL	*- FL
19	1		*FRONT FENDER L+R	N/s Dented	4,870.00 FL	*563.10 FL
20	2		*FRONT FENDER COWLING L+R	Torn	890.00 FL	*201.00 FL
21	2		*FRONT FENDER INNER PANEL L+R	Not Necessary	4,456.00 FL	*- FL
22	1		*FRONT FENDER EMBLEM HYBRID (LH)	Necessary	119.00 FL	*80.00 FL
23	1		*FRONT SUPPORT PANEL	Not Necessary	1,711.00 FL	*- FL
24	1		*FRONT SUPPORT PANEL TOP GARNISH	Not Necessary	417.00 FL	*- FL
25	1		*FRONT BRACE PANEL	Not Necessary	971.00 FL	*- FL
26	1		*FRONT AIR GUIDE L+R	N/s Broken	379.00 FL	*98.00 FL
27	2		*FRONT HORN	Not Necessary	176.00 FL	*- FL
28	1		*FRONT AIR CON CONDENSER	Not Necessary	1,079.00 FL	*- FL
29	1		*FRONT AIR CON HIGH PRESSURE HOSE	Not Necessary	345.00 FL	*- FL
30	1		*FRONT AIR CON LOW PRESSURE HOSE	Not Necessary	345.00 FL	*- FL
31	1		*FRONT RADIATOR	Not Necessary	1,786.00 FL	*- FL
32	1		*FRONT RADIATOR DISCHARGE PIPE	Not Necessary	439.00 FL	*- FL
33	1		*FRONT RADIATOR SUCTION PIPE	Not Necessary	407.00 FL	*- FL
34	1		*FRONT AIR CON FAN BLADE	Not Necessary	731.00 FL	*- FL
35	1		*FRONT AIR CON FAN COWLING	Not Necessary	707.00 FL	*- FL
36	1		*FRONT AIR CON FAN MOTOR	Not Necessary	631.00 FL	*- FL
37	1		*FRONT NUMBER PLATE	Not Necessary	120.00 FS	*- FS
38	10		*FRONT BUMPER CLIPS	Necessary	100.00 FS	*30.00 FS
39	1		*FRONT BONNET ISOLATOR CLIPS	Not Necessary	100.00 FS	*- FS
40	20		*FRONT FENDER COWLING CLIPS	Necessary	200.00 FS	*20.00 FS
41	1		*HEADLAMP TOP BRACKET (LH)	Bent	247.00 FL	*208.00 FL
42	1		*FRONT FENDER INNER BRACKET (LH)	Bent	211.00 FL	*188.00 FL
43	1		*HEADLAMP TOP BRACKET SEALANT	Necessary	60.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 49,971.00 9,232.70

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
- List Item Discount on L Items 25.00/25.00% (S\$)					12,347.75	2,288.18
Total Parts (S\$)					37,623.25	6,944.52
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO RNR ACCIDENT DAMAGE PARTS, CUT / WELD, KNOCK & REALIGN.	New	2,100.00	600.00
2	TO PUTTY AND RESPRAY ACCIDENT AFFECTED AREA.	New	1,500.00	700.00
3	TO RUST PROOF ACCIDENT AFFECTED AREA.	New	120.00	30.00
4	TO RNR A/C CONDENSER ASSY AND REFILL GAS.	New	400.00	120.00
5	TO CHECK WIRING LAYOUT AND HEADLAMP FOCUS.	New	250.00	30.00
6	TO DO DIAGNOSIS AND RESET, REPROGRAM OR CODING FAULT CODE.	New	120.00	80.00
7	TO DO WATER LEAK TEST.	New	250.00	30.00
8	TO RNR RADIATOR ASSY AND HOSES TO ASSIST WORK LOAD.	New	250.00	0.00
Gross Labour Cost (\$\$)			4,990.00	1,590.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >