



24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

INVOICE

Ang Chong Yang Prene
C/o: F One Automobile Pte Ltd
158 Kallang Way
#02-05 Singapore 349245

Invoice No: CL/200307
Ref No: FONE/06/2001/TP
Date: 11 June 2020

DESCRIPTION

AMOUNT

OUR SERVICE FEE CHARGES:

- SURVEY INSPECTION FOR VEHICLE NO. SMK 6559 D
- RESURVEY INSPECTION
- DIGITAL PHOTOGRAPHS SERVICES
(INCLUSIVE OF STORAGE AND SUBMISSION OF DIGITAL PHOTOGRAPHS)
- TRANSPORTATION

GRAND TOTAL

S\$ 662.00

E & O. E

All cheque payment should be "Crossed" and made payable to " **C L APPRAISER PTE LTD** "

We shall be grateful if you could forward our payment at your early convenience.



CL Appraiser Pte Ltd

CL APPRAISER PTE LTD

24 Peshurst Place, Singapore 556440
Email: clappraiser@yahoo.com Hp: 9068 8689 Fax: 6452 9783
Reg No: 201000228E

VEHICLE INSPECTION REPORT

To: Ang Chong Yang Prene
C/o: F One Automobile Pte Ltd
158 Kallang Way
#02-05 Singapore 349245

Date : 11 June 2020
Our ref : FONE/06/2001/TP

Accident Date : 28 May 2020
Inspection Date : 03 June 2020
Repairer Name : F One Automobile Pte Ltd
158 Kallang Way
#02-05 Singapore 349245

Type of Survey : Third Party

PARTICULARS OF VEHICLE

Registration No : SMK 6559 D
Make / Model : Honda Vezel
Chassis No : RU11315396
Engine No : L15B5565408

Year / Capacity : 2019 / 1496 cc
Colour : Brown
Mileage : 28564

CONDITION OF TYRES

	Make	Size	Thread Balance	Rim
Front Nearside	Falken	225/45 R18	5 mm	Sport
Front Offside	Falken	225/45 R18	5 mm	Sport
Rear Nearside	Falken	225/45 R18	5 mm	Sport
Rear Offside	Falken	225/45 R18	5 mm	Sport

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear portion.
(Details refer to the photographs attached)

Enclosed number of photographs: 92 copies

REMARKS

This inspection was conducted entirely on a "WITHOUT PREJUDICE" basis
and we have not given authorization and instruction to the repairer to proceed with the repair

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle
and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a **Lump Sum of \$ 8,100.00** on a contractual basis.

Under normal circumstances, the repair period would be about 6 (Six) working days.

Vehicle Registration No: SMK 6559 D

Our Ref No: FONE/06/2001/TP

Qty	Description	Conditions	Repairer's Estimate	Revised Amount
-----	-------------	------------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Rear windscreen moulding	Necessary	\$ 121.80	\$ 121.80
1	Rear tailgate	Damage	\$ 1,287.60	\$ 1,287.60
2	Rear tailgate dampers	Intact	\$ 331.60	
1	Rear tailgate inner trim board	Damage	\$ 225.00	\$ 225.00
2	Rear tailgate lamps	Damage	\$ 570.00	\$ 570.00
1	Rear tailgate lock	Damage	\$ 269.50	\$ 269.50
1	Rear tailgate rubber	Necessary	\$ 227.00	\$ 227.00
1	Rear tailgate opening switch set	Necessary	\$ 175.00	\$ 175.00
1	Rear tailgate "VEZEL" emblem	Necessary	\$ 56.20	\$ 56.20
2	Rear tailgate number plate lamps	Damage	\$ 97.00	\$ 97.00
1	Rear tailgate number plate garnish	Damage	\$ 185.50	\$ 185.50
1	Rear wiper motor	Damage	\$ 300.70	\$ 300.70
2	Rear taillamps	Damage	\$ 1,390.00	\$ 1,390.00
1	Rear end panel	Damage	\$ 585.80	\$ 585.80
1	Rear end panel inner garnish	Damage	\$ 160.50	\$ 160.50
1	Rear keyless sensor (1 set)	Damage	\$ 189.50	\$ 189.50
1	Rear bumper	Damage	\$ 950.60	\$ 950.60
2	Rear bumper - side	Damage	\$ 450.60	\$ 450.60
2	Rear bumper brackets	Damage	\$ 97.00	\$ 97.00
1	Rear bumper lower garnish	Damage	\$ 325.00	\$ 325.00
2	Rear bumper reflectors	Damage	\$ 303.80	\$ 303.80
2	Rear bumper side retainers	Necessary	\$ 101.80	\$ 101.80
			\$ 8,401.50	\$ 8,069.90
			<i>Less 20%</i>	<i>\$ 1,680.30</i>
Total Cost - List Items			\$ 6,721.20	\$ 6,455.92

SPECIAL NETT ITEMS

1	Rear windscreen sealant	Necessary	\$ 80.00	\$ 50.00
1	Rear bumper clip (1 set)	Necessary	\$ 45.00	\$ 45.00
1	Rear reverse sensor (1 set)	Damage	\$ 350.00	\$ 350.00
1	Rear reverse camera	Damage	\$ 480.00	\$ 480.00
1	Rear reverse sensor buzzer	Damage	\$ 150.00	\$ 150.00
1	Radio antenna	Damage	\$ 120.00	\$ 120.00
Total Cost - Special Nett items			\$ 1,225.00	\$ 1,195.00
Total cost of parts			\$ 7,946.20	\$ 7,650.92

Vehicle Registration No: SMK 6559 D

Our Ref No: FONE/06/2001/TP

S/No	Description	Repairer's Estimate	Revised Amount
Total cost of parts c/f		\$ 7,946.20	\$ 7,650.92

LABOUR

1	To remove, refit, replaced damaged lamps and check up rear electrical wiring	\$ 80.00	\$ 50.00
2	To remove and refit inner garnishes, inner trim to assist repair.	\$ 150.00	\$ 120.00
3	To remove and refit rear reverse sensor and camera.	\$ 150.00	\$ 120.00
4	To transfer rear tailgate mechanism and wiring assembly to assist repair.	\$ 120.00	\$ 120.00
5	To remove and refit rear windscreen glass.	\$ 180.00	\$ 120.00
6	To apply undercoating on repaired and replaced panel.	\$ 150.00	\$ 90.00
7	To provide labour charges, workmanship to dismantle above damaged parts, repair including cut and weld ; re-align body structure and damaged consistent to the accident.	\$ 1,400.00	\$ 1,000.00
8	To respray painting include polishing and waxing on the changed body parts, repaired portions where consistent to the accident.	\$ 1,200.00	\$ 880.00

GRAND TOTAL

\$ 11,376.20	\$ 10,150.92
---------------------	---------------------

Vehicle Registration No: SMK 6559 D

Our Ref No: FONE/06/2001/TP

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 8,100.00**

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within seven (7) from the date hereof. Otherwise, the revised amount shall be deem to be vaild.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicle and/or other accident in other legal proceedings.

C L APPRAISER PTE LTD



Cheong K. H
Automotive Appraiser



















