



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMP 3192X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	REAR BUMPER	DENTED / CRACKED	556.40	523.00
1	REAR BUMPER SIDE RETAINER	DISTORTED	119.70	119.70
1	REAR TAILGATE	BENT	1,110.60	1,110.60
1	REAR TAILGATE WEATHERSTRIP	SERVICEABLE	335.10	-
2	REAR TAILGATE HINGE	TO REPAIR SEE LABOUR	126.20	-
2	REAR TAILGATE DAMPER	SERVICEABLE	442.80	-
1	REAR TAILGATE LOCK ASSY	DENTED	412.70	360.00
1	REAR TAILGATE INNER LEFT AND RIGHT GARNISH	SERVICEABLE	180.50	-
1	REAR TAILGATE INNER TOP CENTER GARNISH	SERVICEABLE	224.80	-
1	REAR BOARD ASSY	SERVICEABLE	339.70	-
1	REAR END PANEL	BENT	780.60	630.00
1	REAR TAIL LAMP LH	CRACKED	667.70	561.35
1	REAR BUMPER REFLECTOR LH	SERVICEABLE	79.80	-
1	REAR PARKING SENSOR	DENTED / SCRATCHED	200.00	200.00
1	REAR TAILGATE OUTER GARNISH	MTG CRACKED	480.80	410.60
1	REAR BUMPER QUARTER DUCT ASSY LH	SERVICEABLE	224.70	-
1	EMBLEM (PRIUS)	NECESSARY	90.80	90.80
1	EMBLEM (HYBRID)	NECESSARY	69.70	69.70
2	REAR FENDER INNER TRIM GARNISH (ADDITIONAL)	DENTED / DISTORTED	1,337.60	1,104.20
1	REAR END PANEL TRIM GARNISH (ADDITIONAL)	MTG DISTORTED	181.60	181.60
	LESS 25% DISCOUNT		-	-1,340.39
			7,961.80	4,021.16
<b><u>LABOUR</u></b>				
	FOR TRANSFER REAR WINDSCREEN FROM OLD TO NEW TAILGATE.		150.00	120.00
	FOR REAR WINDSCREEN SEALANT.		60.00	40.00
	FOR REPLACE REVERSE SENSOR.		60.00	50.00



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR CHARGE FOR DISMANTLE AND REPLACEMENT OF ACCIDENT PARTS. TO HEAT / WELD CUT-OFF TAILLAMP PANEL, INCLUDING KNOCKING, REPAIRING, STRAIGHTEN, RESHAPE AND ADJUST OF THE SAME. INCLUSIVE OF THE REPAIR OF REAR TAILGATE HINGE.		750.00	600.00
	TO PUTTY AND SPRAY PAINT INNER / OUTER ON REAR END PANEL, REAR QUARTER PANEL, REAR TAILGATE OUTER AND INNER.		480.00	480.00
	TO APPLY RUSTPROOFING ON THE REPAIRED AND REPLACED PANELS.		80.00	30.00
			1,580.00	1,320.00
<b>GRAND TOTAL</b>			<b>9,541.80</b>	<b>5,341.16</b>
<b>RECOMMENDED COST OF REPAIRS</b>				<b>5,341.16</b>

Report Ref No. CS/SMO20008140/Kqf3e2

**KONG SENG CHEONG**

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.