



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2200924

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 18/02/2022
Reference CC4/FCI20008400/Kea3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJS 3172Z
Insured Veh. SHC 3157B
Claim No. D20003112MFSH/1
Policy No. D-20094922MFSH
Accident Date 05/08/2020
Inspection Date 12/08/2020

Description	Total
Survey Inspection	509.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	509.00
GST (7%)	35.63
Grand Total	544.63

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS FIRST CAPITAL INSURANCE LTD
36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Ref: CC4/FCI20008400/Kea3q2

Date: 18/02/2022

Code: FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 3157B	Veh. Inspected	SJS 3172Z
Policy No.	D-20094922MFSH	Coverage (\$)	0.00
Claim No.	D20003112MFSH/1	Excess (\$)	0.00
Assign From	CHRIS	Assign Date	12/08/2020

2. Vehicle Particulars & Condition

Make & Model	TOYOTA ALTIS (A)	c.c	1598
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	MR053ZEE106145685	Colour	METALLIC GREEN
Odometer	171758 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	195/65 R15	MICHELIN	8 mm
L/H Front Tyre	195/65 R15	MICHELIN	8 mm
R/H Rear Tyre	195/65 R15	MICHELIN	9 mm
L/H Rear Tyre	195/65 R15	MICHELIN	9 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	05/08/2020	Inspection Date	12/08/2020
Survey held at	K KIM HIN AUTO PTE LTD 160 SIN MING DRIVE #02-20 SIN MING AUTO CITY SINGAPORE 575722		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **9 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJS 3172Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	FRONT BUMPER	BENT / CRACKED	581.70	456.30
1	FRONT BUMPER CENTRE LOWER GRILLE	DISTORTED	129.20	129.20
2	FRONT BUMPER SIDE RETAINER (LH/RH) @\$63.40	N/S DISTORTED	126.80	63.40
10	FRONT BUMPER CLIPS @\$5.50	NECESSARY	55.00	55.00
1	N/S FRONT BUMPER FOG COVER	DENTED	65.30	65.30
1	N/S FRONT BUMPER FOG LAMP	MTG BROKEN	301.90	301.90
1	FRONT BUMPER REINFORCEMENT	BENT	343.70	343.70
2	FRONT BUMPER REINFORCEMENT BRACKET (LH/RH) @\$55.70	N/S BENT	111.40	55.70
1	FRONT BUMPER LOGO	NECESSARY	74.10	74.10
1	FRONT BUMPER TOP SEAL	CUT	54.80	54.80
1	FRONT GRILLE ASSY	CRACKED	397.50	311.20
2	HEADLAMP ASSY (LH/RH) @\$713.80	N/S BROKEN / O/S SERVICEABLE	1,427.60	713.80
1	N/S FRONT FENDER	BENT	712.10	581.90
1	N/S FRONT FENDER INNER PANEL	TO REPAIR SEE LABOUR	569.10	-
2	N/S FRONT FENDER 'VVTI' EMBLEM @\$50.80	N/S NECESSARY	101.60	50.80
1	N/S FRONT FENDER INNER SHIELD	DISTORTED	196.50	196.50
8	N/S FRONT FENDER INNER SHIELD CLIPS @\$5.50	NECESSARY	44.00	44.00
1	N/S FRONT FENDER INNER SHIELD RETAINER CLIP	NECESSARY	29.70	29.70
1	FRONT SUPPORT PANEL	BENT	821.10	708.40
1	BATTERY TOP BRACKET	BUCKLED	40.00	40.00
1	BATTERY BASE TRAY	DENTED	60.80	60.80
1	AIR INTAKE DUCT	DENTED	54.00	54.00
1	AIR INTAKE INNER HOSE	DENTED	130.70	130.70
1	AIR RESONATOR	DENTED	187.60	187.60
1	AIR CLEANER BOX	CRACKED	1,140.10	857.00
1	FUSES & RELAYS BOX -TOP	SERVICEABLE	98.20	-
1	FUSES & RELAYS BOX -LOWER	SERVICEABLE	103.70	-
1	FUSES & RELAYS BOX -CENTRE	SERVICEABLE	209.40	-
1	BONNET	BENT	1,041.60	894.50

Report Ref No. CC4/FCI20008400/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BONNET LOCK	DISTORTED	98.70	98.70
2	BONNET HINGES (LH/RH) @\$60.00	BENT	120.00	120.00
1	BONNET OUTER SEAL	CUT	62.80	62.80
1	BONNET INSULATION	CRACKED	280.80	280.80
7	BONNET INSULATION CLIPS @\$5.50	NECESSARY	38.50	38.50
1	N/S BONNET NOZZLE JET (FOR WINDSCREEN)	SERVICEABLE	145.80	-
2	FRONT WIPER PANEL GARNISH (LH/RH) @\$528.50	N/S CRACKED	1,057.00	366.10
1	AIR CON CONDENSER	TWISTED / PUNCTURE	1,801.70	1,217.85
1	RADIATOR	TWISTED / PUNCTURE	2,390.70	2,030.00
1	RADIATOR TOP GARNISH	CRACKED	101.00	101.00
1	RADIATOR FAN COWLING	CRACKED	297.20	297.20
1	RADIATOR FAN BLADE	SERVICEABLE	179.70	-
1	RADIATOR FAN MOTOR	SERVICEABLE	296.50	-
1	ENGINE LOWER CROSS MEMBER	SERVICEABLE	1,943.20	-
1	FRONT ENGINE UNDERCOVER	SERVICEABLE	156.50	-
1	ENGINE MOUNTING -LH	SERVICEABLE	215.00	-
1	ENGINE MOUNTING BRACKET-LH	SERVICEABLE	104.00	-
1	ENGINE MOUNTING -RH	SERVICEABLE	437.40	-
1	ENGINE MOUNTING BRACKET -RH	SERVICEABLE	149.00	-
1	ENGINE MOUNTING -FRONT	SERVICEABLE	241.90	-
1	ENGINE MOUNTING BRACKET -FRONT	TO REPAIR SEE LABOUR	211.00	-
1	ENGINE MOUNTING -REAR	SERVICEABLE	291.00	-
1	ENGINE MOUNTING BRACKET -REAR	SERVICEABLE	215.00	-
	LESS 25% DISCOUNT		-5,010.90	-2,768.31
			15,032.70	8,304.94
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN)	BENT	40.00	40.00
1	BATTERY (50%) (SN)	CUT / DENTED	180.00	90.00
1	RADIATOR COOLANT (SN)	NECESSARY	48.00	20.00
1	RADIO HEADSET (50%) (SN)	SHORTED	450.00	225.00
			718.00	375.00

Report Ref No. CC4/FCI20008400/Kea3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO TOW ACCIDENT VEHICLE TO WORKSHOP BY NORMAL TOWING.		60.00	50.00
	TO REMOVE ,CUT OUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN,REFIX AND TO RENEW AFFECTED PARTS.INCLUSIVE OF THE REPAIR OF N/S FRONT FENDER INNER PANEL AND ENGINE MOUNTING BRACKET -FRONT.		1,200.00	950.00
	TO FOCUS HEADLAMPS .TO CHECK FRONT WIRING AND LIGHTING OPERATION.		50.00	20.00
	TO REMOVE AIRCON CONDENSER ,PIPES AND DRIERS .VACCUM AND RECHARGE GAS.		100.00	100.00
	TO PUTTY AND RESPRAY ON AFFECTED PORTIONS.		1,400.00	1,200.00
	TO CONDUCT FRONT WHEEL ALIGNMENT TEST.	NOT NECESSARY	80.00	-
	TO CHECK AND REALIGNMENT ON CHASSIS MEMBER .		300.00	250.00
	TO REMOVE AND REFIT ENGINE ASSY IN ORDER TO FACILITATE REPAIRING WORKS.	NOT NECESSARY	280.00	-
			3,470.00	2,570.00
	GRAND TOTAL		19,220.70	11,249.94
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			9,000.00

Report Ref No. CC4/FCI20008400/Kea3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd




51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 3172Z

INSPECTION

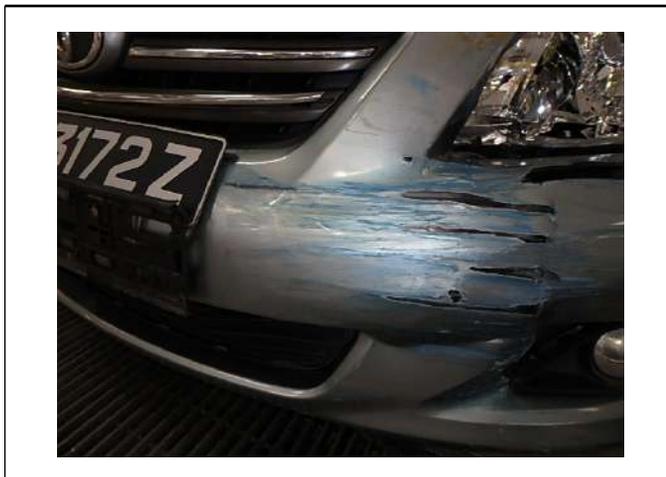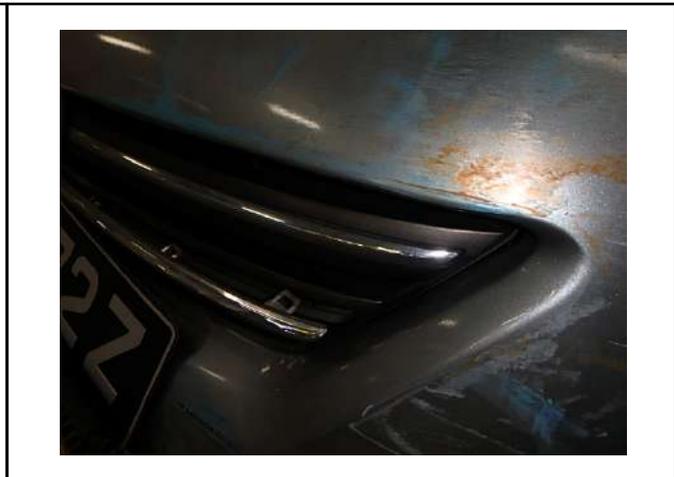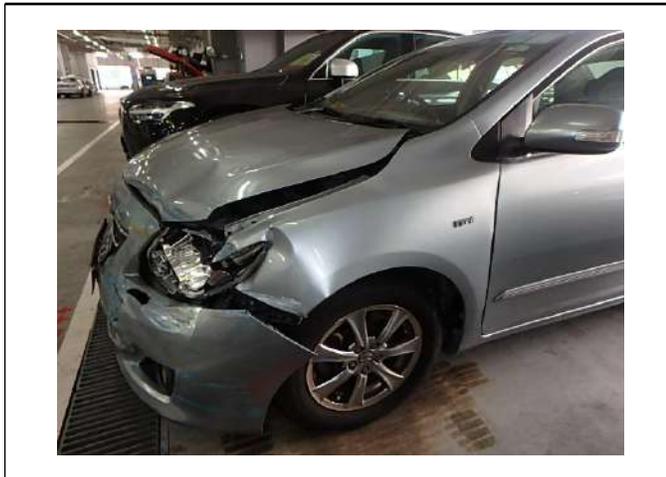



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R









LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

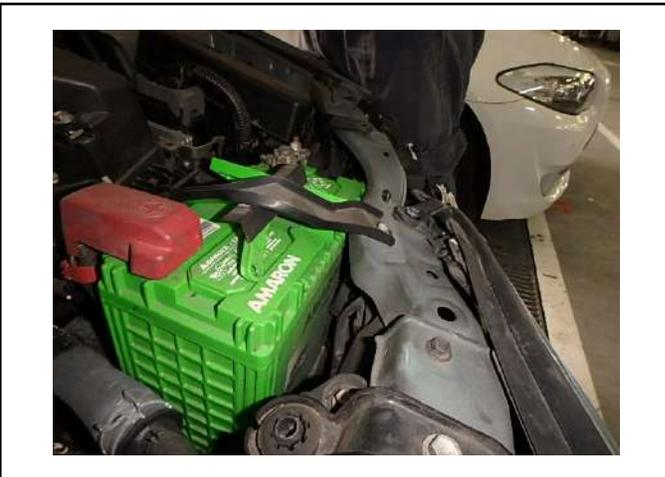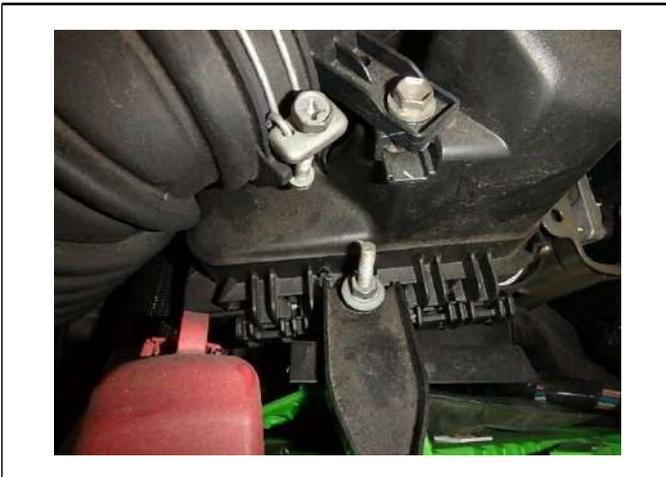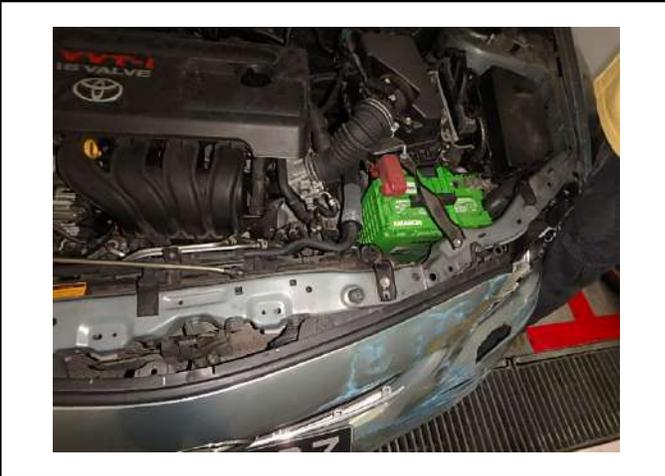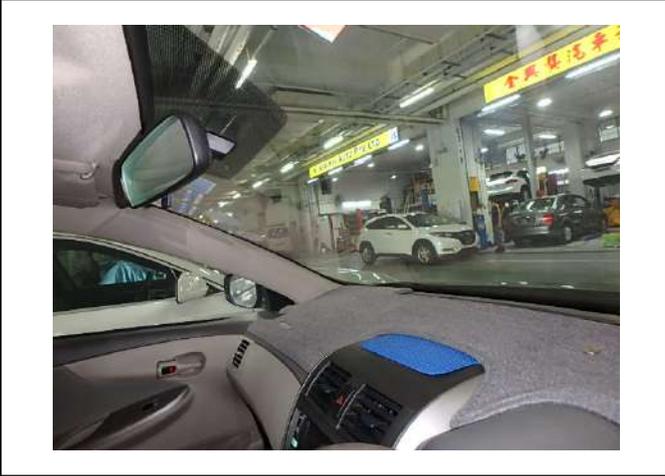







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

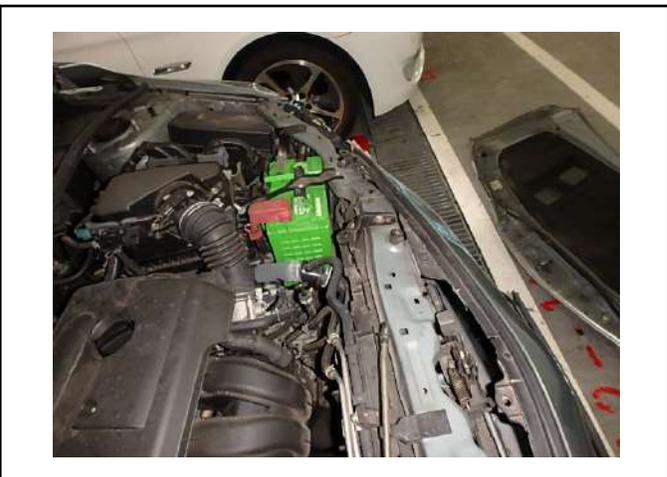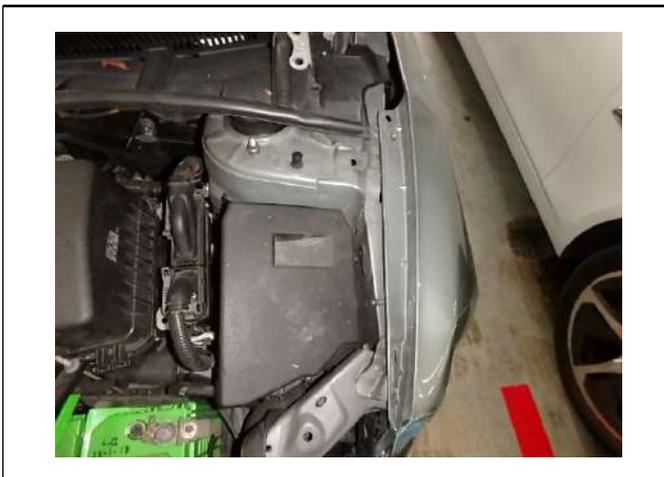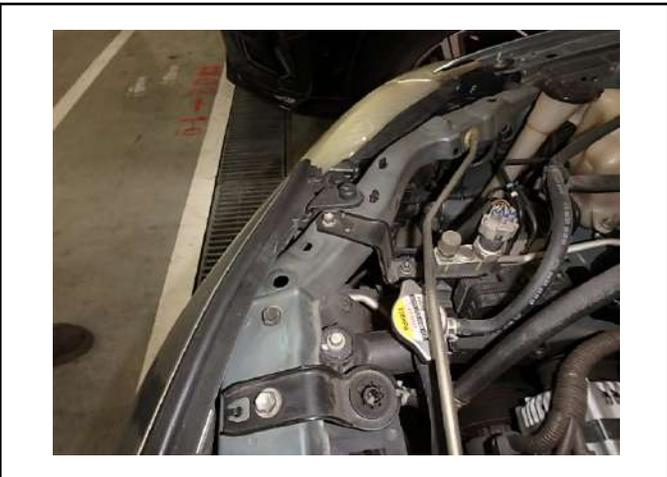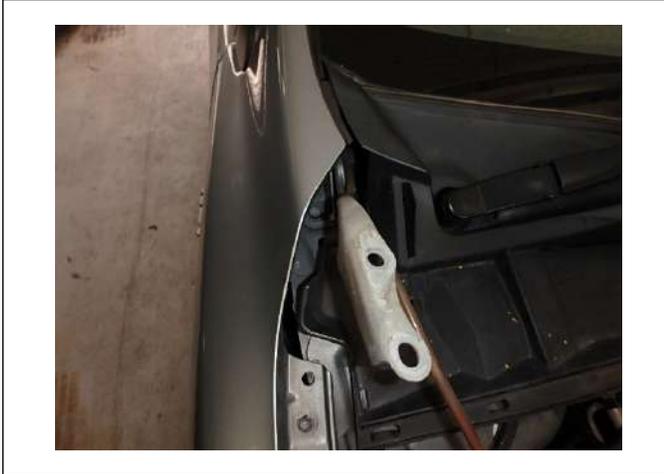





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

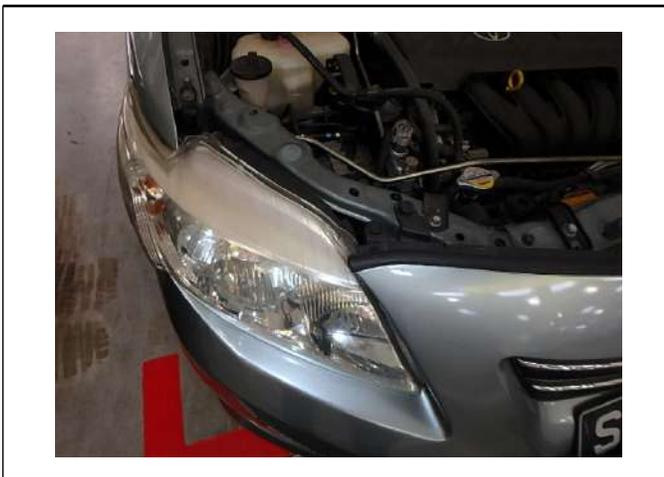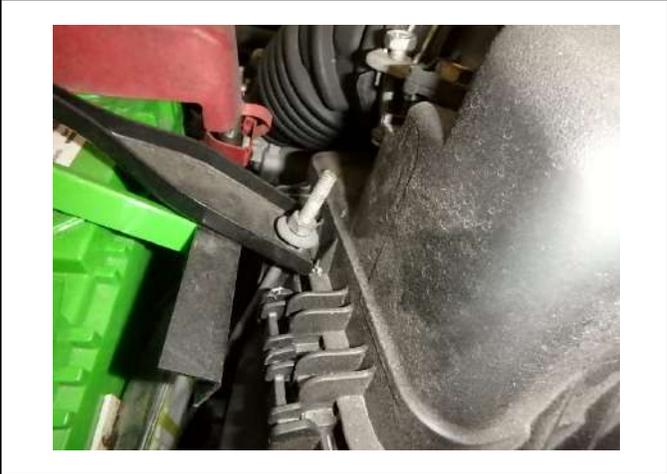



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 3172Z

RE-INSPECTION

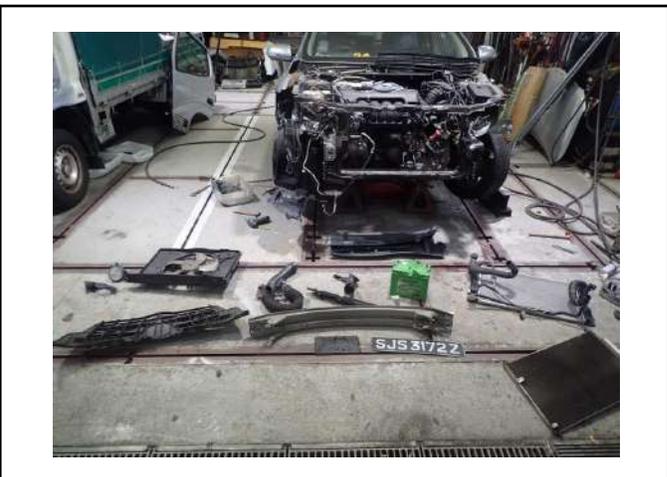



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJS 3172Z

RE-INSPECTION

