



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

EQ INSURANCE COMPANY LTD

INV No. AC2100574

5 MAXWELL ROAD
#17-00 TOWER BLOCK
MND COMPLEX
SINGAPORE 069110

INV Date 27/01/2021
Reference CC4/EQI20008419/R1ga3q2
Code EQI

PROFESSIONAL SERVICE FEE

Vehicle No. SMA 7122B
Insured Veh. SMA 3675Z
Claim No. DM20HO01128-JG
Policy No. DMPPHQ20-003557
Accident Date 05/08/2020
Inspection Date 18/08/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
EQ INSURANCE COMPANY LTD 5 MAXWELL ROAD #17-00 TOWER BLOCK MND COMPLEXSINGAPORE 069110		Ref: CC4/EQI20008419/R1ga3q2 Date: 27/01/2021 Code: EQI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SMA 3675Z	Veh. Inspected	SMA 7122B
Policy No.	DMPPHQ20-003557	Coverage (\$)	0.00
Claim No.	DM20HO01128-JG	Excess (\$)	0.00
Assign From	JOEL	Assign Date	13/08/2020
2. Vehicle Particulars & Condition			
Make & Model	MAZDA 3 HATCHBACK 1.5 AT	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	JM6BN24A8J0214793	Colour	GREY
Odometer	36593 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	FAIR		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/60 R15	BRIDGESTONE	6 mm
L/H Front Tyre	205/60 R15	BRIDGESTONE	6 mm
R/H Rear Tyre	205/60 R15	BRIDGESTONE	6 mm
L/H Rear Tyre	205/60 R15	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	05/08/2020	Inspection Date	18/08/2020
Survey held at	27A Tanjong Penjuru Singapore 609042		
Repairer	TRANS EUROKARS PTE LTD		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMA 7122B

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT BUMPER	DISTORTED	866.80	866.80
1	RETAINER LHS	SERVICEABLE	15.50	-
1	RETAINER RHS	SERVICEABLE	15.50	-
2	GROMMET ,FRONT BUMPER	NECESSARY	5.80	5.80
2	FASTENER ,FRONT BUMPER	NECESSARY	6.00	6.00
2	SEAL RUBBER ,FRONT BUMPER	NECESSARY	4.80	4.80
1	FRONT REINFORCEMENT	REPEATED	502.80	-
1	STIFF 'A' ,FRONT BUMPER	SERVICEABLE	87.90	-
2	RIVET ,LICENCE PLATE HOLDER	NECESSARY	15.20	15.20
1	FRONT GRILLE	CRACKED	135.50	135.50
1	BRACKET LHS ,FRONT GRILLE	BROKEN	27.30	27.30
1	BRACKET RHS ,FRONT GRILLE	BROKEN	27.30	27.30
1	CLIP ,FRONT GRILLE	NECESSARY	3.40	3.40
2	CLIP ,FRONT GRILLE	NECESSARY	9.40	9.40
2	PIN LOCATOR, FRONT GRILLE	SERVICEABLE	5.80	-
2	GROMMET ,FRONT GRILLE	NECESSARY	5.80	5.80
4	RIVET ,FRONT GRILLE	NECESSARY	32.00	32.00
2	SEAL RUBBER ,FRONT GRILLE	NECESSARY	5.60	5.60
1	PROTECTOR LHS ,NO.1	NECESSARY	38.70	38.70
1	PROTECTOR RHS NO.1	NECESSARY	39.10	39.10
1	PROTECTOR LHS, NO.2	NECESSARY	39.00	39.00
1	PROTECTOR RHS, NO.2	NECESSARY	39.00	39.00
1	PROTECTOR LHS, NO.3	NECESSARY	39.10	39.10
1	PROTECTOR RHS, NO.3	NECESSARY	39.00	39.00
1	PROTECTOR CENTER ,NO.1	NECESSARY	71.00	71.00
1	PROTECTOR CENTER ,NO.2	NECESSARY	71.00	71.00
1	PROTECTOR CENTER ,NO.3	NECESSARY	69.70	69.70
1	PROTECTOR LHS ,CHROME	NECESSARY	20.50	20.50
1	PROTECTOR RHS ,CHROME	NECESSARY	20.50	20.50
1	CHROME LHS	CRACKED	191.50	191.50
1	CHROME RHS	CRACKED	191.70	191.70

Report Ref No. CC4/EQI20008419/R1ga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	MASCOT ,FRONT	CRACKED	61.50	61.50
1	BRACKET ,MASCOT	NECESSARY	21.70	21.70
1	GRILLE TOP	DISTORTED	355.40	355.40
4	RIVET ,GRILLE TOP	NECESSARY	36.80	36.80
1	RIVET ,GRILLE TOP	NECESSARY	16.00	16.00
8	FASTENER ,GRILLE TOP	NECESSARY	25.60	25.60
1	REAR BUMPER	DISTORTED	997.50	997.50
1	BRACKET CENTER	NOT NECESSARY	5.40	-
4	GROMMET ,REAR BUMPER	NECESSARY	10.80	10.80
10	RIVET ,REAR BUMPER	NECESSARY	45.00	45.00
2	CLIP ,REAR BUMPER	NECESSARY	5.80	5.80
2	FASTENER ,REAR BUMPER	NECESSARY	6.00	6.00
2	RIVET , REAR BUMPER	NECESSARY	16.00	16.00
2	TAPE PROTECTOR ,REAR BUMPER	NECESSARY	17.20	17.20
2	RETAINER CENTER ,SENSOR	NOT NECESSARY	36.40	-
2	SENSOR ,ULTRASONIC	NOT NECESSARY	361.80	-
1	COVER LHS ,TOWING	DISTORTED	15.80	15.80
1	COVER RHS ,TOWING	DISTORTED	15.80	15.80
1	REAR REINFORCEMENT	DENTED	564.20	564.20
1	TAILGATE	TO REPAIR SEE LABOUR	1,332.20	-
5	FASTENER ,TAILGATE	NOT NECESSARY	15.00	-
2	VALVE ONEWAY ,TAILGATE	NOT NECESSARY	24.00	-
2	FASTENER ,REAR WINDSCREEN	NOT NECESSARY	18.40	-
2	FASTENER ,REAR WINDSCREEN	NOT NECESSARY	5.60	-
1	SPACER ,REAR WINDSCREEN	NOT NECESSARY	12.80	-
1	ORNAMENT ,MAZDA 3	NECESSARY	56.10	56.10
1	ORNAMENT ,SKYACTIVE	NECESSARY	66.80	66.80
1	MASCOT ,REAR	NECESSARY	78.20	78.20
2	FASTENER ,GARNISH	NOT NECESSARY	5.80	-
1	PIN LOCATOR ,GARNISH	NOT NECESSARY	2.90	-
1	GASKET LHS ,TAILLAMP	NECESSARY	22.00	22.00
1	GASKET RHS ,TAILLAMP	NECESSARY	22.00	22.00

Report Ref No. CC4/EQI20008419/R1ga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	GASKET LHS ,LAMP -TAILGATE	NOT NECESSARY	22.00	-
1	GASKET RHS ,LAMP -TAILGATE	NOT NECESSARY	22.00	-
4	PROTECTOR ,SPOILER	NOT NECESSARY	19.20	-
8	PROTECTOR ,SPOILER	NOT NECESSARY	23.20	-
2	PROTECTOR ,SPOILER	NOT NECESSARY	18.60	-
1	CLIP ,SPOILER	NOT NECESSARY	6.60	-
3	CLIP,SPOILER	NOT NECESSARY	10.80	-
2	GROMMET ,SPOILER	NOT NECESSARY	4.80	-
3	FASTENER ,SPOILER	NOT NECESSARY	18.60	-
2	PROTECTOR ,SPOILER SIDE	NOT NECESSARY	7.60	-
2	CLIP ,SPOILER SIDE	NOT NECESSARY	11.40	-
2	CLIP ,SPOILER SIDE	NOT NECESSARY	5.40	-
1	ANTENNA	NOT NECESSARY	111.10	-
1	CLIP ,ANTENNA	NOT NECESSARY	2.70	-
1	BRACKET TOP ,GRILLE	NOT NECESSARY	95.40	-
1	REINF ,FRONT BUMPER (ADDITIONAL)	DENTED	502.80	502.80
1	SET PLATE (ADDITIONAL)	CRACKED	70.40	70.40
1	BRACKET (L) ,BUMPER (ADDITIONAL)	DISTORTED	12.90	12.90
1	BRACKET (R) ,BUMPER (ADDITIONAL)	BROKEN	12.90	12.90
1	HOLDER ,LICENSE (ADDITIONAL)	MTG DEFORMED	74.60	74.60
			7,971.70	5,144.50
	<u>SPECIAL NETT ITEMS</u>			
1	SUNDRIES (SN)	NECESSARY	100.00	10.00
			100.00	10.00
	<u>LABOUR</u>			
	TO REPLACE FRONT BUMPER ,FRONT REINFORCEMENT AND GRILLE TOP . REPAIR ALL AREAS AFFECTED BY THE ACCIDENT .INCLUSIVE OF THE REPAIR OF TAILGATE .		1,980.00	660.00
	TO RESPRAY FRONT BUMPER ,FRONT REINFORCEMENT AND GRILLE TOP .		1,890.00	780.00
	TO REPLACE REAR BUMPER ,REAR REINFORCEMENT AND TAILGATE .REPAIR ALL AREAS AFFECTED BY THE ACCIDENT .		2,310.00	660.00

Report Ref No. CC4/EQI20008419/R1ga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RESPRAY REAR BUMPER ,REAR REINFORCEMENT AND TAILGATE .		2,205.00	1,260.00
	TO REMOVE AND REFIX SPOILER TAILGATE.	NOT NECESSARY	180.00	-
	TO REMOVE & REFIT THE WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.	NOT NECESSARY	560.00	-
	TO SUPPLY SEALER ON THE WINDSCREEN GLASS .	NOT NECESSARY	120.00	-
	TO TRANSFER TAILGATE MECHANISM .	NOT NECESSARY	330.00	-
	TO TRANSFER REVERSE SENSORS .		330.00	330.00
	TO TRANSFER REVERSE CAMERA.	NOT NECESSARY	330.00	-
	TO SUPPLY NUMBER PLATE .		70.00	70.00
	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		250.00	150.00
	TO CARRY -OUT BODY CAVITY PRESERVATION .	NOT NECESSARY	250.00	-
	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		350.00	180.00
	TO TOW THE VEHICLE FROM THE ACCIDENT SITE TO THE WORKSHOP.	NOT NECESSARY	100.00	-
			11,255.00	4,090.00
GRAND TOTAL			19,326.70	9,244.50
RECOMMENDED COST OF REPAIRS				9,244.50

Report Ref No. CC4/EQI20008419/R1ga3q2

MOHAMMED RASUL BIN MOHD YUNUS

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 7122B

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMA 7122B

RE-INSPECTION

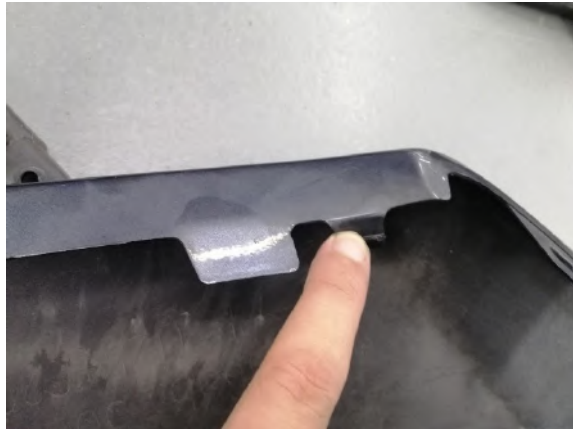



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

