

## CVR Accident Photos







### VEHICLE DETAIL

Vehicle No	<b>QX983K / SKM3497G</b>	Date Of accident	
Date Booked In		Date of Submission	



### REPAIR DESCRIPTIONS

1. Remove Front LH Passenger Door (Pic 1-4)
2. Replace Front LH Passenger Door (Pic 1-4)
3. Remove & Re-Install Front LH Passenger Door accessories (Interior, Exterior Door Handle, Door Lock, Window Glass, Power Window Regulator, etc.) onto new door (Pic 1-4)
4. Panel Beating for Front LH Fender (Pic 5-6)
5. Panel Beating for LHS Sliding Door damaged area (Pic 7-8)
6. Putty & Spray Paint for Front LH Passenger Door (Pic 1-4)
7. Putty & Spray Paint for Front LH Fender (Pic 5-6)
8. Putty & Spray Paint for LHS Sliding Door repaired area (Pic 7-8)

### PHOTOS OF DAMAGED PARTS

<b>Front LH Passenger Door Dented (Pic 1)</b>	<b>Front LH Passenger Door Dented (Pic 2)</b>
	
<b>Front LH Passenger Door Dented (Pic 3)</b>	<b>Front LH Passenger Door Dented &amp; Scratched (Pic 4)</b>
	
<b>Front LH Fender Dented &amp; Scratched (Pic 5)</b>	<b>Front LH Fender Dented &amp; Scratched (Pic 6)</b>
	
<b>LHS Sliding Door Dented &amp; Scratched (Pic 7)</b>	<b>LHS Sliding Door Dented &amp; Scratched (Pic 8)</b>

## CVR Accident Photos

	 <p>LHS Sliding Door Dented &amp; Scratched</p>			 <p>LHS Sliding Door Dented &amp; Scratched</p>	
Odometer reading (Pic 9)			QX983K / SKM3497G (Pic 10)		
	