

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20008589/GTF3E2

Date: 26/08/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100485149
Claimant Vehicle No : SDB8817A	Insured Vehicle No :	SFE467P
Date of Loss: 13/08/2020	Nature of Claim:	TP Claim No: 1152171246SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SDB8817A	Engine No:	CDH148550
Make & Model:	AUDI A4, 1.8 (A)	Chassis No:	WAUZZZ8K1CA059514
Reg. Date:	23/11/2011 (Man. Year: 2011)	Odometer:	127706 km
Colour:	Silver		
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/50 R17	Rear Tyre Size:	225/50 R17
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	17/08/2020	
Date Inspected:	18/08/2020 Inspected At:	Sunday Plus Auto Computerised Services Centre Pte Ltd (HQ) BLK 4003 ANG MO KIO INDUSTRIAL PARK 1 AVE 10, #01-116/118 Singapore 569624
Estimated Period of Repair:	14.0 days	

Adjuster: XING GUO QIANG

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT NUMBER PLATE	Bent	0.00 F	*- F
2	1		*FRT BUMPER	Cracked	0.00 F	*- F
3	1		*FRT BUMPER CLIPS	Necessary	0.00 F	*- F
4	2		*FRT BUMPER BRACKET	Bent	0.00 F	*- F
5	2		*FRT BUMPER SIDE RETAINER	Deformed	0.00 F	*- F
6	1		*FRT BUMPER REINFORCEMENT	Bent	0.00 F	*- F
7	1		*FRT BUMPER SPONGE	Cracked	0.00 F	*- F
8	1		*FRT LH BUMPER FOG LAMP COVER	Missing	0.00 F	*- F
9	1		*FRT RH BUMPER FOG LAMP COVER	Deformed	0.00 F	*- F
10	1		*FRT GRILLE EMBLEM	Cracked	0.00 F	*- F
11	1		*FRT SUPPORT PANEL	Bent	0.00 F	*- F
12	1		*FRT LH HEADLAMP ASSY	Cracked	0.00 F	*- F
13	1		*FRT RH HEADLAMP ASSY	Cracked	0.00 F	*- F
14	1		*BONNET	Dented	0.00 F	*- F
15	1		*BONNET EMBLEM	Necessary	0.00 F	*- F
16	1		*BONNET LOCK	Bent	0.00 F	*- F
17	1		*AIR CON CONDENSER	Bent	0.00 F	*- F
18	1		*RADIATOR	Bent	0.00 F	*- F
19	2		*RADIATOR AIR GUIDE	Torn	0.00 F	*- F
20	1		*RADIATOR FAN ASSY	Deformed	0.00 F	*- F
21	1		*FRT LH CHASSIS MEMBER	Repair	0.00 F	*- F
22	1		*FRT RH CHASSIS MEMBER	Repair	0.00 F	*- F
23	1		*INTER COOLER	Bent	0.00 F	*- F
24	1		*REAR NUMBER PLATE	Bent	0.00 F	*- F
25	1		*REAR NUMBER PLATE LAMP	Cut	0.00 F	*- F
26	1		*REAR BUMPER	Cracked	0.00 F	*- F
27	1		*REAR BUMPER CLIPS	Necessary	0.00 F	*- F
28	2		*REAR BUMPER BRACKET	Bent	0.00 F	*- F
29	1		*REAR BUMPER SIDE RETAINER	Deformed	0.00 F	*- F
30	1		*REAR BUMPER REINFORCEMENT	Bent	0.00 F	*- F
31	1		*REAR BUMPER BEAM	Cracked	0.00 F	*- F
32	1		*REVERSE SENSOR	Damaged	0.00 F	*- F
33	1		*REAR END PANEL	Buckled	0.00 F	*- F
34	1		*REAR END PANEL TOP GARNISH	Deformed	0.00 F	*- F
35	1		*REAR LH TAILLAMP	Cracked	0.00 F	*- F
36	1		*REAR RH TAILLAMP	Cracked	0.00 F	*- F
37	1		*BOOTLID	Buckled	0.00 F	*- F
38	3		*BOOTLID EMBLEM	Necessary	0.00 F	*- F
39	1		*BOOTLID LAMP LH	Cracked	0.00 F	*- F
40	1		*BOOTLID LAMP RH	Cracked	0.00 F	*- F
41	2		*BOOTLID LOCK	Bent	0.00 F	*- F
42	1		*BOOTLID RUBBER	Twisted	0.00 F	*- F
43	2		*BOOTLID HINGE	Bent	0.00 F	*- F
44	1		*SPARE TYRE PANEL	Repair	0.00 F	*- F
45	1		*SPARE TYRE COVER	Broken	0.00 F	*- F
46	1		*REAR LH CHASSIS MEMBER	Repair	0.00 F	*- F
47	1		*REAR RH CHASSIS MEMBER	Repair	0.00 F	*- F
48	1		*REAR RH FENDER	Buckled	0.00 F	*- F
49	1		*REAR FENDER 1/4 GLASS RUBBER	Necessary	0.00 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
50	1		*REAR FENDER 1/4 GLASS SEALANT	Necessary	0.00 F	*- F	
51	1		*REAR WINDSCREEN MOULDING	Necessary	0.00 F	*- F	
52	1		*REAR WINDSCREEN SEALANT	Necessary	0.00 F	*- F	
53	1		*REAR FENDER AIR GRILLE	Cracked	0.00 F	*- F	
54	1		*FUSE BOX	Damaged	0.00 F	*- F	
F=Franchise part.							
					Total Parts (S\$)	0.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >