



Vix Auto Pte Ltd
26 Chia Ping Road
Singapore 619977
Email: contact@vixauto.com.sg
Tel: 64522797 Fax: 66628667
UEN / GST REG No.: 201830761R

ESTIMATE

DATE : 21/2/2020
ACC DATE : 20/2/2020
POLICY NO : DMC919001459

Attention: Motor Claim Department

SHEET NO. 1 OF 2 SHEET

RE: VEHICLE NO: XE4589Y MITSUBISHI FUSO/ CHENG HENG LEE PTE LTD

S/NO	QTY	DESCRIPTION	UNIT PRICE \$	AMOUNT \$
1	1	FRONT CABIN HEAD - sheared / deformed		85,000.00
2	1	FRONT BUMPER		2,987.70
3	1	FRONT SIDE CORNER COVER RHS - missing		240.00
4	1	FRONT BUMPER STEP GARNISH - snapped		289.70
5	1	FRONT BUMPER CENTER COVER RHS - snapped		76.50
6	1	FRONT HEADLAMP RHS - missing		1,674.00
7	1	FOG LAMP RHS - missing		396.70
8	1	FRONT BUMPER SIDE INNER GARNISH torn		137.00
9	1	FRONT BUMPER REINFORCEMENT		1,200.00
10	1	FRONT HEADLAMP RHS BRACKET INNER - snapped		397.00
11	1	FRONT HEADLAMP RHS BRACKET BOTTOM - snapped		217.00
12	1	FRONT HEADLAMP RHS BRACKET TOP - snapped		195.00
13	1	FOG LAMP BOTTOM BRACKET - snapped		35.00
14	1	FRONT SIDE UPPER GARNISH RHS torn		112.00
15	1	FRONT FENDER SIDE BOTTOM GARNISH RHS torn		672.50
16	1	STEP BOARD UPPER RHS - sheared		576.80
17	1	STEP BOARD LOWER RHS - sheared		587.20
18	1	STEP BOARD BRACKET RHS - snapped		865.00
19	1	STEP ALUMINIUM PLATE - snapped		810.00
20	1	FRONT MUGUARD RHS - sheared	270.00	557.00
21	1	FRONT FENDER INNER SHIELD torn		162.00
22	1	AIR INTAKE TOP - deformed		1,789.00
23	1	AIR INTAKE CENTER		652.00
24	1	AIR INTAKE LOWER		869.00
25	1	AIR DRYER RHS		1,246.00
26	1	STEERING BOX		3,200.00
27	1	STEERING COUPLING - jammed		423.00
28	1	HORN		120.00
29	1	FRONT CABIN HEAD ROLLER BAR		1,317.00
30	1	FRONT ROLLER BAR BRACKET	672.00	1,344.00
31	1	FRONT CABIN HEAD ABSORBER	368.00	736.00
32	1	FRONT CABIN HEAD AIR BALLON	289.00	578.00
33	1	ENGINE WIRE HARNESS - snapped / burst		12,675.00
34	1	GEARBOX WIRE HARNESS - snapped / burst		12,134.00
35	1	WIRE HARNESS MAIN FUSE BOX	78.00	156.00
36	1	BRAKE AIR HOSE - burst	450.00	1,800.00
37	1	HANDBRAKE AIR HOSE	372.00	744.00
38	1	MAIN AIR HOSE - burst		462.00
39	1	RADIATOR		5,678.00
40	1	RADIATOR FAN BLADE		423.00
41	1	RADIATOR FAN CLUTCH		2,684.00
42	1	RADIATOR FAN COWLING		789.00
43	1	TURBO INTERCOOLER		8,962.00
44	1	INTERCOOLER HOSE	448.00	896.00
45	1	REAR CABIN HEAD ROLLER BAR		1,841.00
46	1	REAR ROLLER BAR BRACKET		3,789.00
47	1	REAR CABIN HEAD ABSORBER		327.00
48	1	REAR CABIN HEAD AIR BALLON		284.00
49	1	FRONT DRIVER SEAT - deformed / sheared - 900.00 (local repair)	25%	\$ 169,943.10 \$ 127,457.33

S/NO	QTY	DESCRIPTION	UNIT PRICE	AMOUNT \$
1	1	SPECIAL NET		\$ 25.00
2	1	BRAKE OIL		\$ 30.00
3	1	AUTO OIL		\$ 30.00
4	1	COOLANT		\$ 30.00
5	1	FRONT TYRE RHS		\$ 600.00
5	1	FRONT RIM RHS		\$ 800.00
				\$ 1,485.00



Vfx Auto Pte Ltd
24 Chio Ping Road
Singapore 619977
Email: contact@vfxauto.com.sg
Tel: 64582967 Fax: 68428469
UEN / GST REG No.: 201830741R

ESTIMATE

DATE : 24/2/2020
ACC DATE : 20/02/2020
POLICY NO : DMC618001459

Attention: Motor Claim Department

SHEET NO. 2 OF 2 SHEET

RE: VEHICLE NO: XE4889Y MITSUBISHI / FUSO / CHENG HENG LEE PTE LTD

S/NO	QTY	LABOUR & MISCELLANEOUS	AMOUNT \$
1		To remove damaged body panel with all necessary components/attachments apply hot-works where necessary straighten affected area, repair/reshape body dented panels in accordance with factory specifications replace new parts refit and align into position refit all necessary components / attachments	2,600.00
2		To spray paint replaced/repainted body panels inclusive of preparatory works and painting materials	3,200.00
3		Remove & Refit Front Cabin	1,800.00
4		Check & reconnect Wire Harness system & diagnosis fault code	3,200.00
5		Remove & Replace Radiator and Intercooler	400.00
6		Rejack & Alignment Chassis Frame Member	1,200.00
			<u>12,300.00</u>
		GRAND TOTAL	\$ 141,242.33



Photo 1 RH FRT VIEW



Photo 2 LH FRT VIEW



Photo 3 RH RR VIEW



Photo 4 LH RR VIEW



Photo 5 FRONT END VIEW



Photo 6 CRUSHED RH SIDE OF CABIN



Photo 7 SHEARED RH PILLAR & FIREWALL



Photo 8 CRUSHED DOOR & DOOR COMPONENTS



Photo 9 DENTED RH BUMPER / BROKEN RH LAMPS

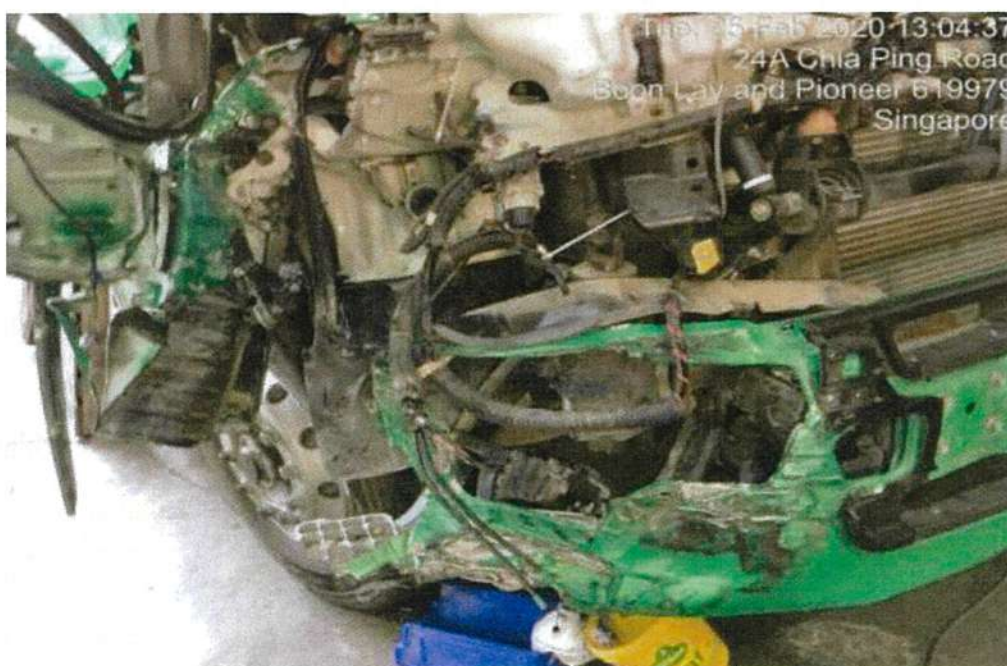


Photo 10 SNAPPED & BURST WIRE HARNESS & AIR PIPING

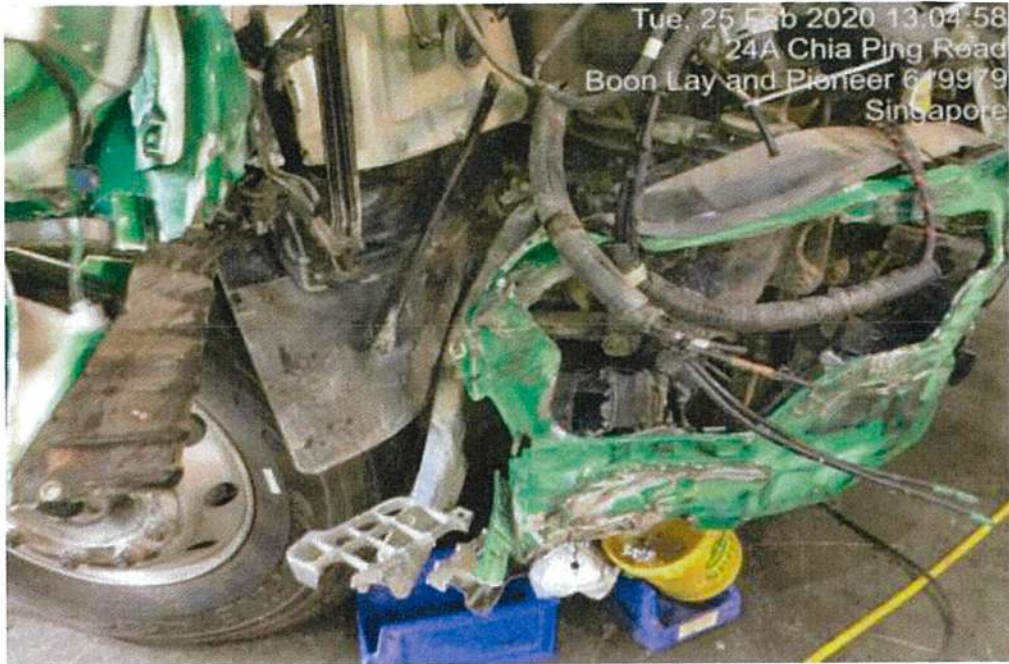


Photo 11 SNAPPED RH LOWER STEPS



Photo 12 SHEARED FIRE WALL & DEFORMED DASHBOARD



Photo 13 SNAPPED WIPER LINKAGE



Photo 14 BROKEN DASHBOARD & COVERINGS

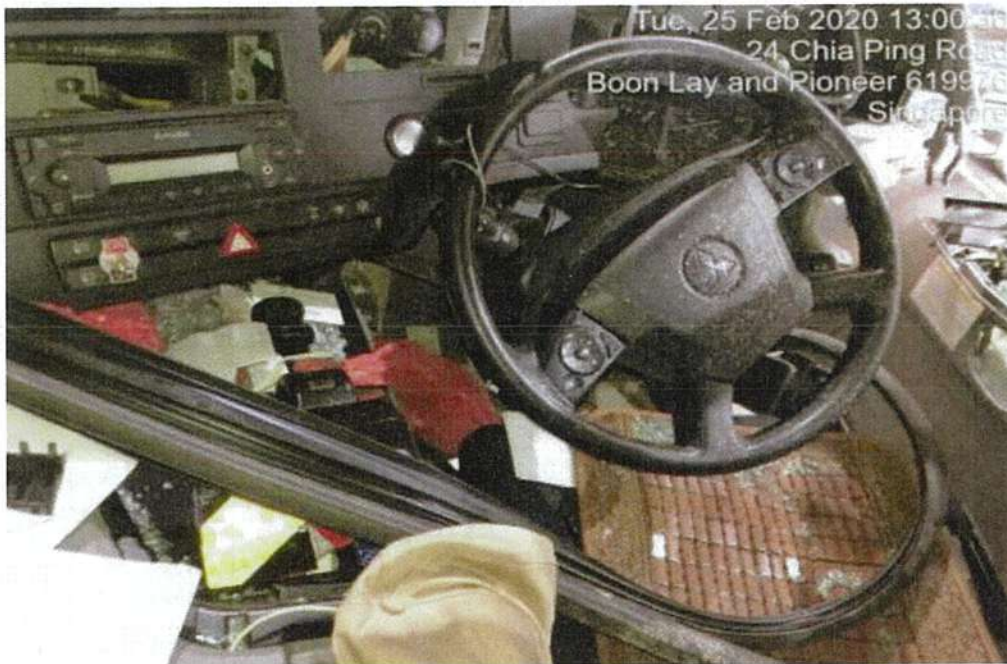


Photo 15 DEFORMED STEERING COLUMN



Photo 16 DISTORTED DRIVER'S SEAT



Photo 17 CHASSIS PLATE



Photo 18 REMOVED CABIN 1



Photo 19 SHEARED CABIN



Photo 20 CABIN REMOVED



Photo 21 SNAPPED WIRE HARNESS & BENT LOWER STEPS



Photo 22 BROKEN AIR FILTER HOUSING

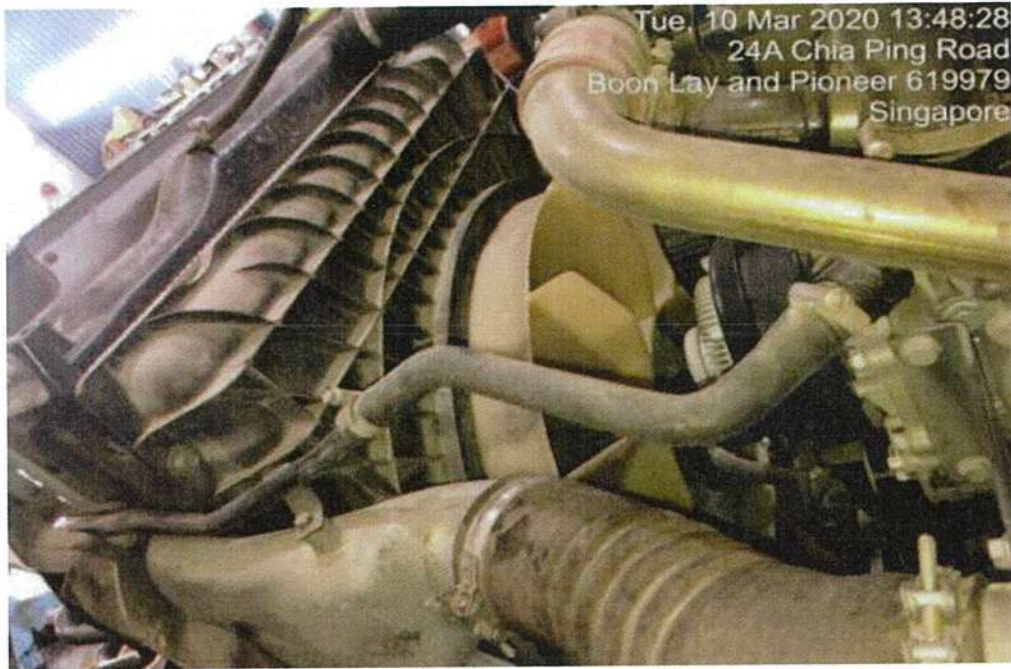


Photo 23 INTACT RADIATOR FAN BLADE



Photo 24 INTACT RADIATOR



Photo 25 INTACT ENGINE MOUNTING



Photo 26 AFTER PAINT 1



Photo 27 AFTER PAINT 2



Photo 28 AFTER PAINT 3