



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

TRANS-CAB AUTO SERVICES PTE LTD
NO.2 ANG MO KIO STREET 63
SINGAPORE 569111

INV No. AC2006008
INV Date 02/09/2020
Reference CS/TP20008695/Ktf3s2
Code TP378



PROFESSIONAL SERVICE FEE

Vehicle No. SHD 480G

Insured Veh.

Claim No.

Policy No.

Accident Date 18/08/2020

Inspection Date 19/08/2020

Description	Total
Survey Inspection	975.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	975.00
GST (7%)	68.25
Grand Total	1,043.25

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

TRANS-CAB AUTO SERVICES PTE LTD

Ref : CS/TP20008695/Ktf3s2

NO.2 ANG MO KIO STREET 63 SINGAPORE 569111

Date : 02-09-2020



Code : TP378

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SHD 480G
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	19/08/2020

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	VF1ABL15AUC283456	Colour	METALLIC WHITE / RED
Odometer	332217	Steering	JAMMED
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	SAILUN	6 mm
L/H Front Tyre	215/60 R16	SAILUN	6 mm
R/H Rear Tyre	215/60 R16	SAILUN	7 mm
L/H Rear Tyre	215/60 R16	SAILUN	7 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION AND UNDERCARRIAGE. DAMAGES SEE DETAILS.

5. General Information

Accident Date	18/08/2020	Inspection Date	19/08/2020
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	4 Working Days
-------------------------------------	-----------------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 480G

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BUMPER COVER FRT	CRACKED	747.20	747.20
1	BUMPER SPOILER FRT	DISTORTED	344.70	344.70
1	BUMPER ABSORBER FRT	SERVICEABLE	394.68	-
1	BUMPER BRACKET FRT LH (HEADLAMP LOWER)	CRACKED	116.47	116.47
1	BUMPER RETAINER FRT LH	CRACKED	101.40	101.40
1	BUMPER SUPPORT FRT	SERVICEABLE	10.70	-
1	BUMPER UNDERTRAY FRT	SERVICEABLE	292.50	-
1	BUMPER GRILLE LOWER FRT	SERVICEABLE	147.00	-
1	BUMPER FOG LAMP GRILLE LH	SERVICEABLE	207.21	-
1	BUMPER BEAM FRT	TO REPAIR SEE LABOUR	663.70	-
1	RADIATOR GRILLE	SERVICEABLE	969.90	-
1	RADIATOR GRILLE BADGE 'RENAULT'	SERVICEABLE	225.36	-
1	RADIATOR GRILLE FRAME	SERVICEABLE	686.00	-
1	FRAME FULL SUPPORT PANEL	SERVICEABLE	592.70	-
1	FRAME FULL SUPPORT BRACKET	TO REPAIR SEE LABOUR	41.60	-
1	FRONT BRACE PANEL	TO REPAIR SEE LABOUR	177.22	-
1	HEADLAMP LH	MTG CRACKED	743.60	743.60
1	HEADLAMP PANEL FRT LH	TO REPAIR SEE LABOUR	128.30	-
1	BONNET	TO REPAIR SEE LABOUR	1,312.70	-
1	BONNET STRUT LH	SERVICEABLE	53.30	-
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	236.50	-
1	BONNET CABLE	SERVICEABLE	55.20	-
1	BONNET CABLE COVER	SERVICEABLE	80.60	-
1	BONNET LOCK	TO REPAIR SEE LABOUR	152.80	-
1	FENDER PANEL FRT LH	BENT	437.10	437.10
1	WHEELARCH FRT LH	CRACKED	191.40	191.40

Report Ref No. CS/TP20008695/Ktf3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FENDER BRACKET LOWER LH	TO REPAIR SEE LABOUR	11.80	-
1	FENDER INSULATOR LH	SERVICEABLE	66.30	-
1	FENDER BRACKET FRT LH	TO REPAIR SEE LABOUR	106.40	-
1	FENDER PANEL INNER FRT LH	TO REPAIR SEE LABOUR	858.30	-
1	FENDER PANEL REINFORCEMENT FRT LH	TO REPAIR SEE LABOUR	642.40	-
1	CHASSIS PANEL FRT LH	TO REPAIR SEE LABOUR	655.80	-
1	CHASSIS PANEL SUPPORT FRT LH	SERVICEABLE	431.70	-
1	WHEEL HOUSING PANEL FRT LH	TO REPAIR SEE LABOUR	2,698.60	-
1	AIR CLEANER LOWER	BROKEN	271.26	271.26
1	AIR CLEANER HOSE	SERVICEABLE	175.85	-
1	BASE BATTERY TRAY	SERVICEABLE	363.40	-
1	AIR CLEANER BOX	SERVICEABLE	464.20	-
1	SUBFRAME OUTER FRT	BENT	1,094.20	1,094.20
1	SUBFRAME BRACKET OUTER LH	SERVICEABLE	49.00	-
1	SUBFRAME INNER FRT	SERVICEABLE	2,284.80	-
1	SUBFRAME SUPPORT INNER	SERVICEABLE	69.50	-
1	SUBFRAME BRACKET INNER LH	SERVICEABLE	101.00	-
1	AUTO COMPUTER	SERVICEABLE	1,287.30	-
1	INJECTION COMPUTER	SERVICEABLE	2,706.30	-
1	STEERING PINION RACK	BENT / JAMMED	3,765.30	3,765.30
1	STEERING PUMP ELECTRIC	SERVICEABLE	2,026.70	-
1	ENGINE HARNESS	SERVICEABLE	1,501.60	-
1	ENGINE UNDERTRAY	SERVICEABLE	583.10	-
1	BATTERY	SERVICEABLE	350.00	-
1	BATTERY COVER	SERVICEABLE	363.40	-
1	LOWER ARM LH L70Y	DISTORTED	192.70	192.70
1	KNUCKLE ARM LH L70Y	BENT	481.50	481.50
1	ABSORBER FRT LH L70Y	BENT	274.10	274.10
1	ABSORBER MOUNTING KIT LH	BENT	212.30	212.30

Report Ref No. CS/TP20008695/Ktf3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	ABSORBER DUST COVER	SERVICEABLE	76.30	-
1	DRIVESHAFT LH	TO REPAIR SEE LABOUR	1,355.70	-
1	KNUCKLE HUB+BEARING LH	BENT	272.30	272.30
1	STABILIZER BAR FRT	SERVICEABLE	427.90	-
1	STABILIZER LINK FRT	SERVICEABLE	69.50	-
1	ABS SENSOR FRT LH	SERVICEABLE	152.50	-
1	DOOR PANEL FRT LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR HINGE UPPER FRT LH	TO REPAIR SEE LABOUR	274.50	-
1	DOOR HINGE LOWER FRT LH	TO REPAIR SEE LABOUR	300.55	-
1	DOOR CHECK FRT LH	SERVICEABLE	90.90	-
1	DOOR FINISHER FRT LH	SERVICEABLE	258.90	-
1	DOOR FINISHER CLIP KIT FRT LH	NOT NECESSARY	94.00	-
1	DOOR SEAL FRT LH	NOT NECESSARY	69.60	-
1	DOOR MIRROR ASSY LH	SERVICEABLE	1,483.40	-
1	DOOR WAIST SEAL OUTER FRT LH	SERVICEABLE	92.20	-
1	ROCKER PANEL OUTER LH	TO REPAIR SEE LABOUR	1,184.99	-
1	TOW COVER FRT	SERVICEABLE	60.90	-
	LESS 10% DISCOUNT		-4,230.75	-924.55
			38,076.70	8,320.98
	SPECIAL NETT ITEMS			
1	SET RADIATOR GRILLE FRAME CLIP (SN)	NOT NECESSARY	60.00	-
1	SET BUMPER CLIP FRT (SN)	NECESSARY	80.00	80.00
1	BUMPER BRACKET CLIP FRT (SN)	NOT NECESSARY	65.00	-
1	BUMPER SUPPORT CLIP FRT (SN)	NOT NECESSARY	10.00	-
1	SET BUMPER RETAINER CLIP FRT (SN)	NOT NECESSARY	70.00	-
1	SET RADIATOR GRILLE SCREW (SN)	NOT NECESSARY	55.00	-
1	SET BUMPER GRILLE LOWER CLIP (SN)	NOT NECESSARY	70.00	-
1	BUMPER FOG LAMP GRILLE CLIP (SN)	NOT NECESSARY	55.00	-
1	SET FRAME FULL SUPPORT PANEL CLIP (SN)	NOT NECESSARY	70.00	-

Report Ref No. CS/TP20008695/Ktf3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
2	FRAME FULL SUPPORT PANEL NUT (SN)	NOT NECESSARY	40.00	-
2	FRAME FULL SUPPORT PANEL STUD (SN)	NOT NECESSARY	50.00	-
1	WINDSCREEN MOULDING (SN)	NOT NECESSARY	200.00	-
2	FRONT WINDSCREEN SEALANT (SN)	NOT NECESSARY	150.00	-
1	FRONT WINDSCREEN INNER SPONGE SEAL (SN)	NOT NECESSARY	130.00	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	120.00	-
1	SET WHEELARCH CLIP FRT (SN)	NECESSARY	60.00	60.00
1	ROCKER PANEL CLIP (SN)	NOT NECESSARY	60.00	-
1	FRONT DOOR STICKER "TRANS-CAB" (SN)	NOT NECESSARY	80.00	-
1	FRONT RENAULT TYRE 215/60/16 (@ \$330.00 50% DISC) (SN)	PUNCTURE	330.00	165.00
1	FRONT RENAULT TYRE RIM (SN)	BENT	380.00	380.00
1	FRONT DOOR STICKER 'CLASSIC' (SN)	NOT NECESSARY	80.00	-
3	CAN POWER STEERING FLUID (SN)	NOT NECESSARY	80.00	-
1	SET FENDER INSULATOR CLIP (SN)	NOT NECESSARY	50.00	-
1	BONNET CABLE CLIP (SN)	NOT NECESSARY	30.00	-
2	SEAM SEALANT (FOR BODY REPAIR) (SN)	NOT NECESSARY	200.00	-
			2,575.00	685.00
	LABOUR			
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK.	NOT NECESSARY	380.00	-
	PANEL BEATING, KNOCKING AND STRAIGHTENING THE NECESSARY PORTION, REMOVE AND RENEWAL OF PARTS, ADJUST AND REALIGN THE SAME. INCLUSIVE OF THE OF BUMPER BEAM FRT, FRAME FULL SUPPORT BRACKET, FRONT BRACE PANEL, HEADLAMP PANEL FRT LH, BONNET, BONNET HINGE LH, BONNET LOCK, FENDER BRACKET LOWER LH, FENDER BRACKET FRT LH, FENDER PANEL INNER FRT LH, FENDER PANEL REINFORCEMENT FRT LH, CHASSIS PANEL FRT LH, WHEEL HOUSING PANEL FRT LH, DRIVESHAFT LH, DOOR PANEL FRT LH, DOOR HINGE UPPER FRT LH, } DOOR HINGE LOWER FRT LH AND ROCKER PANEL OUTER LH. }		2,200.00	400.00
	TO REMOVE AND REFIT INTERIOR FITTINGS, TRIMINGS, GANISH, FITTINGS AND OTHER, TO ENABLE REPAIR.	NOT NECESSARY	380.00	-

Report Ref No. CS/TP20008695/Ktf3s2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO RUST-PROOFING AND APPLY UNDERCOAT OF THE AFFECTED AREAS.		250.00	30.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.		220.00	60.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
	TO REMOVE AND RENEW POWER STEERING PUMP, OIL COOLER PIPE AND FINAL CHECKING AND TESTING.	NOT NECESSARY	440.00	-
	TO TRANSFER OF TIRE, RIM AND ON WHEEL BALANCING.		170.00	20.00
	TO DISMANTLE AND REFIT ENGINE CROSS-MEMBER AND ENGINE MOUNTING.	NOT NECESSARY	380.00	-
	TO REMOVE AND REFIT BATTERY, ELECTRICAL WIRING, FUSE BOX AND RELAY TO ENABLE REPAIR.	NOT NECESSARY	450.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		2,200.00	660.00
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT WINDSCREEN GLASS TO FACILITATE BODYWORK REPAIR.	NOT NECESSARY	170.00	-
	TO TRANSFER OF BONNET FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF FRONT BUMPER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO CHECK ABS AND BRAKE EFFICIENCY, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF DOOR FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO DISMANTLE AND REFIT FRONT END SUSPENSION, UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.		380.00	200.00
	TOWING FEES.		170.00	50.00
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO CONDUCT AND PERFORM A COMPREHENSIVE VEHICLE DIAGNOSTIC CHECK AND RESET VEHICLE WARNING INDICATORS.	NOT NECESSARY	450.00	-
			9,850.00	1,440.00
GRAND TOTAL			50,501.70	10,445.98

Report Ref No. CS/TP20008695/Ktf3s2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,350.00
-------------------------------------------------------------------------	--	--	----------

Report Ref No. CS/TP20008695/Ktf3s2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 480G

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3551 FAX: 6256 4315

Reg. No: 199607196R GST Reg. No. 19-9607196-R

PHOTOGRAPHS FOR VEHICLE NO. SHD 480G

RE-INSPECTION

