

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: [sur@lkkauto.com](mailto:sur@lkkauto.com); [assignments@lkkauto.com](mailto:assignments@lkkauto.com)

## VEHICLE DAMAGE INSPECTION REPORT

**Our File No:** CC4/AIG20008915/KEA3Q2

**Date:** 08/04/2021

### REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070033777

**Claimant**  
**Vehicle No :** SLU8632X **Insured Vehicle No :** GBD9899U

Date of Loss: 21/08/2020 Nature of Claim: TP Claim No: 5942468944SG

### DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                   |             |              |
|-----------------------------|-----------------------------------|-------------|--------------|
| Reg No:                     | <b>SLU8632X</b>                   |             |              |
| Make & Model:               | TOYOTA C-HR HYBRID, 1.8 S CVT (A) | Engine No:  | 2ZR8243464   |
| Reg. Date:                  | 15/12/2017 (Man. Year: 2017)      | Chassis No: | ZYX102086306 |
| Colour:                     | Metallic Grey                     | Odometer:   | 196666 km    |
| Engine Capacity:            | 1797 cc                           |             |              |
| Market Value/New Car Price: | N/A                               |             |              |
| Sum Insured (S\$):          | <b>Market Value/New Car Price</b> |             |              |

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

### CONDITION OF TYRES

|                   |            |                  |            |
|-------------------|------------|------------------|------------|
| Front Tyre Size:  | 215/55 R17 | Rear Tyre Size:  | 215/55 R17 |
| Front Left Side:  | Kumho 7 mm | Rear Left Side:  | Kumho 7 mm |
| Front Right Side: | Kumho 7 mm | Rear Right Side: | Kumho 7 mm |

*The above values represent the remaining tyre treads depth*

| <b>COST OF CLAIMS</b>                             | <b>Repairer's</b> | <b>Adjuster's</b> | <b>Difference</b> | <b>Diff %</b> |
|---------------------------------------------------|-------------------|-------------------|-------------------|---------------|
| Parts                                             | 9,515.92          | 8,392.62          | 1,123.30          | 11.80         |
| Miscellaneous Items                               | 0.00              | 0.00              | 0.00              |               |
| Labour                                            | 3,880.00          | 2,690.00          | 1,190.00          | 30.67         |
| Paintwork Labour                                  | 0.00              | 0.00              | 0.00              |               |
| Towing                                            | 0.00              | 0.00              | 0.00              |               |
| <b>Gross Total (S\$)</b>                          | <b>13,395.92</b>  | <b>11,082.62</b>  | <b>2,313.30</b>   | <b>17.27</b>  |
| <b>+ GST 7.00/7.00% (S\$)</b>                     | 937.71            | 775.78            | 161.93            | 17.27         |
| <b>Nett Amount (S\$)</b>                          | <b>14,333.63</b>  | <b>11,858.40</b>  | <b>2,475.23</b>   | <b>17.27</b>  |
| <b>+ Loss of Use (10.0 x S\$100.00/day) (S\$)</b> |                   | 1,000.00          |                   |               |
| <b>+ Doc/Search Fee (S\$)</b>                     |                   | 8.00              |                   |               |
| <b>Nett Liability (S\$)</b>                       |                   | <b>12,866.40</b>  |                   |               |

### INSPECTION

Date of Assignment: 24/08/2020

Date Inspected: 24/08/2020 Inspected At:

Cheng Hoe Motor Pte Ltd (Yishun)  
Blk 1019 #01-374/382, Yishun  
Industrial Park A  
Singapore 768761

Estimated Period of Repair: 8.0 days

**Adjuster:** KENNETH KONG

**Manager:** Asher Sng Rong Yi

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

| No. | Qty | Part No. | Particulars                          | Condition          | Repairer's  | Amount       |
|-----|-----|----------|--------------------------------------|--------------------|-------------|--------------|
| 1   | 1   |          | *REAR BUMPER                         | Buckled            | 530.50 FL   | *530.50 FL   |
| 2   | 1   |          | *REAR BUMPER LOWER SKIRT             | Bent               | 399.20 FL   | *399.20 FL   |
| 3   | 1   |          | *REAR BUMPER REINFORCEMENT           | Bent               | 337.10 FL   | *337.10 FL   |
| 4   | 1   |          | *REAR BUMPER TOW HOOK COVER          | Dented             | 29.00 FL    | *29.00 FL    |
| 5   | 1   |          | *REAR BUMPER LH SIDE RETAINER        | Distorted          | 92.33 FL    | *92.33 FL    |
| 6   | 6   |          | *REAR BUMPER CLIP                    | Necessary          | 21.00 FL    | *21.00 FL    |
| 7   | 1   |          | *REAR BUMPER RH REFLECTOR            | Cracked            | 56.90 FL    | *56.90 FL    |
| 8   | 1   |          | *REAR BUMPER REFLECTOR GARNISH       | O/S Dented         | 267.80 FL   | *133.90 FL   |
| 9   | 1   |          | *REAR TAILGATE                       | Bent               | 1,198.30 FL | *1,198.30 FL |
| 10  | 1   |          | *TAILGATE LOGO                       | Necessary          | 70.50 FL    | *70.50 FL    |
| 11  | 1   |          | *TAILGATE EMBLEM CHR                 | Necessary          | 49.90 FL    | *49.90 FL    |
| 12  | 1   |          | *TAILGATE EMBLEM HYBRID              | Necessary          | 48.70 FL    | *48.70 FL    |
| 13  | 1   |          | *TAILGATE OUTER TOP GARNISH          | Cracked            | 1,019.20 FL | *1,019.20 FL |
| 14  | 1   |          | *TAILGATE INNER LOCK                 | Dented             | 361.60 FL   | *361.60 FL   |
| 15  | 1   |          | *TAILGATE INNER RUBBER               | Distorted / Dented | 325.20 FL   | *325.20 FL   |
| 16  | 2   |          | *TAILGATE REFLECTOR                  | Cracked            | 804.00 FL   | *804.00 FL   |
| 17  | 2   |          | *TAILGATE DAMPER                     | Serviceable        | 508.00 FL   | *- FL        |
| 18  | 2   |          | *TAILGATE HINGE                      | Distorted          | 119.00 FL   | *119.00 FL   |
| 19  | 1   |          | *TAILGATE INNER TRIM BOARD           | Buckled            | 385.20 FL   | *385.20 FL   |
| 20  | 2   |          | *TAILLAMP                            | Dented / Cracked   | 797.20 FL   | *797.20 FL   |
| 21  | 1   |          | *REAR CENTRE PANEL                   | Bent               | 625.80 FL   | *625.80 FL   |
| 22  | 1   |          | *REAR CENTRE PANEL INNER TOP GARNISH | Buckled            | 232.80 FL   | *232.80 FL   |
| 23  | 1   |          | *REAR WINDSCREEN GLASS MOULDING      | Necessary          | 107.00 FL   | *107.00 FL   |
| 24  | 1   |          | *REAR SPARE TYRE TOP BOARD           | Cracked            | 686.10 FL   | *686.10 FL   |
| 25  | 1   |          | *REAR TOOL BOX                       | No such part       | 422.80 FL   | *- FL        |
| 26  | 1   |          | *FRONT BUMPER                        | Buckled            | 1,198.20 FL | *1,198.20 FL |
| 27  | 1   |          | *FRONT BUMPER REINFORCEMENT          | Repair             | 339.70 FL   | *- FL        |
| 28  | 1   |          | *FRONT BUMPER CENTRE LOWER GRILLE    | Cracked            | 515.00 FL   | *515.00 FL   |
| 29  | 1   |          | *FRONT BUMPER PLATE GARNISH          | Cracked            | 132.90 FL   | *132.90 FL   |
| 30  | 1   |          | *REAR END PANEL SEALANT              | Necessary          | 40.00 FS    | *30.00 FS    |
| 31  | 1   |          | *REVERSE CAMERA                      | Shorted            | 380.00 FS   | *320.00 FS   |
| 32  | 1   |          | *REVERSE SENSOR                      | Dented             | 200.00 FS   | *200.00 FS   |
| 33  | 1   |          | *REAR WINDSCREEN GLASS SEALANT       | Necessary          | 40.00 FS    | *40.00 FS    |
| 34  | 1   |          | *FRONT NUMBER PLATE                  | Dented             | 35.00 FS    | *35.00 FS    |
| 35  | 1   |          | *FRONT BUMPER SPONGE                 | Cracked            | 80.30 FL    | *80.30 FL    |

F=Franchise part. S=SpcNett. L=ListItemDisc.

|                                                            |                  |                  |
|------------------------------------------------------------|------------------|------------------|
| <b>Sub Total (\$\$)</b>                                    | <b>12,456.23</b> | <b>10,981.83</b> |
| <b>- List Item Discount on L Items 25.00/25.00% (\$\$)</b> | 2,940.31         | 2,589.21         |
| <b>Total Parts (\$\$)</b>                                  | <b>9,515.92</b>  | <b>8,392.62</b>  |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                             | Particulars                                                                                                                                                                                                                                  | Lab.Type | Repairer's      | Amount          |
|--------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b><u>Labour Items</u></b>     |                                                                                                                                                                                                                                              |          |                 |                 |
| 1                              | REMOVE AND REFIX REAR WINDSCREEN GLASS                                                                                                                                                                                                       | New      | 120.00          | 120.00          |
| 2                              | REMOVE & REFIX REAR SEAT ,GARNISH ,CARPET ETC                                                                                                                                                                                                | New      | 100.00          | 60.00           |
| 3                              | REMOVE & REFIX REAR BUMPER ASSY ,LOWER SKIRT ,REFLECTORS ,TAILGATE ,SPOILER ,TAILLAMPS ,LOCK ASSY ,REAR WIPER ASSY ,TO CUTING ,WELDING & RENEW REAR PANEL ,TO KNOCKING & REPAIR REAR SPARE TYRE COMPARTMENT ,REAR FENDERS & REALIGN THE SAME | New      | 1,200.00        | 900.00          |
| 4                              | REMOVE & REFIX REVERSE CAMERA ,RESET & REPOSITION                                                                                                                                                                                            | New      | 50.00           | 50.00           |
| 5                              | PUTTY & RESPRAY ON REAR SPARE TYRE COMPARTMENT ,TAILGATE SPOILER ,REAR PANEL,REAR BUMPER ,REAR FENDERS & REAR AFFECTED AREAS                                                                                                                 | New      | 1,100.00        | 1,000.00        |
| 6                              | RUSTPROOFING                                                                                                                                                                                                                                 | New      | 60.00           | 60.00           |
| 7                              | REMOVE & REFIX FRT BUMPER ASSY ,GRILLE ,HEADLAMPS ,KNOCKING &REPAIR & REALIGN THE SAME                                                                                                                                                       | New      | 600.00          | 250.00          |
| 8                              | PUTTY & RESPRAY ON FRT BUMPER ,GRILLE                                                                                                                                                                                                        | New      | 400.00          | 250.00          |
| 9                              | TO MOUNT ON CAR-O-LINER ,JACK & STRAIGHTEN CHASSIS                                                                                                                                                                                           | New      | 250.00          | 0.00            |
| <b>Gross Labour Cost (S\$)</b> |                                                                                                                                                                                                                                              |          | <b>3,880.00</b> | <b>2,690.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >