



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2103558

INV Date 18/05/2021

Reference CC4/LPC16004854/Db3q2-
1

Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJM 2131E
Insured Veh. SCV 7808P
Claim No. 15/16/16/VP05/018486
Policy No. Z15VP05003276
Accident Date 12/03/2016
Inspection Date 14/03/2016

Description	Total
Third Party Express Settlement	450.00
Less:AC1805314 DD 21/05/2018	-350.00
Subtotal	100.00
GST (7%)	7.00
Grand Total	107.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
LONPAC INSURANCE BHD 300 BEACH ROAD #17-04/07 THE CONCOURSESINGAPORE 199555			Ref: CC4/LPC16004854/Db3q2-1 Date: 18/05/2021 Code: LPC2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SCV 7808P	Veh. Inspected	SJM 2131E	
Policy No.	Z15VP05003276	Coverage (\$)	0.00	
Claim No.	15/16/16/VP05/018486	Excess (\$)	0.00	
Assign From	ONG LI LI	Assign Date	14/03/2016	
2. Vehicle Particulars & Condition				
Make & Model	SUZUKI SWIFT	c.c	1586	
Engine No.	HIDDEN	Year of Reg.	2008	
Chassis No.	ZC31S205486	Colour	YELLOW	
Odometer	84398 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/45 R16	KUMHO	8 mm	
L/H Front Tyre	205/45 R16	KUMHO	8 mm	
R/H Rear Tyre	205/45 R16	KUMHO	8 mm	
L/H Rear Tyre	205/45 R16	KUMHO	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT AND REAR PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	12/03/2016	Inspection Date	14/03/2016	
Survey held at	AUTOWORX HOUSE 176 SIN MING DRIVE #02-01 SINGAPORE 575721			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJM 2131E

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BOOT LID	BENT /DENTED	794.00	794.00
1	REAR BOOT LOCK	DAMAGED	276.00	276.00
1	REAR BOOT LOCK CATCH	TO REPAIR SEE LABOUR	145.00	-
1	REAR BOOT OUTER HANDLE	BENT	127.00	127.00
1	REAR BOOT WEATHERSTRIP	DEFORMED / NECESSARY	175.00	175.00
1	REAR BOOT INNER TRIM	MTG CRACKED	263.80	263.80
2	REAR TAIL LAMP ASSY @\$486.00	MTG CRACKED	972.00	972.00
1	REAR BUMPER	DENTED	735.45	735.45
1	REAR BUMPER LOWER GRILLE	DEFORMED / BENT	345.00	345.00
1	REAR BUMPER LOWER GRILLE CENTRE COVER	NOT NECESSARY	152.00	-
2	REAR BUMPER REVERSE LAMP @\$218.20	O/S CRACKED / N/S NOT NECESSARY	436.40	218.20
8	REAR BUMPER CLIP @\$3.50	NECESSARY	28.00	28.00
2	REAR BUMPER SIDE RETAINER @\$43.40	SERVICEABLE	86.80	-
2	REAR BUMPER BRACKET @\$128.00	SERVICEABLE	256.00	-
1	SET REAR NUMBER PLATE LAMP ASSY	NOT NECESSARY	242.20	-
2	REAR FENDER DUST COVER @\$174.00	NOT NECESSARY	348.00	-
1	REAR END PANEL	DENTED	295.00	295.00
1	REAR END PANEL GARNISH	BROKEN	176.00	176.00
1	REAR END PANEL AIR DRAFTER	CRACKED	73.50	73.50
1	REAR WINDSCREEN GLASS MOULDING	NECESSARY	186.00	186.00
1	SPARE TYRE PANEL	NOT NECESSARY	533.20	-
1	SPARE TYRE TOP BOARD	NOT NECESSARY	278.00	-
1	FRONT BUMPER	DENTED/ DISTORTED	627.00	627.00
1	FRONT BUMPER CENTRE LOWER GRILLE	CRACKED	117.00	117.00
2	FRONT BUMPER SIDE RETAINER @\$67.00	SERVICEABLE	134.00	-
1	FRONT BUMPER REINFORCEMENT TOP	BENT	364.00	364.00
1	FRONT BUMPER REINFORCEMENT TOP PAD	NOT NECESSARY	278.20	-
1	FRONT BUMPER LOWER REINFORCEMENT	NOT NECESSARY	203.30	-

Report Ref No. CC4/LPC16004854/Db3q2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER LOWER REINFORCEMENT PAD	BROKEN	263.60	263.60
2	FRONT BUMPER SIDE LOWER GARNISH @\$267.20	NOT NECESSARY	534.40	-
2	FRONT BUMPER FOG LAMP	NOT NECESSARY	335.40	-
2	FRONT BUMPER FOG LAMP GARNISH @\$173.00	NOT NECESSARY	346.00	-
1	FRONT BUMPER TOW COVER	NOT NECESSARY	87.00	-
1	FRONT CENTRE GRILLE	CRACKED	176.00	176.00
2	FRONT HEAD LAMP @\$479.00	NOT NECESSARY	958.00	-
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	976.80	-
1	RADIATOR	PUNCTURE / BENT	768.80	768.80
2	RADIATOR TOP RUBBER MOUNT @\$48.60	NOT NECESSARY	97.20	-
1	A/C CONDENSOR (ADDITIONAL)	BENT	968.10	968.10
1	REAR BOOT LOCK SENSOR (ADDITIONAL)	MTG CRACKED	226.70	226.70
	LESS 10% DISCOUNT		-1,438.59	-817.62
			12,947.26	7,358.53
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT BONNET (CARBON FIBER) (SN)	BENT / DENTED	2,100.00	800.00
1	REAR WINDSCREEN GLASS INNER SEAL (SN)	NOT NECESSARY	30.00	-
1	TUBE REAR WINDSCREEN GLASS SEALANT (SN)	NECESSARY	60.00	40.00
1	SET EXHAUST SILENCER (SN)	BENT	2,160.00	800.00
3	EXHAUST PIPE MOUNTING @\$30.00 (SN)	SERVICEABLE	90.00	-
2	NUMBER PLATE @\$35.00 (SN) }	BENT	70.00	90.00
2	NUMBER PLATE HOUSING @\$35.00 (SN) }	BENT	70.00	-
1	SET REVERSE SENSOR (SN)	NOT FITTED	220.00	-
1	SET REVERSE CAMERA (SN)	NOT NECESSARY	440.00	-
			5,240.00	1,730.00
	<u>LABOUR</u>			
	TO REMOVE AND REPLACE ALL THE PARTS MENTIONED ABOVE ,KNOCKING AND STRAIGHTEN UP THE NECESSARY AFFECTED AREAS.INCLUSIVE OF THE REPAIR OF REAR BOOT LOCK CATCH AND FRONT SUPPORT PANEL .		1,800.00	900.00
	TO SPRAY PAINTING ON AFFECTED AREAS.		1,300.00	800.00
	TO CHECK WIRING SYSTEM.		60.00	30.00

Report Ref No. CC4/LPC16004854/Db3q2-1



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO INSTALL REVERSE SENSOR AND REVERSE CAMERA.	NOT NECESSARY	80.00	-
	TO APPLY WATERPROOF SEALANT ON JOINTED PANELS.		150.00	40.00
	TO APPLY RUST PROOFING .		130.00	40.00
	TO REMOVE AND REPLACE AIR CON COMPONENT ,CHARGE UP GAS.		140.00	120.00
	TO REMOVE AND REFIT WINDSCREEN GLASS TO ENABLE REPAIR .		140.00	120.00
	TO REMOVE CARPET ,TIMMING AND SEATS TO ENABLE REPAIR.		80.00	60.00
	TO CARRY OUT EXHAUST SYSTEM.		160.00	60.00
	TOWING .	NOT NECESSARY	60.00	-
			4,100.00	2,170.00
GRAND TOTAL			22,287.26	11,258.53
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				9,000.00

Report Ref No. CC4/LPC16004854/Db3q2-1

ANG BRYAN TANI

Automotive Assessor / Investigator

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 2131E

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 2131E

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

