

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG20009173/R1SF3E2

Date: 15/12/2020

REFERENCE

Insured/Claimant:	TAY HEE HUAT	Policy No:	1800042163		
Date of Loss:	27/08/2020	Nature of Claim:	OD	Claim No:	5905216335SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJX9133X		
Make & Model:	MITSUBISHI OUTLANDER, 2.0 (A)	Engine No:	4J11XS6664
Reg. Date:	24/04/2018 (Man. Year: 2018)	Chassis No:	GF7W0401404
Colour:	Blue	Odometer:	66941 km
Engine Capacity:	1998 cc		
Market Value/New Car Price:	S\$85,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/55 R18	Rear Tyre Size:	225/55 R18
Front Left Side:	Toyo 6 mm	Rear Left Side:	Toyo 6 mm
Front Right Side:	Toyo 6 mm	Rear Right Side:	Toyo 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	22,456.05	15,479.02	6,977.03	31.07
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,155.00	10,005.00	3,150.00	23.95
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	35,611.05	25,484.02	10,127.03	28.44
+ GST 7.00/7.00% (S\$)	2,492.77	1,783.88	708.89	28.44
Nett Amount (S\$)	38,103.82	27,267.90	10,835.92	28.44

INSPECTION

Date of Assignment: 01/09/2020

Date Inspected: 31/08/2020 Inspected At:

Cycle & Carriage Automotive Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 20.0 days

Adjuster: MOHD RASUL

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*PARKING SENSOR	Not Working	220.00 FS	*220.00 FS
2	1		*REAR NUMBER PLATE WITH FRAME	Bent	50.00 FS	*50.00 FS
3	1		*SUNDRY	Necessary	20.00 FS	*20.00 FS
4	1		*TRIM ASSY QTR LWR RH	Not Necessary	402.00 FS	*- FS
5	1		*FACE, RR BUMPER	Deformed	807.00 FL	*807.00 FL
6	2		*BRKT, R/BMPR FACE SIDE, RH	Serviceable	24.00 FL	*- FL
7	2		*BRKT, R/BMPR FACE SIDE, LH	Necessary	24.00 FL	*24.00 FL
8	1		*REINFORCEMENT, RR BUMPER, LH	Bent	79.00 FL	*79.00 FL
9	1		*REINFORCEMENT, RR BUMPER, RH	Serviceable	79.00 FL	*- FL
10	1		*EXTENSION, RR BUMPER	Deformed	232.00 FL	*232.00 FL
11	1		*MOULDING, RR BUMPER, RH	Serviceable	106.00 FL	*- FL
12	1		*MOULDING, RR BUMPER, LH	Deformed	106.00 FL	*106.00 FL
13	1		*PANEL ASSY, TAILGATE	Buckled	984.00 FL	*984.00 FL
14	2		*STOPPER, WINDSHIELD GLASS	Necessary	6.00 FL	*6.00 FL
15	1		*GLASS, TAILGATE WINDOW	Broken	654.00 FL	*654.00 FL
16	2		*DAM, TAILGATE SIDE	Necessary	54.00 FL	*54.00 FL
17	4		*FASTENER, WINDSHIELD	Necessary	24.00 FL	*24.00 FL
18	1		*DAM, TAILGATE, UPR	Necessary	13.00 FL	*13.00 FL
19	1		*GARNISH, TAILGATE	Deformed	494.00 FL	*494.00 FL
20	1		*W/STRIP, TAILGATE OPENING	Necessary	213.00 FL	*213.00 FL
21	1		*LATCH, TAILGATE	Bent	383.00 FL	*383.00 FL
22	1		*HANDLE, TAILGATE LOCK RLSE	Cracked	202.00 FL	*202.00 FL
23	1		*PANEL, QTR, OTR LH	Buckled	1,291.00 FL	*1,291.00 FL
24	1		*EXTENSION, QTR PANEL, OTR LH	Bent	276.00 FL	*276.00 FL
25	1		*EXTN, QTR PANEL, RR LWR LH	Bent	78.00 FL	*78.00 FL
26	1		*GLASS, QTR WINDOW, LH	Necessary	713.00 FL	*713.00 FL
27	1		*PANEL, RR END	Bent	246.00 FL	*246.00 FL
28	1		*PANEL, RR END, INR RH	Serviceable	146.00 FL	*- FL
29	1		*PANEL, RR END, INR LH	Serviceable	146.00 FL	*- FL
30	1		*FLOOR, RR	Repair	751.00 FL	*- FL
31	1		*SHIELD, RR WHEEL, RR RH	Serviceable	22.00 FL	*- FL
32	1		*SHIELD, RR WHEEL, RR LH	Serviceable	22.00 FL	*- FL
33	1		*TRIM, TAILGATE	Deformed	329.00 FL	*329.00 FL
34	1		*TRIM, TAILGATE, UPR LH	Serviceable	73.00 FL	*- FL
35	1		*TRIM, TAILGATE, UPR	Serviceable	94.00 FL	*- FL
36	1		*TRIM, TAILGATE, UPR RH	Serviceable	73.00 FL	*- FL
37	1		*MARK, OUTLANDER	Necessary	95.00 FL	*95.00 FL
38	1		*TRIM, QTR, UPR RH	Deformed	333.00 FL	*333.00 FL
39	1		*TRIM ASSY, QTR, LWR LH	Deformed	402.00 FL	*402.00 FL
40	1		*TRIM, QTR, UPR LH	Deformed	333.00 FL	*333.00 FL
41	1		*TRIM, RR SHELF	Deformed	672.00 FL	*672.00 FL
42	1		*TRIM, RR END	Deformed	123.00 FL	*113.00 FL
43	1		*LID, CARGO FLOOR BOX	Serviceable	295.00 FL	*- FL
44	1		*BOX, CARGO FLOOR	Deformed	204.00 FL	*204.00 FL
45	1		*REFLECTOR, TAIL LAMP, RH	Serviceable	100.00 FL	*- FL
46	1		*REFLECTOR, TAIL LAMP, LH	Cracked	100.00 FL	*100.00 FL
47	1		*LAMP ASSY, COMB, RR LH	Cracked	600.00 FL	*600.00 FL
48	1		*LAMP ASSY, COMB, RR RH	Serviceable	600.00 FL	*- FL
49	1		*LAMP ASSY, LICENSE PLATE	Serviceable	34.00 FL	*- FL
50	1		*LAMP ASSY, TAIL, RH	Cracked	506.00 FL	*506.00 FL
51	1		*LAMP ASSY, TAIL, LH	Cracked	506.00 FL	*506.00 FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*BRACKET, RR WINDOW WIPER	Serviceable	24.00 FL	*- FL
53	1		*MOTOR, RR WINDOW WIPER	Serviceable	505.00 FL	*- FL
54	1		*ARM ASSY, RR WINDOW WIPER	Scratched	64.00 FL	*64.00 FL
55	1		*BLADE ASSY, RR WINDOW WIPER	Necessary	32.00 FL	*32.00 FL
56	1		*ANT, KEYLESS OPERATION, RR	Serviceable	96.00 FL	*- FL
57	1		*BUZZER, KEYLESS OPERATIO, RR	Serviceable	91.00 FL	*- FL
58	1		*HARNESS, RR BUMPER	Serviceable	84.00 FL	*- FL
59	1		*FACE, FR BUMPER	Torn	1,060.00 FL	*859.00 FL
60	1		*BRACKET, FR BUMPER SIDE, LH	Necessary	18.00 FL	*18.00 FL
61	1		*EXTENSION, FR BUMPER	Scratched	426.00 FL	*426.00 FL
62	1		*GARNISH, FR BUMPER, LH	Broken	75.00 FL	*75.00 FL
63	1		*BRKT, FR BUMPER SIDE, LWR LH	Serviceable	6.00 FL	*- FL
64	1		*GARNISH, FR BUMPER SIDE	Cracked	220.00 FL	*220.00 FL
65	1		*GARNISH, FR BUMPER SIDE	Cracked	112.00 FL	*112.00 FL
66	1		*GARNISH, FR BUMPER SIDE	Cracked	48.00 FL	*48.00 FL
67	1		*COVER, FR BUMPER	Cracked	280.00 FL	*280.00 FL
68	1		*REINFORCEMENT, FR BUMPER	Bent	503.00 FL	*490.00 FL
69	1		*BAR, FR BUMPER GUARD	Serviceable	130.00 FL	*- FL
70	1		*REINFORCEMENT, FR BUMPER	Bent	134.00 FL	*134.00 FL
71	1		*REINFORCEMENT, FR BMPR SIDE	Serviceable	22.00 FL	*- FL
72	1		*REINF, FR BUMPER SIDE, LH	Bent	60.00 FL	*60.00 FL
73	1		*COVER, FR BUMPER	Serviceable	25.00 FL	*- FL
74	1		*COVER, HEADLAMP SUPT PANEL	Bent	50.00 FL	*50.00 FL
75	1		*GRILLE ASSY, RADIATOR	Cracked	569.00 FL	*569.00 FL
76	1		*BRACKET, RADIATOR GRILLE, LH	Serviceable	13.00 FL	*- FL
77	1		*HOOD	Bent	975.00 FL	*975.00 FL
78	1		*HINGE, HOOD, RH	Serviceable	68.00 FL	*- FL
79	1		*HINGE, HOOD, LH	Serviceable	68.00 FL	*- FL
80	1		*INSULATOR, HOOD	Deformed	133.00 FL	*133.00 FL
81	1		*LATCH, HOOD	Serviceable	76.00 FL	*- FL
82	1		*WEATHERSTRIP, HOOD	Necessary	40.00 FL	*40.00 FL
83	1		*WEATHERSTRIP, HOOD	Necessary	41.00 FL	*41.00 FL
84	1		*FENDER, FR LH	Buckled	688.00 FL	*688.00 FL
85	1		*INSULATOR, FR FENDER, LH	Serviceable	65.00 FL	*- FL
86	1		*SHIELD, FR WHEELHOUSE, LH	Cracked	164.00 FL	*164.00 FL
87	1		*MOULDING, FR BUMPER, LH	Serviceable	116.00 FL	*- FL
88	1		*MOULDING, FR WHEEL ARCH, LH	Deformed	199.00 FL	*168.00 FL
89	1		*PANEL, HEADLAMP SUPPORT, UPR	Bent	229.00 FL	*229.00 FL
90	1		*PANEL, HEADLAMP SUPPORT, LWR	Serviceable	107.00 FL	*- FL
91	1		*PNL, HEADLAMP SUPT, UPR LH	Bent	58.00 FL	*58.00 FL
92	1		*GARNISH, FR DECK	Serviceable	173.00 FL	*- FL
93	1		*COVER, FR DECK, LH	Serviceable	19.00 FL	*- FL
94	1		*HEADLAMP ASSY, LH	Broken	2,125.00 FL	*2,125.00 FL
95	1		*LAMP ASSY, FOG, FR LH	Serviceable	348.00 FL	*- FL
96	1		*HORN, THEFT PROTECTION	Serviceable	92.00 FL	*- FL
97	1		*CONDENSER ASSY, A/C REFRIGE	Serviceable	857.00 FL	*- FL
98	1		*DUCT, RR VENTILATOR	Cracked	44.00 FL	*39.00 FL
99	1		*RADIATOR ASSY	Serviceable	1,091.00 FL	*- FL
100	1		*TANK ASSY, RADIATOR COND	Serviceable	103.00 FL	*- FL
101	1		*SHROUD, COOLING FAN	Serviceable	258.00 FL	*- FL
102	1		*MOTOR, COOLING FAN, LH (120W)	Serviceable	479.00 FL	*- FL
103	1		*DUCT, A/CLNR INTAKE	Serviceable	187.00 FL	*- FL
104	1		*COVER, AIR CLEANER	Serviceable	156.00 FL	*- FL
105	1		*BODY ASSY, AIR CLEANER	Serviceable	146.00 FL	*- FL
106	1		*BRACKET, AIR CLEANER	Serviceable	70.00 FL	*- FL
107	1		*DUCT, A/CLNR TO THROT BODY	Serviceable	161.00 FL	*- FL

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
108	1		*FAN, COOLING, LH	Serviceable	78.00 FL	*- FL
109	1		*MOULDING, RR WHEEL ARCH, LH	Deformed	168.00 FL	*168.00 FL
110	1		*PANE, HEADLAMP SUPPORT, LH	Bent	58.00 FL	*58.00 FL
111	1		*REINF, GATE PILLAR, LH	Bent	250.00 FL	*250.00 FL
112	1		*HANDLE, TAILGATE PULL	Deformed	18.00 FL	*18.00 FL
113	1		*GROMMET, TAIL LAMP	Necessary	3.00 FL	*3.00 FL
114	10		*CLIP	Necessary	30.00 FL	*30.00 FL
115	15		*CLIP	Necessary	30.00 FL	*30.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	28,957.00	20,016.00
- List Item Discount on L Items 23.00/23.00% (\$)	6,500.95	4,536.98
Total Parts (\$)	22,456.05	15,479.02

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW REAR BUMPER, TAILGATE, REAR END PANEL REAR FENDER LH REAR COMPARTMENT, REAR LAMP, HOUSING LH	New	4,050.00	2,700.00
2	REMOVE & INSTALL PARKING SENSOR	New	60.00	60.00
3	REMOVE & INSTALL TAILGATE GLASS	New	240.00	240.00
4	APPLY SEALANT FOR TAILGATE GLASS	New	80.00	80.00
5	REMOVE & INSTALL TAILGATE TRIMS	New	200.00	120.00
6	REMOVE & INSTALL REAR COMPARTMENT TRIMS AND REAR FENDER RIMS	New	300.00	120.00
7	REMOVE & INSTALL REAR QUATAR GLASS	New	160.00	120.00
8	SPRAY PAINT FOR REAR BUMPER, TAILGATE, REAR END PANEL, REAR COMPARTMENT REAR FENDER LH, REAR LAMP HOUSING LH	New	2,450.00	1,750.00
9	APPLY SEALANT FOR ACCIDENT PORTION	New	80.00	80.00
10	C&C LOGO	New	40.00	40.00
11	RENEW FRT BUMPER, BONNET, FRT FENDER LH, FRT SUPPORT PANEL FRT FENDER RH, FRONT DOOR LH	New	2,250.00	1,800.00
12	REMOVE & INSTALL AIRCON CONDENSOR & RADIATOR	New	100.00	100.00
13	TOP UP AIRCON GAS	New	80.00	80.00
14	CHECK WIRING & ELECTRICAL SYSTEM	New	30.00	30.00
15	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
16	SPRAY PAINT FOR FRT BUMPER, BONNET, FRT SUPPORT PANEL FRT FENDER LH & RH, FRT DOOR LH	New	2,450.00	2,100.00
17	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	120.00
18	CLEAN AND VACUUM SHATTERED GLASSES	New	80.00	80.00
19	APPLY SEALANT FOR FRT ACCIDENT PORTION	New	40.00	40.00
20	REMOVE & INSTALL FUEL TANK TO FACILITATE REPAIR	New	225.00	225.00
Gross Labour Cost (\$\$)			13,155.00	10,005.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >