



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2103709

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 26/05/2021
Reference CC6/CTI20009287/Kgs3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. GBF 3866T
Insured Veh. SLF 7505R
Claim No. SNM20D203149
Policy No. DMHCSNA00004132000
Accident Date 28/08/2020
Inspection Date 01/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI20009287/Kgs3q2 Date: 26/05/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SLF 7505R	Veh. Inspected	GBF 3866T
	Policy No.	DMHCSNA00004132000	Coverage (\$)	0.00
	Claim No.	SNM20D203149	Excess (\$)	0.00
	Assign From		Assign Date	01/09/2020
2. Vehicle Particulars & Condition				
	Make & Model	RENAULT KANGOO (A)	c.c	1598
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	VF1FW1UBA54200413	Colour	WHITE
	Odometer	69381 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	WEST LAKE	5 mm
	L/H Front Tyre	195/65 R15	WEST LAKE	5 mm
	R/H Rear Tyre	195/65 R15	NEXEN	8 mm
	L/H Rear Tyre	195/65 R15	NEXEN	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	28/08/2020	Inspection Date	01/09/2020
	Survey held at	CITY AUTO PTE LTD BLK 8, SIN MING IND. ESTATE #01-60/62 Sector C SINGAPORE 575643.		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBF 3866T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR BUMPER	BENT	650.00	620.00
10	REAR BUMPER CLIPS @\$5.00	NECESSARY	50.00	50.00
1	REAR BUMPER REINFORCEMENT	BENT	480.00	480.00
1	LH BACK DOOR	BENT	1,980.00	1,700.00
1	LH BACK DOOR UPPER LOCK	TO REPAIR SEE LABOUR	250.00	-
1	LH BACK DOOR LOWER LOCK	TO REPAIR SEE LABOUR	230.00	-
1	LH BACK DOOR HINGE UPPER	TO REPAIR SEE LABOUR	280.00	-
1	LH BACK DOOR HINGE LOWER	TO REPAIR SEE LABOUR	280.00	-
1	LH BACK DOOR ARRESTOR	SERVICEABLE	290.00	-
1	LH BACK DOOR INNER TRIM	BUCKLED / CRACKED	590.00	291.60
1	REAR LICENSE PLATE LAMP WITH HOUSING	DENTED	35.00	35.00
1	BACK DOOR WEATHERSTRIP	SERVICEABLE	175.00	-
1	LH BACK DOOR RUBBER	SERVICEABLE	160.00	-
1	REAR BUMPER DAMPER	BENT	550.00	550.00
1	FRONT BONNET	BENT	870.00	856.00
1	FRONT BUMPER	BENT	880.00	865.00
2	FRONT BUMPER RETAINER @\$55.00	DISTORTED	110.00	110.00
1	FRONT BUMPER REINFORCEMENT	BENT	450.00	450.00
1	FRONT BUMPER TOWING COVER	DENTED	140.00	140.00
12	FRONT BUMPER CLIP@\$5.00	NECESSARY	60.00	60.00
1	FRONT GRILLE	SERVICEABLE	330.00	-
1	FRONT GRILLE LOGO	DENTED	170.00	170.00
1	FRONT GRILLE TOP SUPPORT	CRACKED	140.00	140.00
1	CHROME BOTTOM	SERVICEABLE	195.00	-
1	CHROME TOP	SERVICEABLE	150.00	-
1	AIR CON CONDENSER	PUNCTURE	1,050.00	1,000.00
1	RADIATOR	PUNCTURE	620.00	620.00
1	RADIATOR AIR GUIDE TOP	CRACKED	135.00	135.00

Report Ref No. CC6/CTI20009287/Kgs3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	RADIATOR SIDE AIR GUIDE	CRACKED	370.00	370.00
1	HEADLAMP	MTG BROKEN	420.00	420.00
	LESS 10% DISCOUNT		-1,209.00	-906.26
			10,881.00	8,156.34
	<u>SPECIAL NETT ITEMS</u>			
1	REVERSE SENSOR (SN)	DENTED	250.00	200.00
1	LH BACK DOOR GLASS SEALANT (SN)	NECESSARY	40.00	40.00
1	REAR NUMBER PLATE (SN)	DENTED	25.00	25.00
1	REAR NUMBER PLATE CASING (SN)	DENTED	20.00	20.00
1	STICKER -COMPANY (SN)	NECESSARY	850.00	850.00
1	STICKER -70KM/H (SN)	NECESSARY	10.00	10.00
1	STICKER -5 PAX (SN)	NECESSARY	10.00	10.00
			1,205.00	1,155.00
	<u>LABOUR</u>			
	TO REMOVE AND REFIT REAR TRIMS AND UPHOLSTERY .		80.00	60.00
	TO REMOVE AND REFIT BACK DOOR GLASS .		100.00	50.00
	TO CHECK WIRING AND LIGHTING .		60.00	40.00
	TO INSTALL REVERSE CAMERA.		40.00	40.00
	TO REMOVE AND REFIT AIR CON COMPARTMENT AND RECHARGES AIR CON GAS.		100.00	100.00
	TO SPRAY RUBBERZIED UNDERCOATING .		120.00	60.00
	TO KNOCK JACKOUT DAMAGED PARTS ,PANEL BEATING ,WELDING ,ALIGN,REFIX AND TO RENEW ACCIDENT PARTS.INCLUSIVE OF THE REPAIR OF LH BACK DOOR UPPER LOCK,LH BACK DOOR LOWER LOCK,LH BACK DOOR HINGE UPPER AND LH BACK DOOR HINGE LOWER .		1,200.00	800.00
	SPRAY PAINTING ON AFFECTED & REPLACE PARTS.		1,100.00	600.00
			2,800.00	1,750.00
GRAND TOTAL			14,886.00	11,061.34

Report Ref No. CC6/CTI20009287/Kgs3q2



RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			8,850.00
---	--	--	----------

Report Ref No. CC6/CTI20009287/Kgs3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 3866T

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 3866T

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. GBF 3866T

RE-INSPECTION

