

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI20009316/KVF3E2

Date: 08/10/2020

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMPCSNW00027272002
Claimant Vehicle No :	SCG3128Z	Insured Vehicle No :	S5321CD
Date of Loss:	27/08/2020	Nature of Claim:	TP
		Claim No:	SNM20D203133/C02/THAMYL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SCG3128Z	Engine No:	1ZZ2617363
Make & Model:	TOYOTA ISIS, 1.8 (A)	Chassis No:	ZNM100033422
Reg. Date:	08/08/2006 (Man. Year: 2006)	Odometer:	188903 km
Colour:	Metallic Dark Blue		
Engine Capacity:	1794 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195 65 R15
Front Left Side:	Yokohama 8 mm	Rear Left Side:	Bridgestone 8 mm
Front Right Side:	Yokohama 8 mm	Rear Right Side:	Bridgestone 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	745.00	596.00	149.00	20.00
Miscellaneous Items	100.00	100.00	0.00	0.00
Labour	394.80	352.80	42.00	10.64
Paintwork Labour	563.09	563.09	0.00	0.00
Towing	0.00	0.00	0.00	
Gross Total (S\$)	1,802.89	1,611.89	191.00	10.59
+ GST 7.00/7.00% (S\$)	126.20	112.83	13.37	10.59
Nett Amount (S\$)	1,929.09	1,724.72	204.37	10.59

INSPECTION

Date of Assignment:	02/09/2020 Present Location:	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)
Date Inspected:	14/09/2020 Inspected At:	Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)
		160 Sin Ming Drive #04-01, Sin Ming AutoCity
		Singapore 575722
Estimated Period of Repair:	5.0 days	

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 08 Oct 2020)
Parts:	144	TOYOTA ISIS 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SCG3128Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*Spare Parts		745.00 F	*596.00 F
						F=Franchise part.
Total Parts (S\$)					745.00	596.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	Extra	100.00	100.00
Sub Total (\$\$)			100.00	100.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	Total Paint Including Material	New	563.09	563.09
<u>Labour Items</u>				
2	Total of Labour	New	394.80	352.80
Gross Labour Cost (\$\$)			957.89	915.89

Report was unsubmitted during this print-out.

< END OF ESTIMATES >