Auto Insure Pte. Ltd 6 Marsiling Lane 739145

Insurer Reference: SMU4201X

Repairer Reference: SMU4201X(M715) Date calculated: 19/10/2020 10:37 AM

Full Report Registration: SMU4201X Printed: 19/10/2020 10:37 AM

Summary Information

Claim

Location: Singapore (SG) Work Provider: China Taiping Insurance

(Singapore) Pte Ltd

Printed by: Min Seng Chong Claim Reference:

SMU4201X

Date of Incident: Hire Car Start: Hire Car End:

Currency:

SGD 28/08/20

Estimated Repair Time: 7 4 Actual Repair Days:

Vehicle Details

Vehicle

Manufacturer: TOYOTA Model: NOAH

Sub Model: BASE MODEL Model Sheet Number: 70 NB 01 Registration: SMU4201X

VIN number: Odometer:


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

ΑII **Underbody**

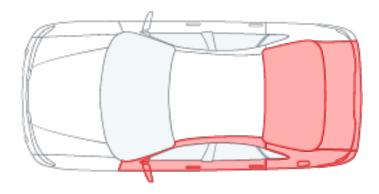

Labour

Time Base 10 WU/h

Price = 42.00 SGD/h

Code	Description	WU	Price SGD
NO NUMBER	R + R L/R UPPER BUMPER COVER	3.0	12.60
B420	RENEW REAR BUMPER INCLUDES: BUMPER AND ALL REQUIRED ATTACHED PARTS R + R	11.0	46.20
NO NUMBER	R + R L/R VENTILATION GRILLE	1.0	4.20
3481	L/R LOWER SIDE PANEL REPAIR .	30.0* /	126.00
3931	REAR CROSSMEMBER REPAIR	20.0* .	∕ 84.00
	Labour Cost Panel / Mechanical Labour	Hrs WU 6.50 65.0	273.00
	Total of Labour		273.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
Code	Description	WU Price SGD	
	REAR BUMPER NEW PART PAINT K1R	8.0	
	L/R LOWER SIDE PANEL REPAIR PAINTING >50%	23.0	
	L/R DOOR SURFACE PAINT	9.0	
	BOOTLID/TAILGATE SURFACE PAINT	9.0	
	REAR CROSSMEMBER SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
2581	REAR BUMPER NEW PART PAINT K1R	27.22
3481	L/R LOWER SIDE PANEL REPAIR PAINTING >50%	26.32
1781	L/R DOOR SURFACE PAINT	20.42
2931	BOOTLID/TAILGATE SURFACE PAINT	23.94
3931	REAR CROSSMEMBER SURFACE PAINT	1.94

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			53.0	
Preparation Main Work Metal		1.70	17.0	71.40
Preparation Comp. Work Plastic		0.30	3.0	12.60
Total	10 WU/h	7.30	73.0	306.60

Material Cost - Paint	Price SGD
New Part Painting - Plastic K1R	27.22
Repair Painting	26.32
Surface-/Blend Paint	46.30
Material-constant Metal	18.10
Material-constant Plastic	9.00
Total	126.94

Spare Parts

prices as at 2015-06-01/01

Code	Description	Part Number	Part Source		Price SGD
Coue	Description	Part Nulliber			Price 3dD
1000 2623	BRACKET LH L/R BUMPER BRACKET	COVER UPPER LH 52156 28100	Original / BR Original / BR		70.00 55.00
3403	L/R BUMPER REFLECTOR		Original /Scr		35.00
2607	L/R UPP BUMPER COVER		Original /c RV		85.00
3785 2581	L/R VENT INSERT REAR BUMPER	62940 12170 52159 28955	Original / 🏖 f Original / c 🏻 ƙ		50.00 280.00
2585	TOW HOOK COVER	52162 28060A0	Original / Mis		12.00
f: OEM Parts	Savings				0.00
n: Non-OEM Parts u: Used parts	Subtotal				587.00
u. Oseu parts	Total				587.00
Extras Code D	escription				Price SGD
coue D	escription				File 3db
	EVERSE SENSORS REAR B otal Extras	SUMPER / Cut			200.00* 200.00
<u> </u>	otai Extras				200.00
	_				
Final Calculat	ion			CCD	
				SGD	SGD
Parts				587.00	F07.00
Total Parts					587.00
Labour Time Ba	-			272.00	
Total of Labour	X 42.00 SGD/h			273.00	273.00
Tatal Of Fature					200.00
Total Of Extras					200.00
	e Base 10 WU/h			206.60	
Material Cost 73	.0 WU X 42.00 SGD/h			306.60 126.94	
Total Paint Inclu	ding Material				433.54
Repair Cost Excl	udes GST				1,493.54
GST (+7.00%)	uded CCT				104.55
Repair Cost Incl	uaea GSI				1,598.09
				PIP	
				9/P \$ 1,49 40	3.54
Comments * - USER SUPPLIE	D DATA			1 / ' ']
	TURERS CODE EXISTS			40	lays
) - WU PARTIAL IN	ICL IN OTHER POSITIONS				V
A					

Assessment Note

No assessment notes entered.