

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG20009380/AQF3E2

Date: 22/01/2021

REFERENCE

Insured/Claimant:	NIMMI PANCHATSHARAM	Policy No:	1800151238		
Date of Loss:	02/09/2020	Nature of Claim:	OD	Claim No:	2561816503SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMG6936U		
Make & Model:	AUDI A3, 999cc SEDAN TFSI (A)	Engine No:	CHZB22564
Reg. Date:	28/12/2018 (Man. Year: 2018)	Chassis No:	WAUZZZ8V2K1011853
Colour:	Black	Odometer:	19596 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$93,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	21,909.00	10,823.04	11,085.96	50.60
Miscellaneous Items	0.00	0.00	0.00	
Labour	12,714.00	5,764.00	6,950.00	54.66
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	34,623.00	16,587.04	18,035.96	52.09
- Excess (S\$)	600.00	600.00	0.00	0.00
(S\$)	34,023.00	15,987.04	18,035.96	53.01
+ GST 7.00/7.00% (S\$)	2,381.61	1,119.09	1,262.52	53.01
Nett Amount (S\$)	36,404.61	17,106.13	19,298.48	53.01

INSPECTION

Date of Assignment:	03/09/2020		
Date Inspected:	03/09/2020	Inspected At:	Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	7.0 days		

Adjuster: ADRIAN LING

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	1,987.00 FS	*1,589.60 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	185.00 FS	*- FS
3	1		*FRONT BUMPER GUIDE SECTION - LH	Not Necessary	38.00 FS	*- FS
4	1		*FRONT BUMPER GRILLE - CENTRE	Not Necessary	159.00 FS	*- FS
5	1		*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Not Necessary	530.00 FS	*- FS
6	1		*FRONT BUMPER CLOSING ELEMENT - LH	Not Necessary	293.00 FS	*- FS
7	1		*FRONT BUMPER COVER TRIM - LH	Not Necessary	161.00 FS	*- FS
8	1		*RADIATOR GRILLE	Cracked	1,406.00 FS	*1,124.80 FS
9	1		*RADIATOR GRILLE CLOSING ELEMENT	Cracked	189.00 FS	*150.80 FS
10	1		*AIRCON STICKER	Necessary	8.00 FS	*5.68 FS
11	1		*CAUTION SIGN STICKER	Necessary	14.00 FS	*10.80 FS
12	1		*FRONT BUMPER AIR GUIDE GRILLE - LH	Not Necessary	186.00 FS	*- FS
13	1		*FRONT BUMPER SIDE REINFORCEMENT BEAM	Not Necessary	715.00 FS	*- FS
14	1		*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	187.00 FS	*- FS
15	1		*FOAM FILLER PIECE COVER	Not Necessary	121.00 FS	*- FS
16	1		*SIGNAL HORN - LH HIGH TONE	Not Necessary	197.00 FS	*- FS
17	1		*FRONT FENDER - LH	Not Necessary	841.00 FS	*- FS
18	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	71.00 FS	*- FS
19	1		*FRONT FENDER BRACKET - LH	Not Necessary	27.00 FS	*- FS
20	1		*FRONT FENDER BRACKET - LH	Not Necessary	38.00 FS	*- FS
21	1		*FRONT FENDER BRACE	Not Necessary	95.00 FS	*- FS
22	1		*WHEEL HOUSING LINER - LH	Not Necessary	167.00 FS	*- FS
23	1		*WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	88.00 FS	*- FS
24	1		*BONNET	Dented	3,134.00 FS	*2,507.20 FS
25	1		*BONNET ATTACHMENT PARTS	Not Necessary	163.00 FS	*- FS
26	2		*BONNET LID HINGE - LH / RH	Bent	122.00 FS	*96.48 FS
27	1		*BONNET CATCH HOOK	Not Necessary	89.00 FS	*- FS
28	2		*BONNET STRIKER - LH / RH	Not Necessary	218.00 FS	*- FS
29	1		*BONNET EDGE PROTECTION	Necessary	28.00 FS	*21.84 FS
30	1		*SIDE SEAL - LH	Not Necessary	41.00 FS	*- FS
31	1		*BONNET LID LOCK	Not Necessary	212.00 FS	*- FS
32	1		*BONNET BOWDEN CABLE - CENTRE	Not Necessary	57.00 FS	*- FS
33	1		*BONNET SOUND ABSORBER	Not Necessary	217.00 FS	*- FS
34	1		*PLENUM CHAMBER COVER	Cut	177.00 FS	*141.60 FS
35	1		*BONNET CATCH HOOK	Not Necessary	63.00 FS	*- FS
36	1		*LED HEADLIGHT - LH	Cracked	5,455.00 FS	*4,364.00 FS
37	1		*MAIN LIGHT ELECTRONICS POWER MODULE - LH	Not Necessary	749.00 FS	*- FS
38	1		*LED WITH HEAT SINK - LH	Not Necessary	725.00 FS	*- FS
39	1		*LIGHT CONTROL SYSTEM CONTROL UNIT	Not Necessary	551.00 FS	*- FS
40	1		*HEADLAMP REPAIR KIT	Not Necessary	130.00 FS	*- FS
41	1		*HEADLIGHT HOSE - LH	Not Necessary	40.00 FS	*- FS
42	1		*LIFT CYLINDER - LH	Not Necessary	141.00 FS	*- FS
43	1		*LIFT CYLINDER HOSE	Not Necessary	67.00 FS	*- FS
44	1		*LOCK CARRIER	Cracked	719.00 FS	*575.20 FS
45	1		*READY MIX COOLANT	Necessary	177.00 FS	*141.44 FS
46	1		*AIRCON CONDENSER	Not Necessary	517.00 FS	*- FS
47	1		*TEMPERATURE SENSOR BRACKET	Cracked	18.00 FS	*14.40 FS
48	1		*RADIATOR AIR GUIDE - LH	Cracked	24.00 FS	*19.20 FS
49	1		*RADIATOR AIR GUIDE - UPPER CENTRE	Not Necessary	12.00 FS	*- FS
50	1		*FRONT NO PLATE	Necessary	60.00 FS	*60.00 FS
51	1		*SUNDRIES	Not Necessary	300.00 FS	*- FS

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
F=Franchise part. S=SpcNett.						
Total Parts (S\$)					21,909.00	10,823.04

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	280.00	280.00
2	TO REMOVE AND TRANSFER LHS HEADLIGHT CONTROL UNIT AND POWER MODULE	New	350.00	250.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR. CHECK ELECTRICAL FANS AND CONTROL UNIT. PRESSURISE COOLING SYSTEM. TO CARRY OUT VACUUM AND REGAS	New	1,200.00	1,200.00
4	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND LHS HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANISE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	5,600.00	2,250.00
5	TO RESPRAY FRONT BUMPER, BONNET, HINGES, LHS UPPER A-PILLAR AND BOTH FRONT FENDERS	New	4,900.00	1,400.00
6	TO CARRY OUT DIAGNOSTIC CHECK	New	384.00	384.00
Gross Labour Cost (S\$)			12,714.00	5,764.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >