

CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X
Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Nurnadira Binte ismail
Block 813A Choa Chu Kang Avenue 7 #13-565
Singapore 681813

Your Ref : GBA 5106 S
Our Ref : 201810228/CA
Date : 03 January, 2019
Survey : Third Party

SURVEY REPORT

PARTICULARS OF VEHICLE

| | | | |
|---------------|---------------|------------|------------------|
| Vehicle No. | : GBA 5106 S | Propellant | : Petrol, Auto |
| Make | : Suzuki | Capacity | : 658 cc |
| Type of Body | : 5 Doors Van | Mileage | : 179116 |
| Year & Model | : 2007, Every | Engine No | : K6A7172566 |
| Colour | : White | Chassis No | : DA64V-208202 |
| Passenger-cap | : 4 | Road Tax | : February, 2019 |

TYRES CONDITIONS

| | | | | | |
|-------------|------------|------|-------|------|-----------|
| Front Left | : Compasal | Worn | : 10% | Size | : 155 R12 |
| Front Right | : Compasal | Worn | : 10% | Size | : 155 R12 |
| Rear Left | : Compasal | Worn | : 10% | Size | : 155 R12 |
| Rear Right | : Compasal | Worn | : 10% | Size | : 155 R12 |

PRE-ACCIDENT CONDITION (Static Test Only)

| | | | |
|-----------|---------------|-----------|---------------|
| Handbrake | : Serviceable | Steering | : Serviceable |
| Footbrake | : Serviceable | Paintwork | : Good |

QUANTUM

Repair Estimate : \$ 5,479.43
Revised Amount : \$ 3,900.00 (Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be: **six (6)** days.
We **have not** authorised repairs.

Survey Done At : Precise Auto Service
1 Kaki Bukit Avenue 6, #02-34/36
Autobay @ Kaki Bukit
Singapore, 417883

Assignment Date : 01 October, 2018
Survey Date : 01 October, 2018
Accident Date : 22 September, 2018
Assignment Given By : Nurnadira Binte ismail

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

| Description | Qty | Repair Estimate | Revised Amount | Remarks |
|-------------------------------------|-----|-----------------|----------------|---------------|
| Front bumper fascia | 1 | 549.60 | 549.60 | Torn/Deformed |
| Front bumper side retainer o/s | 1 | 28.00 | 28.00 | To replace |
| Front bumper reinforcement | 1 | 198.00 | 198.00 | Bent |
| Front bumper clip | 10 | 50.00 | 50.00 | To replace |
| Headlamp o/s | 1 | 482.00 | 482.00 | Badly Grazed |
| Front fender o/s | 1 | 212.85 | 212.85 | Badly Bent |
| Front fender splash shield o/s | 1 | 39.70 | 39.70 | Dropped-Off |
| Front fender splash shield clip o/s | 8 | 24.00 | 24.00 | To replace |
| Front knuckle arm o/s | 1 | 274.85 | 274.85 | Bent |
| Front wheel bearing kit o/s | 1 | 225.60 | 225.60 | To replace |
| Front shock absorber o/s | 1 | 228.25 | 228.25 | Bent |
| Front shock absorber mounting o/s | 1 | 56.28 | 56.28 | To replace |
| Front lower arm o/s | 1 | 180.30 | 180.30 | Bent |

| | | | |
|--|----------|----------|----------|
| | 2,549.43 | 2,549.43 | |
| | - | 382.41 | Less 15% |
| | 2,549.43 | 2,167.02 | |

SPECIAL NETT

| | | | | |
|-----------------------------------|-------|--------|--------|--------------|
| Front wheel cap (offside front) | 1 set | 320.00 | 320.00 | Badly Grazed |
| Front tyre o/s | 1 | 250.00 | 250.00 | Damaged |

Total Materials Cost : 3,119.43 2,737.02

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

| Description | Qty | Repair Estimate | Revised Amount | Remarks |
|--|---------------------|-----------------|-----------------|---------|
| Balance brought forward | | 3,119.43 | 2,737.02 | |
| <u>Labour & Miscellaneous Charges</u> | | | | |
| To remove/refit wire harness, all related connectors. Check proper function. Focus headlights. | | 100.00 | 80.00 | |
| To apply underseal and rust-proofing on the affected areas. | | 120.00 | 80.00 | |
| To remove/refit front undercarriage/suspension assembly with all attachments/components. | | 280.00 | 250.00 | |
| To conduct wheel alignment (Before & After). | | 240.00 | 240.00 | |
| To renew offside front tyre and conduct wheel balancing. | | 120.00 | 80.00 | |
| To spray paint replaced/repaired body parts inclusive of preparatory works and painting materials. | | 850.00 | 700.00 | |
| To remove all damaged parts with all necessary components/attachments. To apply hot-works where necessary, straighten chassis members, repair/reshape dented body panels, in accordance with factory specifications. Replace damaged parts, refit and align into position. Refit all necessary components/attachments. | | 650.00 | 500.00 | |
| | | <hr/> | <hr/> | |
| | Grand Total: | 5,479.43 | 4,667.02 | |

Summary

| | | |
|------------------------|----------|------------------------|
| Total Material | 3,119.43 | 2,737.02 |
| Total Labour/Painting | 2,360.00 | 1,930.00 |
| Grand Total | 5,479.43 | 4,667.02 |
| Lump-sum Amount | | <u>3,900.00</u> |

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

CAUSE OF DAMAGE

The vehicle sustained impact along the offside front.

REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.


We checked the damage carefully and were of the opinion that the vehicle could be repaired. We would therefore recommend repairs to be carried out at: **\$ 3,900.00** on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS



Tan Chin Suan (Licensed Appraiser)
A.M.L.M.L., T Eng (CEI) A.L.L.M. (U.K)

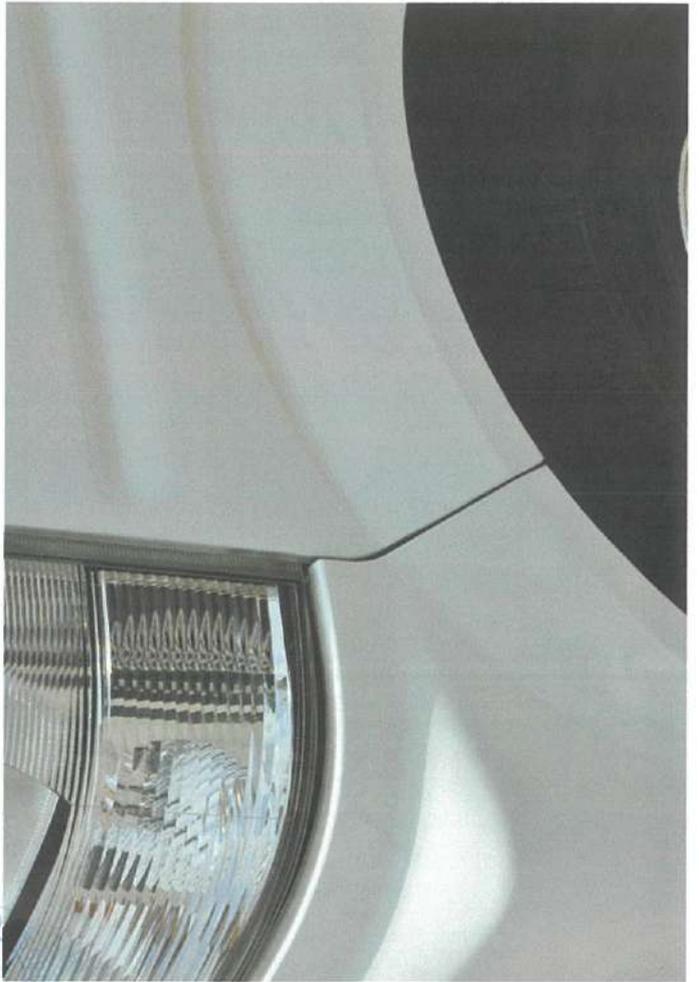

ART
AUTO
S



TO
040







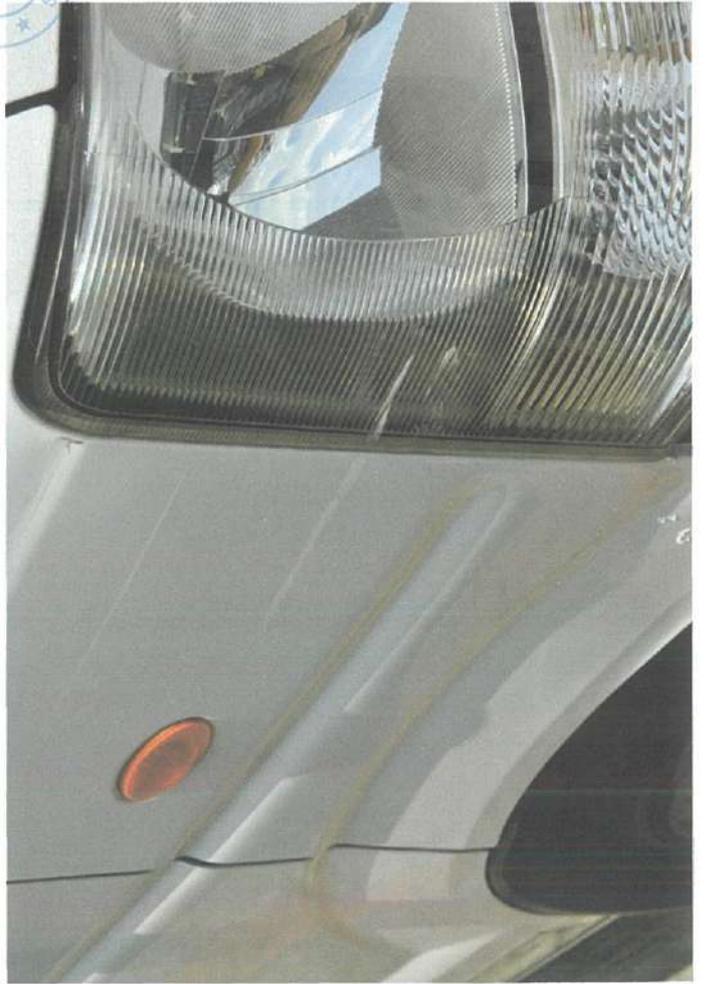






PHOTO
CARS

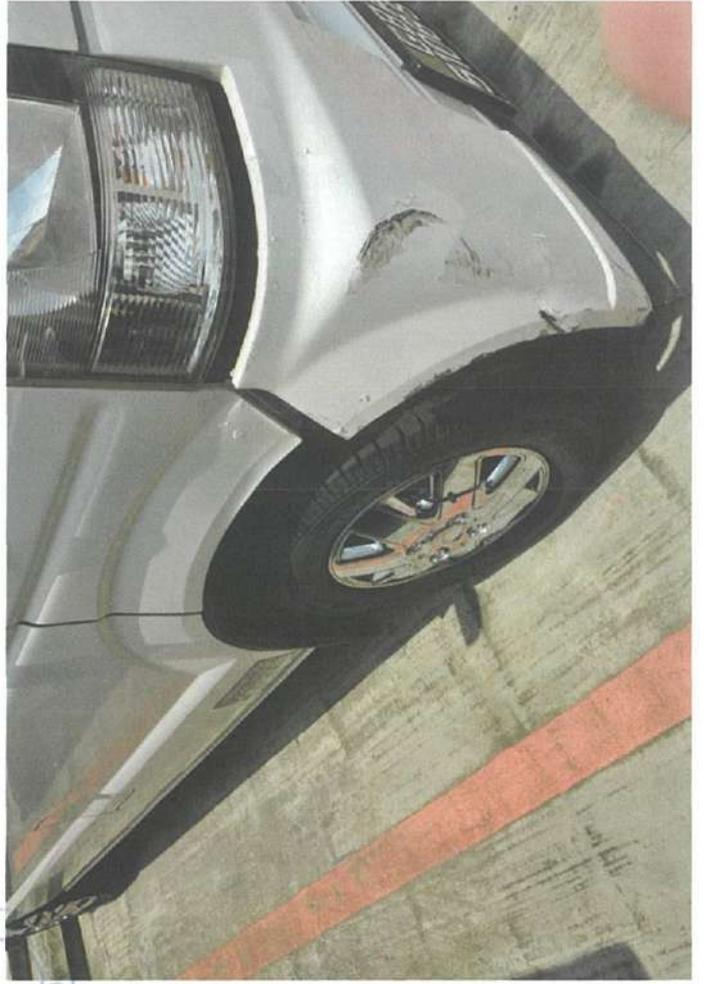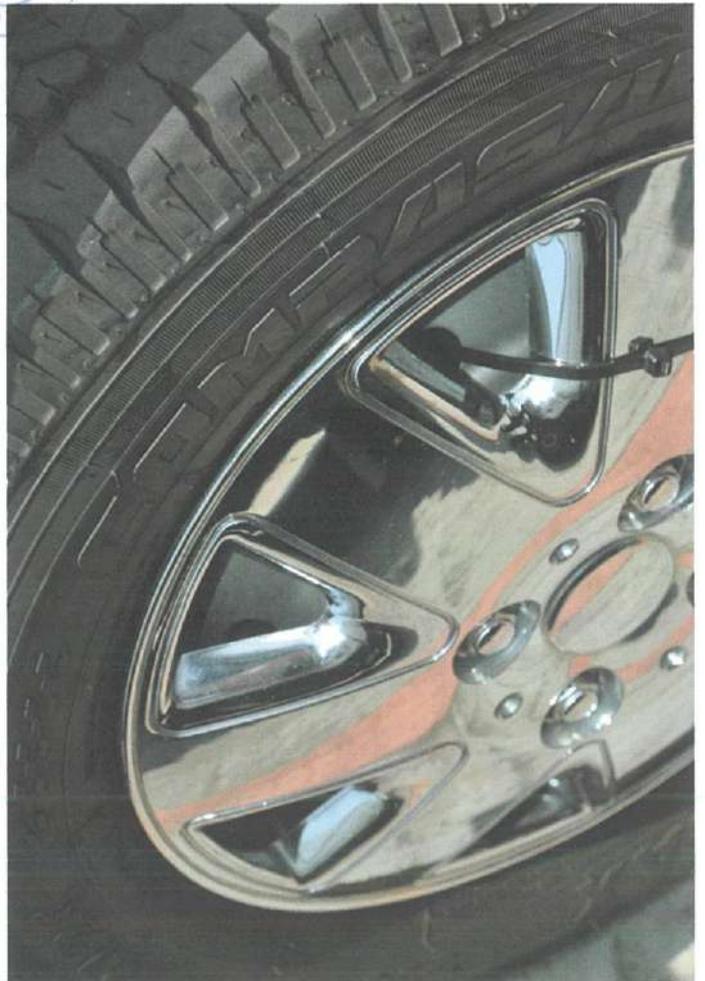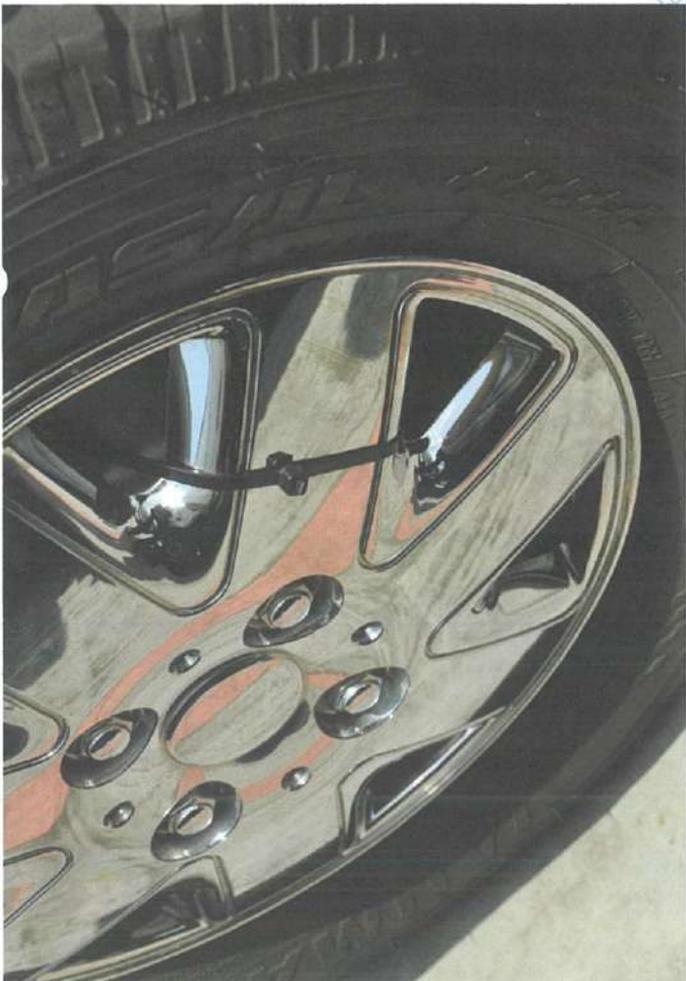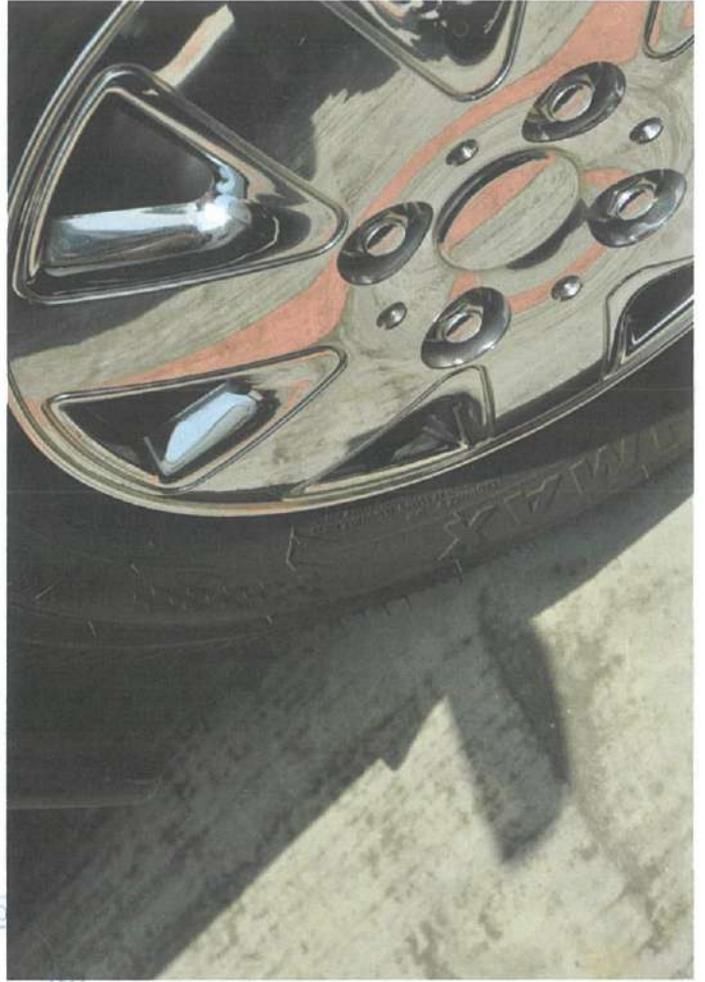
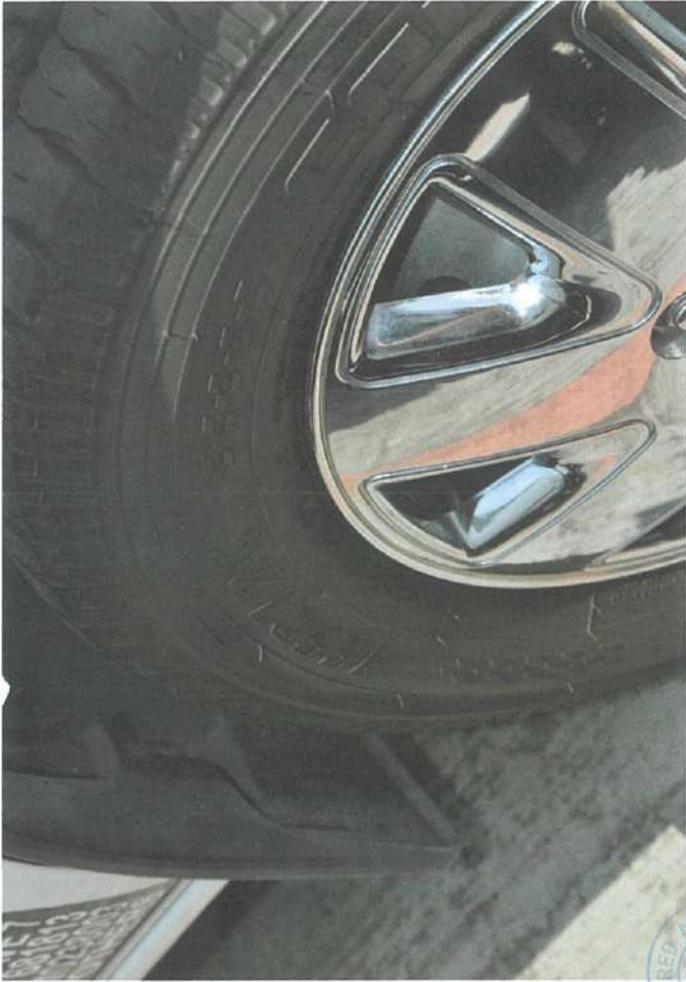



CHESTER AUTO
SRS

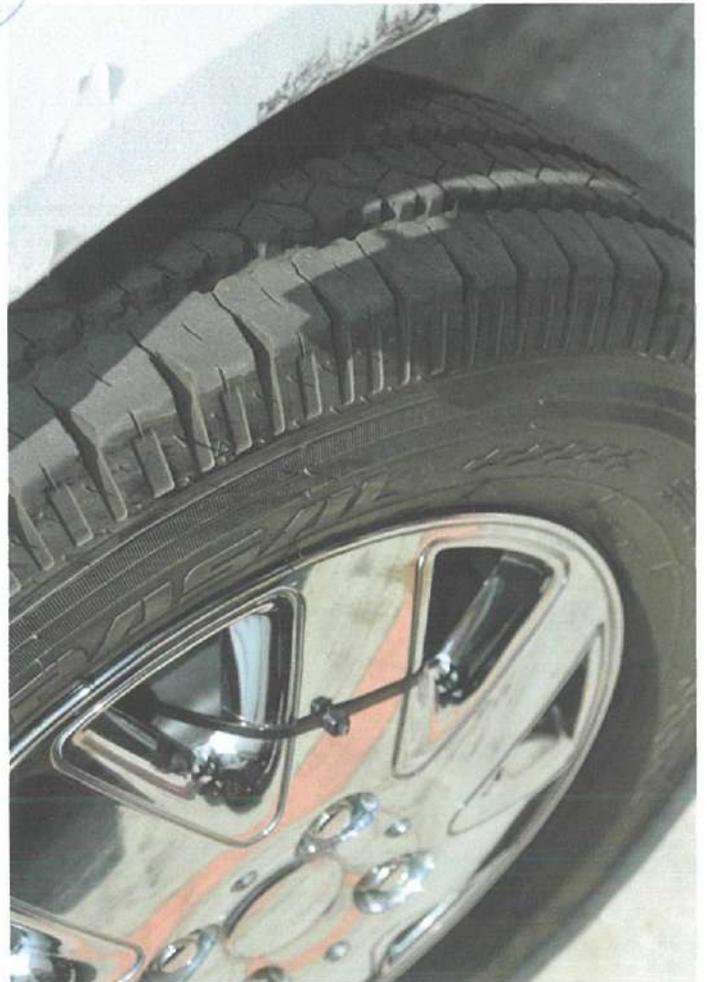



PERDUE
SSE
*

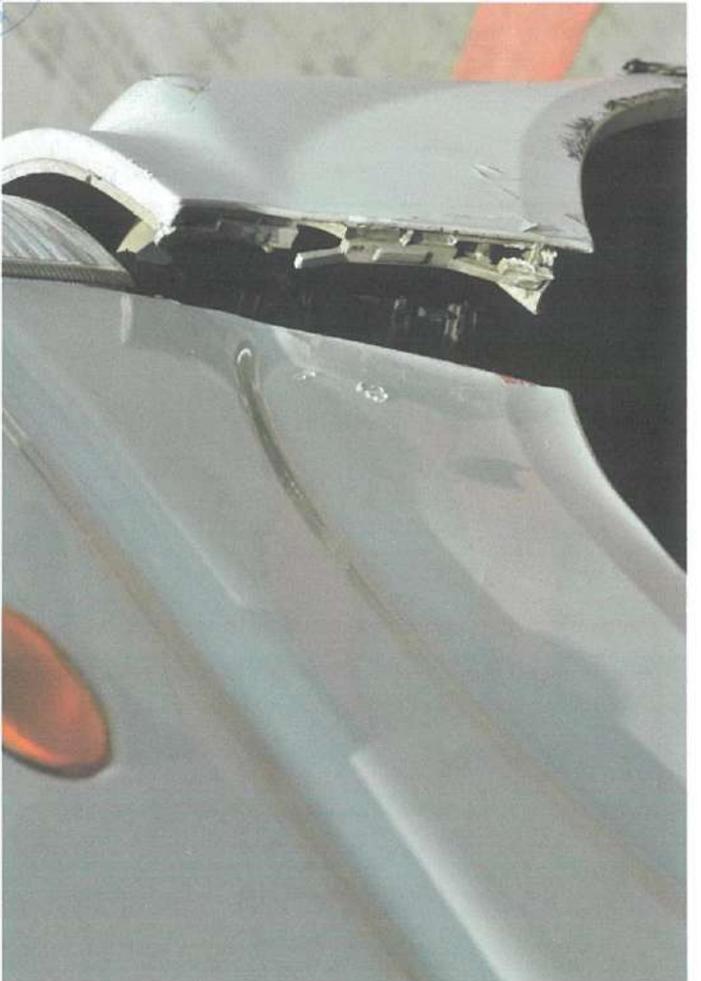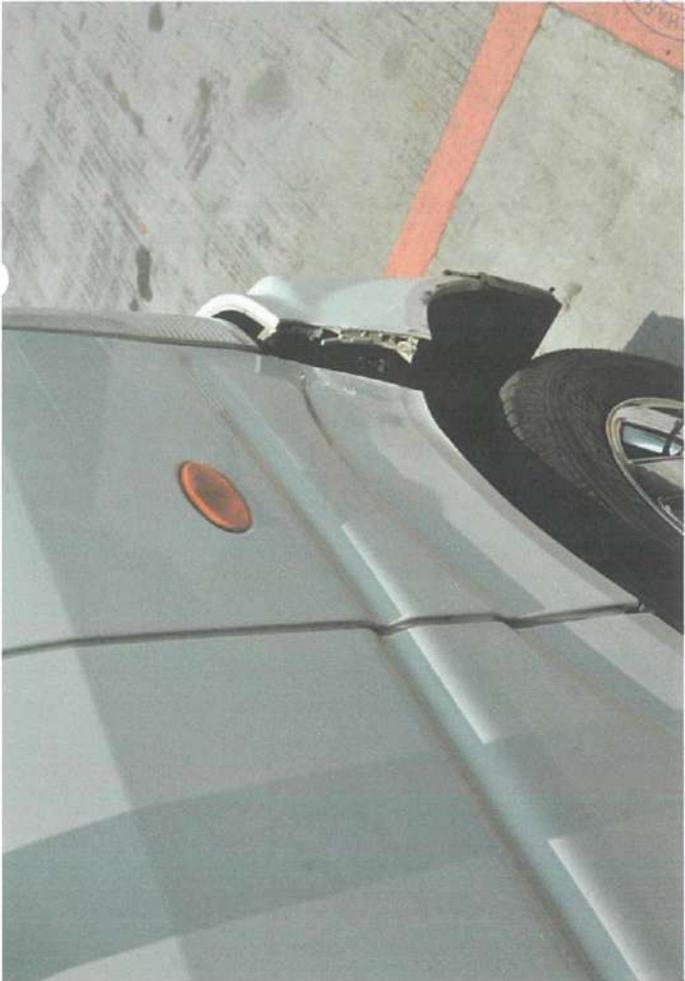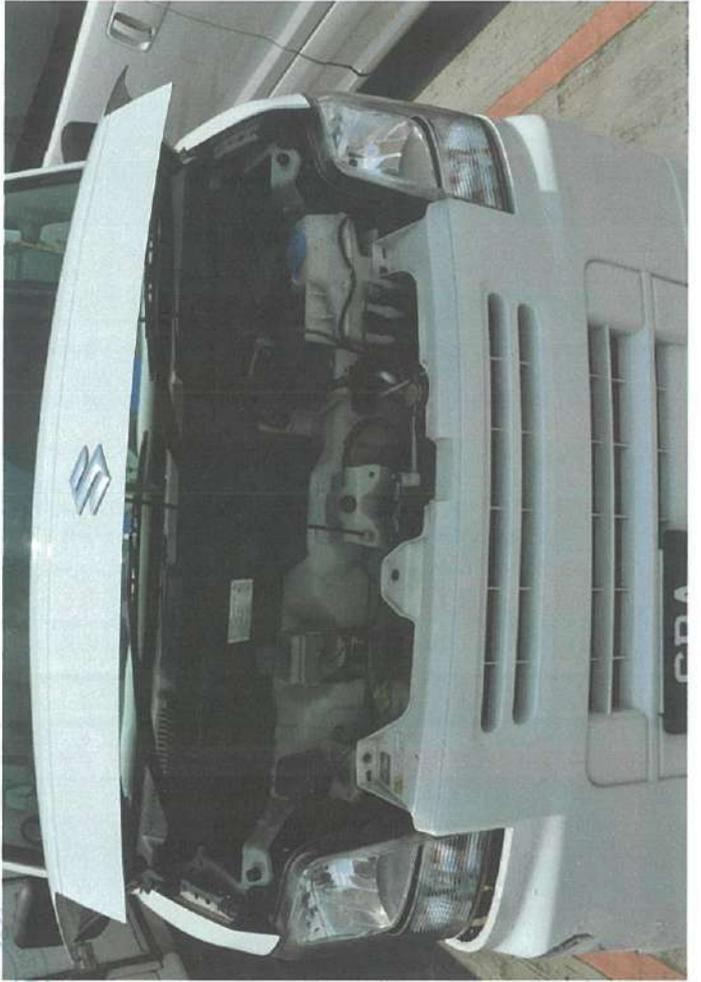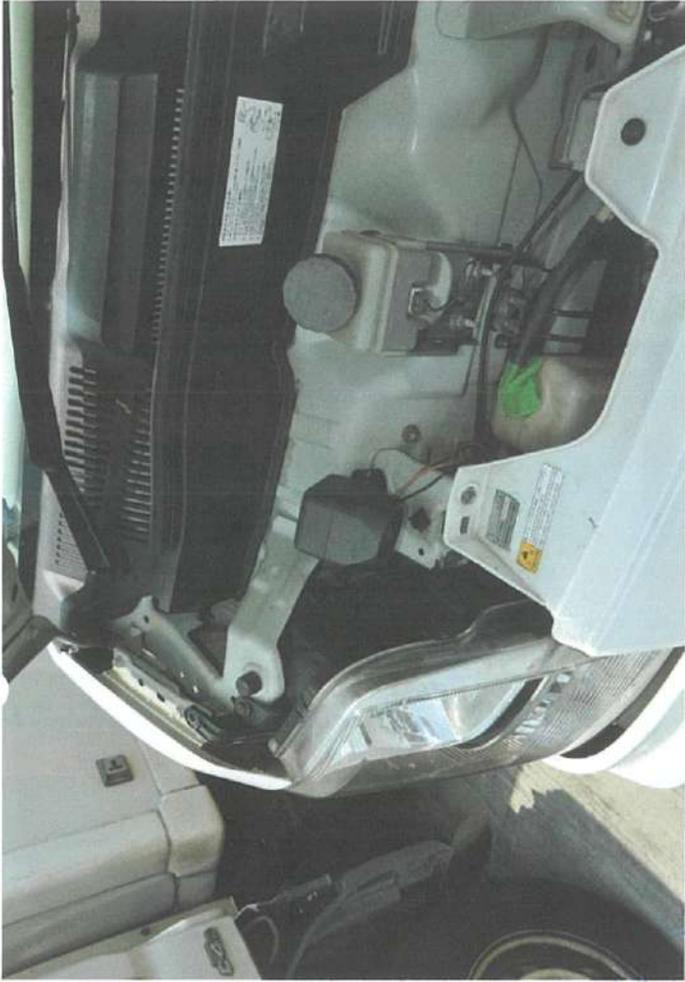


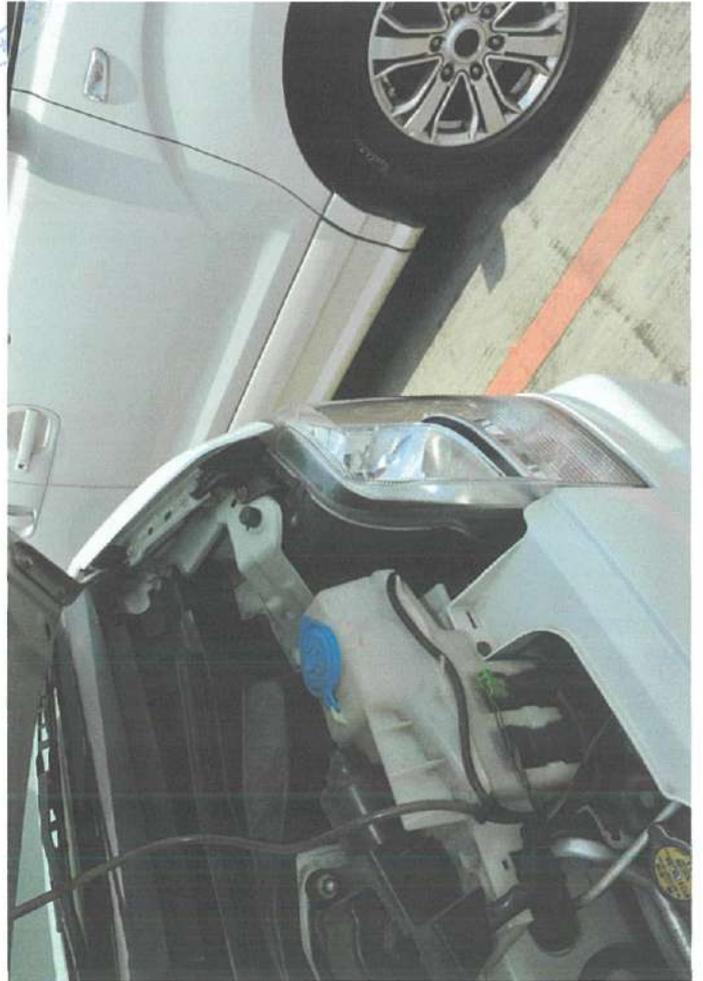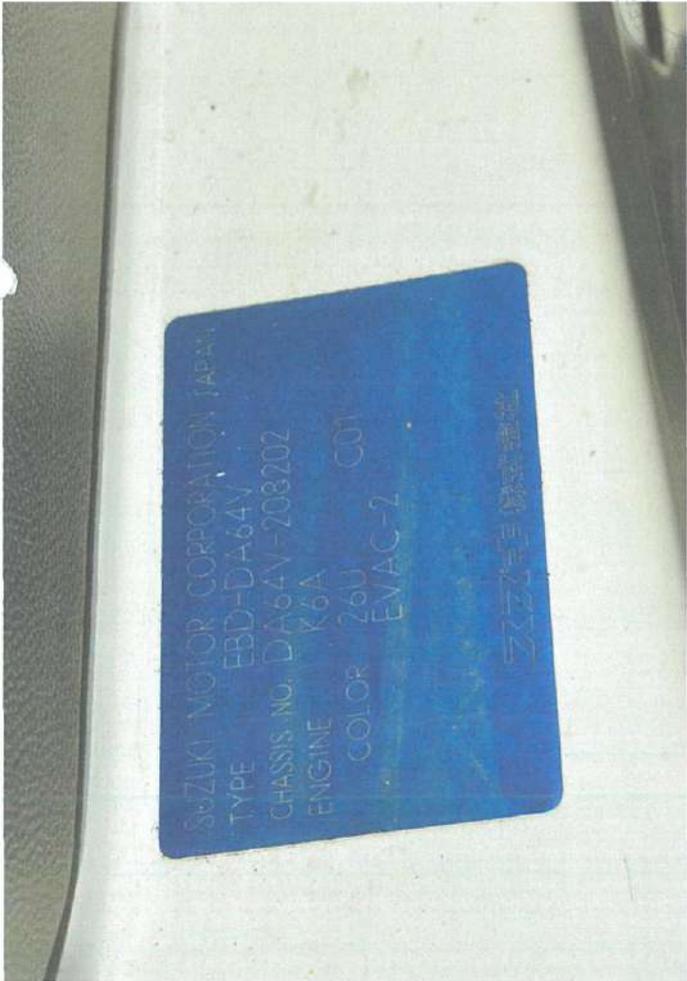


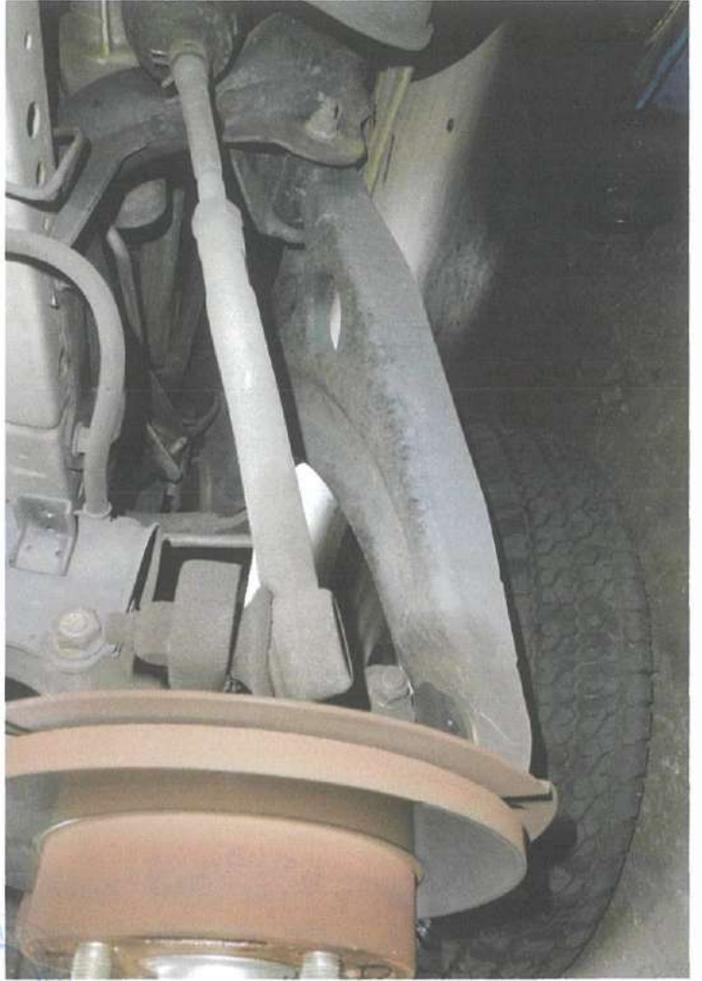

RED AUTO A
SAS
CH

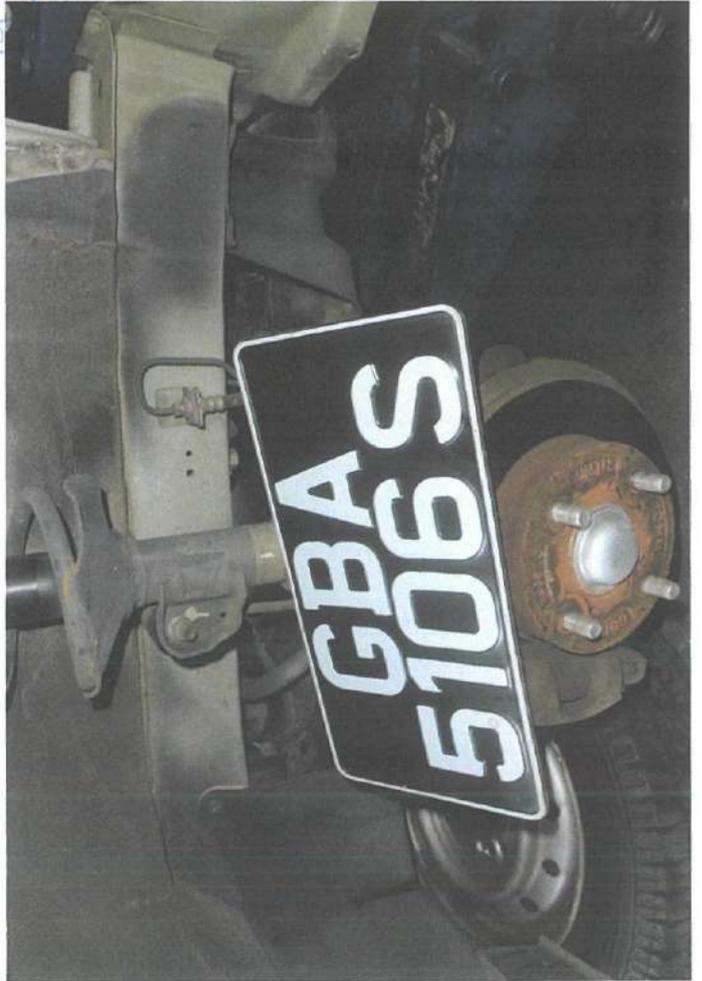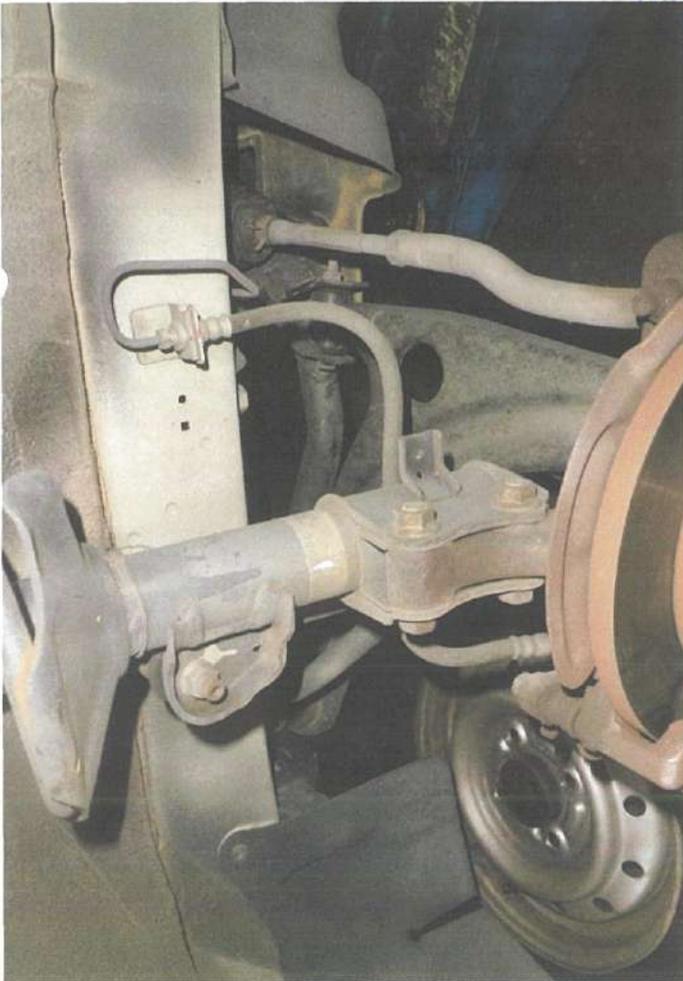

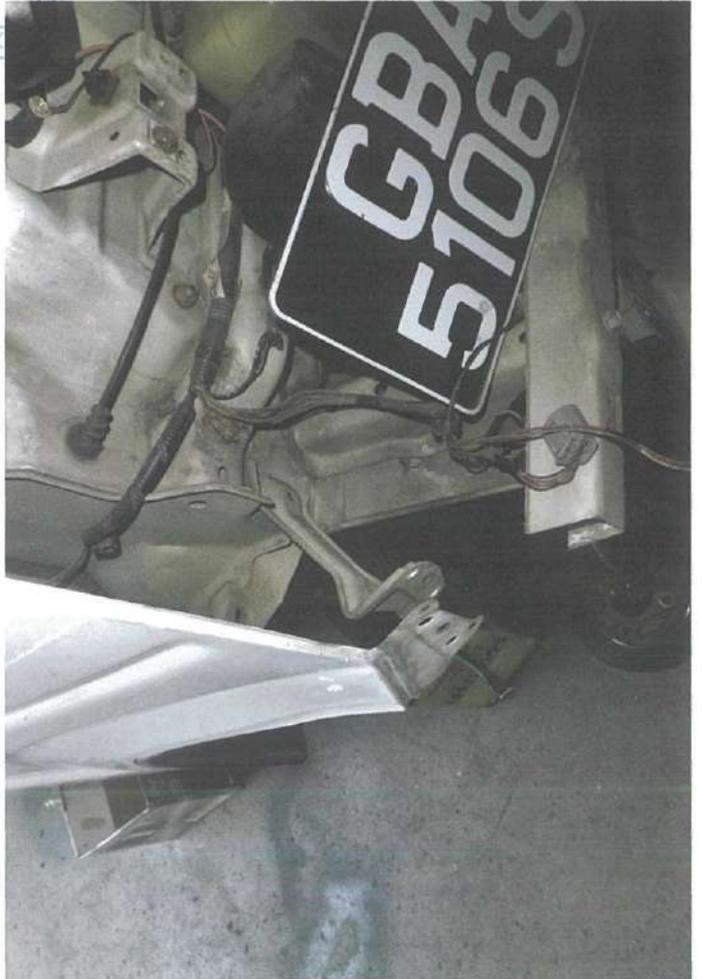

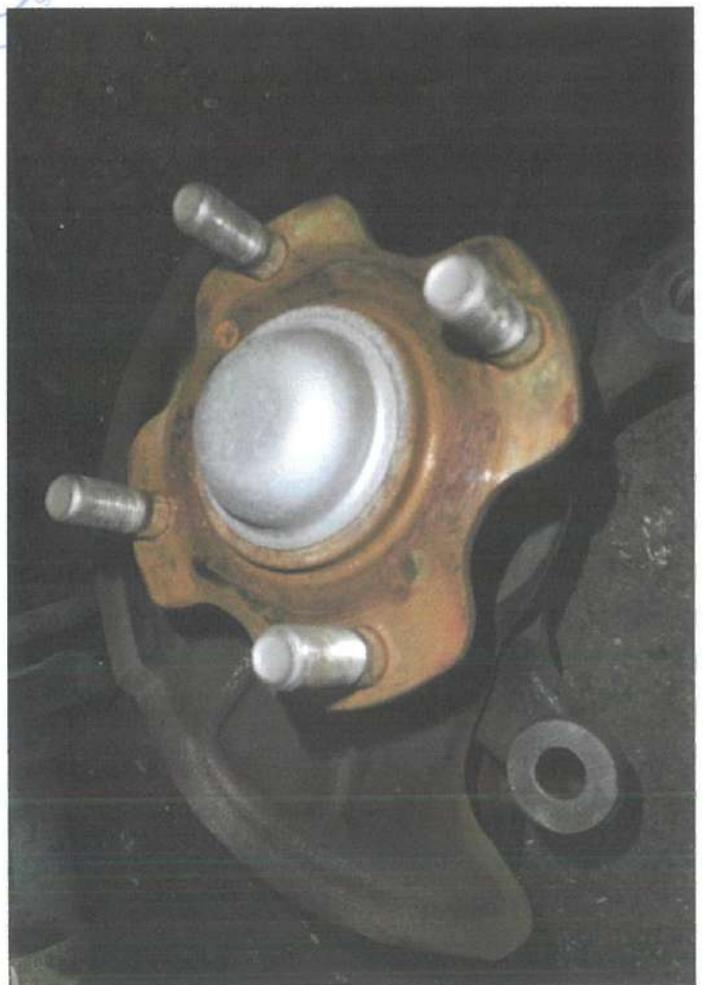

10 AUTO ASSESS

