

CHARTERED AUTO ASSESSORS

17 Joo Seng Road #08-129 Joo Seng Heights Singapore 360017 Reg No. 26910200X
Tel: +65 9631 7008 Fax: +65 6281 9989 Email: charteredauto@gmail.com

Nurnadira Binte ismail
Block 813A Choa Chu Kang Avenue 7 #13-565
Singapore 681813

Your Ref : GBA 5106 S
Our Ref : 201810228/CA
Date : 03 January, 2019
Survey : Third Party

SURVEY REPORT

PARTICULARS OF VEHICLE

Vehicle No.	: GBA 5106 S	Propellant	: Petrol, Auto
Make	: Suzuki	Capacity	: 658 cc
Type of Body	: 5 Doors Van	Mileage	: 179116
Year & Model	: 2007, Every	Engine No	: K6A7172566
Colour	: White	Chassis No	: DA64V-208202
Passenger-cap	: 4	Road Tax	: February, 2019

TYRES CONDITIONS

Front Left	: Compasal	Worn	: 10%	Size	: 155 R12
Front Right	: Compasal	Worn	: 10%	Size	: 155 R12
Rear Left	: Compasal	Worn	: 10%	Size	: 155 R12
Rear Right	: Compasal	Worn	: 10%	Size	: 155 R12

PRE-ACCIDENT CONDITION (Static Test Only)

Handbrake	: Serviceable	Steering	: Serviceable
Footbrake	: Serviceable	Paintwork	: Good

QUANTUM

Repair Estimate : \$ 5,479.43
Revised Amount : \$ 3,900.00 (Lump-sum Without Prejudice)

Under normal circumstances, the repair period would be: six (6) days.
We **have not** authorised repairs.

Survey Done At : Precise Auto Service
1 Kaki Bukit Avenue 6, #02-34/36
Autobay @ Kaki Bukit
Singapore, 417883

Assignment Date : 01 October, 2018
Survey Date : 01 October, 2018
Accident Date : 22 September, 2018
Assignment Given By : Nurnadira Binte ismail

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

Description	Qty	Repair Estimate	Revised Amount	Remarks
Front bumper fascia	1	549.60	✓ 549.60	Torn/Deformed
Front bumper side retainer o/s	1	28.00	✓ 28.00	To replace
Front bumper reinforcement <i>NE NEW</i>	1	198.00	X 198.00	Bent
Front bumper clip	10	50.00	30 50.00	To replace
Headlamp o/s	1	482.00	✓ 482.00	Badly Grazed 284
Front fender o/s <i>Repis</i>	1	212.85	X 212.85	Badly Bent
Front fender splash shield o/s <i>3 NE NEW</i>	1	39.70	X 39.70	Dropped-Off
Front fender splash shield clip o/s	8	24.00	X 24.00	To replace
Front knuckle arm o/s	1	274.85	✓ 274.85	Bent
Front wheel bearing kit o/s	1	225.60	✓ 225.60	To replace
Front shock absorber o/s	1	228.25	✓ 228.25	Bent
Front shock absorber mounting o/s <i>NE NEW</i>	1	56.28	X 56.28	To replace
Front lower arm o/s	1	180.30	✓ 180.30	Bent
		1900.60		
		1615.51		
		2,549.43	2,549.43	
		-	382.41	Less 15%
		2,549.43	2,167.02	

SPECIAL NETT

Front wheel cap (offside front)	1 set	320.00	80 320.00	Badly Grazed
Front tyre o/s <i>NE NEW</i>	1	250.00	X 250.00	Damaged
				80
Total Materials Cost :		3,119.43	2,737.02	

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

Description	Qty	Repair Estimate	Revised Amount	Remarks
Balance brought forward		3,119.43	2,737.02	
<u>Labour & Miscellaneous Charges</u>				
To remove/refit wire harness, all related connectors. Check proper function. Focus headlights.		100.00	80.00 30	
To apply underseal and rust-proofing on the affected areas.		120.00	80.00 30	
To remove/refit front undercarriage/suspension assembly with all attachments/components.		280.00	250.00 200	
To conduct wheel alignment (Before & After).		240.00	240.00 80	
To renew offside front tyre and conduct wheel balancing.		120.00	80.00 X	
To spray paint replaced/repaired body parts inclusive of preparatory works and painting materials.		850.00	700.00 400	
To remove all damaged parts with all necessary components/attachments. To apply hot-works where necessary, straighten chassis members, repair/reshape dented body panels, in accordance with factory specifications. Replace damaged parts, refit and align into position. Refit all necessary components/attachments.		650.00	500.00 300	
				1040.
Grand Total:		5,479.43	4,667.02	

Summary

Total Material	3,119.43	2,737.02
Total Labour/Painting	2,360.00	1,930.00
Grand Total	5,479.43	4,667.02
Lump-sum Amount		<u>3,900.00</u>

total: 2735.51
L/S: 2.1K
04 Days.

Our Ref: 201810228/CA

Vehicle No. GBA 5106 S

CAUSE OF DAMAGE

The vehicle sustained impact along the offside front.

REMARKS

Having checked the scope of repair works we were satisfied that it was in accordance with the damage sustained. We also checked each item and have indicated its nature of damage. It was our opinion that these items were found damaged beyond repair and require replacement.

We checked the damage carefully and were of the opinion that the vehicle could be repaired. We would therefore recommend repairs to be carried out at: **\$ 3,900.00** on a lump-sum basis.

The survey was conducted on a without prejudice basis and we submit this report for your consideration.

CHARTERED AUTO ASSESSORS



Tan Chin Suan (Licensed Appraiser)
A.M.L.M.L., T Eng (CEI) A.L.L.M. (U.K)