



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. GBA 5106S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER FASCIA	TORN / DEFORMED	549.60	549.60
1	FRONT BUMPER SIDE RETAINER O/S	TO REPLACE	28.00	28.00
1	FRONT BUMPER REINFORCEMENT	SERVICEABLE	198.00	-
10	FRONT BUMPER CLIP	TO REPLACE	50.00	30.00
1	HEADLAMP O/S	BADLY GRAZED	482.00	384.00
1	FRONT FENDER O/S	TO REPAIR SEE LABOUR	212.85	-
1	FRONT FENDER SPLASH SHIELD O/S	SERVICEABLE	39.70	-
8	FRONT FENDER SPLASH SHIELD CLIP O/S	SERVICEABLE	24.00	-
1	FRONT KNUCKLE ARM O/S	BENT	274.85	274.85
1	FRONT WHEEL BEARING KIT O/S	TO REPLACE	225.60	225.60
1	FRONT SHOCK ABSORBER O/S	BENT	228.25	228.25
1	FRONT SHOCK ABSORBER MOUNTING O/S	SERVICEABLE	56.28	-
1	FRONT LOWER ARM O/S	BENT	180.30	180.30
	LESS 15% DISCOUNT		-	-285.09
			2,549.43	1,615.51
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET FRONT WHEEL CAP (OFFSIDE FRONT) (SN)	BADLY GRAZED	320.00	80.00
1	FRONT TYRE O/S (SN)	SERVICEABLE	250.00	-
			570.00	80.00
<b><u>LABOUR</u></b>				
	TO REMOVE / REFIT WIRE HARNESS, ALL RELATED CONNECTORS. CHECK PROPER FUNCTION. FOCUS HEADLIGHTS.		100.00	30.00
	TO APPLY UNDERSEAL AND RUST-PROOFING ON THE AFFECTED AREAS.		120.00	30.00
	TO REMOVE / REFIT FRONT UNDERCARRIAGE / SUSPENSION ASSEMBLY WITH ALL ATTACHMENTS / COMPONENTS.		280.00	200.00
	TO CONDUCT WHEEL ALIGNMENT (BEFORE & AFTER).		240.00	80.00
	TO RENEW OFFSIDE FRONT TYRE AND CONDUCT WHEEL BALANCING.	NOT NECESSARY	120.00	-

Report Ref No. CS1/LAW20009392/Aqf3e2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SPRAY PAINT REPLACED / REPAIRED BODY PARTS INCLUSIVE OF PREPARATORY WORKS AND PAINTING MATERIALS.		850.00	400.00
	TO REMOVE ALL DAMAGED PARTS WITH ALL NECESSARY COMPONENTS / ATTACHMENTS. TO APPLY HOT-WORKS WHERE NECESSARY, STRAIGHTEN CHASSIS MEMBERS, REPAIR, RESHAPE DENTED BODY PANELS, IN ACCORDANCE WITH FACTORY SPECIFICATIONS. REPLACE DAMAGED PARTS, REFIT AND ALIGN INTO POSITION. REFIT ALL NECESSARY COMPONENTS / ATTACHMENTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER O/S.		650.00	300.00
			2,360.00	1,040.00
	<b>GRAND TOTAL</b>		<b>5,479.43</b>	<b>2,735.51</b>
	<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>2,100.00</b>

Report Ref No. CS1/LAW20009392/Aqf3e2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.