

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC6/AIG20009502/UES3Q2

Date: 30/12/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800026548

Claimant
Vehicle No : SDB2523L **Insured Vehicle No :** SJJ4905S

Date of Loss: 05/09/2020 Nature of Claim: TP Claim No: 4968741271SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SDB2523L	Engine No:	CZC544708
Make & Model:	VOLKSWAGEN SPORTSVAN, 1.4 (A)	Chassis No:	WVWZZZAUZGW590480
Reg. Date:	27/05/2016 (Man. Year: 2016)	Odometer:	61938 km
Colour:	Grey		
Engine Capacity:	1395 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	225/40R18	Rear Tyre Size:	225/40R18
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	38,082.30	21,127.94	16,954.36	44.52
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,850.00	4,500.00	2,350.00	34.31
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	44,932.30	25,627.94	19,304.36	42.96
Approved Total (Overridden) (\$\$)		20,500.00		
(\$\$)	44,932.30	20,500.00	24,432.30	54.38
+ GST 7.00/7.00% (\$\$)	3,145.26	1,435.00	1,710.26	54.38
Nett Amount (\$\$)	48,077.56	21,935.00	26,142.56	54.38
+ Loss of Use (14.0 x S\$60.00/day) (\$\$)		840.00		
+ Doc/Search Fee (\$\$)		2.00		
Nett Liability (\$\$)		22,777.00		

INSPECTION

Date of Assignment: 07/09/2020

Date Inspected: 07/09/2020 Inspected At:

Fastech Auto Pte Ltd (HQ)
1 Kaki Bukit Ave 6, #01-46/48/50
Autobay
Singapore 417883

Estimated Period of Repair: 13.0 days

Adjuster: MARCUS CHUA**Manager:** Asher Sng Rong Yi

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

MARKET VALUE

MARKET VALUE: \$68,000

LTA REBATE: \$46,508

NETT VALUE: \$21,492

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN MOULDING	Necessary	110.90 F	*110.90 FL
2	1		*TAILGATE	Dented/Bent	1,865.90 F	*1,634.12 FL
3	1		*TAILGATE INNER LOCK	Shorted	299.00 F	*245.50 FL
4	1		*TAILGATE INNER TRIM BOARD	Not Necessary	485.20 F	*- FL
5	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Not Necessary	50.00 F	*- FL
6	1		*TAILGATE REAR LOGO	Necessary	105.00 F	*105.00 FL
7	1		*TAILGATE 230 TSI EMBLEM	Necessary	86.00 F	*86.00 FL
8	1		*TAILGATE GOLF EMBLEM	Necessary	82.00 F	*82.00 FL
9	1		*TAILGATE SPORT VAN EMBLEM	Necessary	80.00 F	*80.00 FL
10	1		*TAILGATE WEATHERSTRIP	Twisted	399.00 F	*297.00 FL
11	2		*TAILGATE REFLECTORS	Not Necessary	970.20 F	*- FL
12	1		*REAR BUMPER	Distorted	1,455.20 F	*1,366.15 FL
13	1		*REAR BUMPER TOW COVER	Torn	45.00 F	*45.00 FL
14	2		*REAR BUMPER REFLECTORS	Cracked	200.40 F	*171.00 FL
15	1		*REAR BUMPER LOWER LIP	Distorted	668.90 F	*550.00 FL
16	2		*REAR BUMPER SIDE RETAINERS	Not Necessary	196.20 F	*- FL
17	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	228.00 F	*228.00 FL
18	1		*REAR BUMPER REINFORCEMENT	Bent	520.00 F	*495.20 FL
19	1		*REAR BUMPER CENTRE RETAINER	Cracked	221.90 F	*221.90 FL
20	1		*REAR BUMPER CLIPS	Necessary	50.00 F	*50.00 FL
21	1		*REAR END PANEL OUTER	Badly Dented	699.00 F	*688.15 FL
22	1		*REAR END PANEL INNER	Badly Dented	554.90 F	*435.15 FL
23	1		*REAR END PANEL TOP GARNISH	Twisted	220.00 F	*220.00 FL
24	1		*REAR FLOOR PANEL	Crumpled/Buckled	1,420.00 F	*1,420.00 FL
25	1		*REAR FLOOR PANEL TOP CLOTH TRIM	Deformed	889.00 F	*889.00 FL
26	1		*REAR FLOOR PANEL TOP BOARD	Not Necessary	665.00 F	*- FL
27	1		*REAR FLOOR PANEL TOOLS SPONGE	Not Necessary	688.00 F	*- FL
28	2		*TAILLAMPS	Scratched/Cracked	1,330.00 F	*1,230.00 FL
29	2		*REAR FENDERS	Repair	2,398.00 F	*- FL
30	1		*REAR FENDER INNER TRIM BOARDS	O/s Torn	1,330.20 F	*665.10 FL
31	1		*REAR EXHAUST	Repair	1,088.90 F	*- FL
32	1		*REAR EXHAUST HEAT SHIELD	Bent	331.00 F	*331.00 FL
33	1		*FRONT BUMPER	Distorted	1,455.90 F	*1,415.66 FL
34	1		*FRONT BUMPER CENTRE GRILLE	Distorted	687.50 F	*488.50 FL
35	1		*FRONT BUMPER CENTRE GRILLE CHROME MOULDING	Scratched	119.00 F	*119.00 FL
36	1		*FRONT BUMPER SPONGE	Torn	220.00 F	*220.00 FL
37	1		*FRONT BUMPER REINFORCEMENT	Bent	766.10 F	*615.11 FL
38	2		*FRONT BUMPER SIDE RETAINERS	Not Necessary	133.00 F	*- FL
39	1		*FRONT BUMPER INNER RETAINER N/S	Cracked	100.00 F	*100.00 FL
40	1		*FRONT BUMPER NOZZLE N/S	Cracked	211.00 F	*188.50 FL
41	1		*FRONT BUMPER NOZZLE COVER N/S	Missing	52.00 F	*52.00 FL
42	1		*FRONT BUMPER PDC SENSORS (2 Pcs)	Shorted (1 Pc only)	398.00 F	*199.00 FL
43	1		*FRONT BUMPER FOG LAMPS	N/s Cracked	900.00 F	*415.00 FL
44	1		*SET FRONT BUMPER CLIPS	Necessary	50.00 F	*50.00 FL
45	1		*BONNET	Dented/Buckled	1,299.00 F	*1,199.25 FL
46	1		*BONNET LOCK	Twisted	398.00 F	*398.00 FL
47	1		*HEADLAMPS	N/s Cracked	5,300.00 F	*2,009.71 FL
48	1		*FRONT GRILLE	Cracked	668.00 F	*668.00 FL
49	1		*FRONT GRILLE LOGO	Necessary	105.00 F	*105.00 FL
50	1		*FRONT SUPPORT PANEL	Cracked	1,066.00 F	*1,016.15 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
51	1		*AIRCON CONDENSER	Serviceable	885.00 F	*- FL
52	1		*AIRCON CONDENSER SIDE GARNISH	Torn	95.00 F	*95.00 FL
53	1		*RADIATOR	Punctured	988.00 F	*945.15 FL
54	1		*RADIATOR FAN ASSY	Not Necessary	1,245.00 F	*- FL
55	1		*FRONT FENDER	Repair	678.00 F	*- FL
56	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*50.00 FS
57	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
58	1		*REAR LICENCE PLATE W/HOLDER	Not Necessary	50.00 FS	*- FS
59	1		*SET REAR FLOOR PANEL INSULATOR	Necessary	280.00 FS	*120.00 FS
60	1		*FRONT LICENCE PLATE W/HOLDER	Bent	50.00 FS	*40.00 FS
61	1		*BOL RADIATOR COOLANT	Necessary	50.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) **38,082.30** **22,225.20**
- List Item Discount on L Items 0.00/5.00% (\$\$) **0.00** **1,097.26**

Total Parts (\$\$) **38,082.30** **21,127.94**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO CHECK WIRING	New	80.00	30.00
2	TO DISMANTLE & REPLACED PDC SENSOR	New	80.00	50.00
3	TO DISMANTLE & REFIX REAR WINDSCREEN	New	150.00	120.00
4	TO TRANSFER TAILGATE MECHANISM	New	100.00	60.00
5	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	120.00	100.00
6	TO DISMANTLE & REFIX REAR EXHAUST	New	120.00	60.00
7	TO DISMANTLE & REFIX FUEL TANK	New	100.00	60.00
8	TO SPRAY RUST PROOFING	New	180.00	120.00
9	TO REFILL AIR CON GAS	New	120.00	100.00
10	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	3,000.00	2,000.00
11	TO PUTTY & SPRAY PAINTING	New	2,800.00	1,800.00
Gross Labour Cost (\$\$)			6,850.00	4,500.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >