



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

AUTO & GENERAL INSURANCE (S) PL
(BUDGET DIRECT INSURANCE)
190 CLEMENCEAU AVENUE #03-01
SINGAPORE SHOPPING CENTRE
SINGAPORE 239924

INV No. AC2007070
INV Date 19/10/2020
Reference CS/AGI20009543/Aqf3q2
Code AGI



PROFESSIONAL SERVICE FEE

Vehicle No. SLW 9366Y

Insured Veh. SGZ 1937X

Claim No. C10007224

Policy No.

Accident Date 05/09/2020

Inspection Date 09/09/2020

Description	Total
Survey Inspection	350.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	350.00
GST (7%)	24.50
Grand Total	374.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AUTO & GENERAL INSURANCE (S) PL		Ref : CS/AGI20009543/Aqf3q2	
(BUDGET DIRECT INSURANCE) 190 CLEMENCEAU AVENUE #03-01 SINGAPORE SHOPPING CENTRESINGAPORE 239924		Date : 19-10-2020	
Code : AGI			
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SGZ 1937X	Veh. Inspected	SLW 9366Y
Policy No.		Coverage (\$)	0.00
Claim No.	C10007224	Excess (\$)	0.00
Assign From	IVY RATILLA	Assign Date	07/09/2020
2. Vehicle Particulars & Condition			
Make & Model	HYUNDAI ELANTRA	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2018
Chassis No.	KMHD841CMJU645461	Colour	SILVER
Odometer	61953	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	205/55 R16	ROADSTONE	6 mm
L/H Front Tyre	205/55 R16	ROADSTONE	6 mm
R/H Rear Tyre	205/55 R16	ROADSTONE	6 mm
L/H Rear Tyre	205/55 R16	ROADSTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE REAR O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	05/09/2020	Inspection Date	09/09/2020
Survey held at	VISION AUTOWORK PTE LTD 8 KAKI BUKIT AVE 4, #08-09 PREMIER @ KAKI BUKIT SINGAPORE 415875		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLW 9366Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	REAR BUMPER	DEFORMED	459.40	459.40
1	REAR BUMPER MUDFLAP RH	NOT NECESSARY	159.00	-
1	REAR BUMPER REFLECTOR RH	CUT	40.80	40.80
1	REAR BUMPER LOWER LIP	CUT	250.10	250.10
2	REAR BUMPER RETAINER @\$44.30	O/S NECESSARY	88.60	44.30
1	REAR BUMPER REINFORCEMENT	BENT	294.80	294.80
5	REAR BUMPER BRACKET @\$6.00	NOT NECESSARY	30.00	-
1	REAR BUMPER INNER GARNISH RH	NOT NECESSARY	15.00	-
1	REAR BUMPER LOWER GARNISH RH	NOT NECESSARY	37.20	-
1	TAILLAMP RH	CRACKED	876.00	876.00
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	197.40	-
1	BOOTLID LAMP RH	NOT NECESSARY	664.20	-
1	REAR END PANEL	DENTED	454.60	454.60
1	REAR END PANEL TOP GARNISH	NOT NECESSARY	59.80	-
1	REAR FENDER RH	TO REPAIR SEE LABOUR	1,470.00	-
1	REAR FENDER COWLING RH	NOT NECESSARY	250.00	-
2	REAR FENDER INNER TRIM @\$208.00	NOT NECESSARY	416.00	-
1	REAR FENDER AIR VENT RH	CRACKED	107.40	107.40
1	REAR WINDSCREEN MOULDING	NOT NECESSARY	180.00	-
	LESS 20% DISCOUNT		-1,210.06	-505.48
			4,840.24	2,021.92
<u>SPECIAL NETT ITEMS</u>				
1	SET REAR BUMPER CLIP (SN)	NECESSARY	80.00	30.00
1	SET TAILLAMP CLIP RH (SN)	NECESSARY	30.00	10.00
1	TAILLAMP PANEL SEALANT RH (SN)	NOT NECESSARY	60.00	-
1	REAR FENDER SEALANT RH (SN)	NOT NECESSARY	150.00	-
1	SET REAR FENDER COWLING CLIP (SN)	NOT NECESSARY	80.00	-
1	SET REAR FENDER INNER TRIM CLIP (SN)	NOT NECESSARY	80.00	-
1	REAR WINDSCREEN GLASS SEALANT (SN)	NOT NECESSARY	80.00	-

Report Ref No. CS/AGI20009543/Aqf3q2

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WINDSCREEN GLASS INNER SHIELD RH (SN)	NOT NECESSARY	60.00	-
1	REAR END PANEL INSULATION SEAL (SN)	NECESSARY	150.00	60.00
1	SET REAR END PANEL TOP GARNISH CLIP (SN)	NOT NECESSARY	60.00	-
1	SET REVERSE SENSOR (SN)	NOT NECESSARY	220.00	-
			1,050.00	100.00
	LABOUR			
	PANEL BEATING ,REMOVAL AND REPLACING PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMP PANEL RH AND REAR FENDER RH .		1,400.00	600.00
	TO SPRAY PAINT AFFECTED AREA.		1,400.00	600.00
	TUFF COAT.		250.00	50.00
	WIRING CHECK .		250.00	30.00
	REMOVE & REFIX CUSHION SEAT /UPHOLSTERY & ROOF LINING TO FACILITATE REPAIR.		350.00	60.00
	REMOVE AND REFIX REVERSE SENSOR AND DISTANCE SETTING.		80.00	50.00
	REMOVE & REFIX REAR WINDSCREEN .	NOT NECESSARY	120.00	-
	REMOVE AND REFIX REAR EXHAUST PIPE .	NOT NECESSARY	180.00	-
	CONDUCT WATER LEAKAGE TEST.	NOT NECESSARY	120.00	-
	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT /CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC.	NOT NECESSARY	350.00	-
			4,500.00	1,390.00
GRAND TOTAL			10,390.24	3,511.92
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,800.00

Report Ref No. CS/AGI20009543/Aqf3q2

ADRIAN LING WAI PING**B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI****Licensed Appraiser**

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 9366Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLW 9366Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

