

**ASSIGNMENT**

Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 P / WS / TP RES / OD RES / EVA / INV / MV  
 Subject Vehicle No: \_\_\_\_\_  
 Workshop m/s: Tropical  
925K  
 Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (s Record)  
 Veh: \_\_\_\_\_

N/S	O/S

Condition)  
 The veh had commenced its repair at the time of inspection.  
 Market Value: \_\_\_\_\_  
 Incident Report: \_\_\_\_\_ Consistent? : Yes or No  
 Seen: \_\_\_\_\_ Consistent? : Yes or No  
 Days: 02 days Res.: Yes or No  
1.0.1 % 3 Val.: Yes or No  
 V / REP. / 24 HRS  
 Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: GBJ 1255Z Yr Regn: 01, 19  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or \_\_\_\_\_  
 Make: Toy Dyno c.c. 2982  
 Colour: Silver A/C: Insured / Std / NI / NA  
 Sp. Reading: 79326 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: JTFAT 35YX OK 212332  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Brakes: In order / Jammed / Leaked / Burnt or \_\_\_\_\_  
 Mod: NII / S/Rlm / STD A/Rlm or \_\_\_\_\_  
 Tyre Size: F: Mic 195R15 XJ  
 R: Yoko 155R12 X 81D  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or \_\_\_\_\_  
 Front Rear  
 R/Bal. 4 mm 3 3 mm  
 L/Bal. 4 mm 3 3 mm  
 D.O.A. 26/8/20 D.O.I. 7/10/2020  
 Survey held at \_\_\_\_\_  
 Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or  
O/S 1st  
 The UIC / Chassis frame / Body Structure affected due to collision.

Action / Instruction
<u>350K Cash</u>

Pass to?  : Prel. Report  
 : Final Report  
 Return to? \_\_\_\_\_  
 Days Of Repair: \_\_\_\_\_  
 Resurvey No. of Trip: \_\_\_\_\_  
 Add Fee:  : Site Insp (\$ \_\_\_\_\_)  
 : Interview (\$ \_\_\_\_\_)  
 : Tech Invs (\$ \_\_\_\_\_)  
 : Weekend (\$ \_\_\_\_\_)  
 Survey Fee: \_\_\_\_\_  
 Transportation: \_\_\_\_\_  
 S + RS. \$ \_\_\_\_\_  
 Fuel \$ \_\_\_\_\_  
 Others \_\_\_\_\_  
 TOTAL \_\_\_\_\_

mat : \_\_\_\_\_  
 /L.B.I: (\$ \_\_\_\_\_)

# Tropical Tech Automobile Services

BLK 5030 ANG MO KIO AVENUE 3 #01-201 INDUSTRIAL PARK 2 SINGAPORE 569535

TEL: 6481 7773 / 6481 1403 FAX: 6484 4978

E-mail: tsac303@singnet.com.sg

M / s : **First Capital Insurance Ltd**  
36, Robinson Road, #16-01  
City House, Singapore 068877

*Not Authorized*

Estimate bill : TT 35 / 20 / TP / WT

Attn : **Motor Claims Department**  
Tel : 65073848  
Fax : 65073849

*Recovery After Paint*

Registration No : GBJ1255Z

*2 days*

Make / model : Toyota Dyna 150

Mileage :

Date : 08 / 09 / 2020

**TRAFFIC ACCIDENT INVOLVING VEHICLE BEARING REGISTRATION NO : SH7149S AND GBJ1255Z ALONG CAIRNHILL ROAD ON 26 AUGUST 2020 AT 1335 HRS.**

lpc	RH door	\$	<i>12</i>	1,649.00	X
	Sub total :	\$		1,649.00	
	Less 10% discount:	\$		164.90	
	A total :	\$		1,484.10	
	Remove & refit RH door.	\$		400.00	<i>150</i>
	Heat / weld / beating / pull / straighten / align front chassis frame by Chassis Alignment Jack.	\$		400.00	
	Tuff kote front damaged portion.	\$	<i>12</i>	150.00	X
	Putty / primer application, spray painting RH door.	\$		400.00	<i>200</i>
	<b>Grand final amount:</b>	\$		<b>2,434.10</b>	

LKK Auto Consultants hence notify the Repairer of the following:

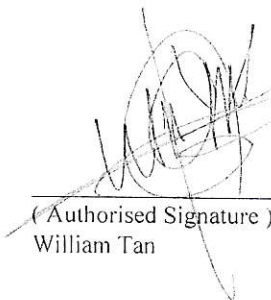
- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Tropical Tech Automobile Services

  
( Authorised Signature )  
William Tan

