

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/AIG20009676/QSF3E2

Date: 23/09/2020

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd.	Policy No: 2070104576
Claimant Vehicle No : FBP1893A	Insured Vehicle No : SMT6556P
Date of Loss: 08/09/2020	Nature of Claim: TP Claim No: 1734914921SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBP1893A		
Make & Model:	YAMAHA MX KING T150, 150cc	Engine No:	G3E6E0469742
Reg. Date:	21/02/2019 (Man. Year: 2018)	Chassis No:	MH3UG0750KK008809
Colour:	Blue	Odometer:	21997 km
Engine Capacity:	150 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	80/90-17	Rear Tyre Size:	80/90-17
Front Left Side:	Michelin 5 mm	Rear Left Side:	Michelin 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	10/09/2020	
Date Inspected:	14/09/2020	Inspected At: Speedy Motor Cycle Service Centre (HQ) 10 ANG MO KIO IND PARK 2A #05-21 Singapore 568047
Estimated Period of Repair:	3.0 days	

Adjuster: OI SUN PIN

Manager: Hiew May Fung

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT NUMBER PLATE	Necessary	0.00 F	*- F
2	1		*FRONT HEADLAMP	Scratched	0.00 F	*- F
3	1		*FRONT HEADLAMP FAIRING	Scratched	0.00 F	*- F
4	1		*FRONT WINDSHIELD	Scratched	0.00 F	*- F
5	1		*FRONT WING MIRROR	Scratched	0.00 F	*- F
6	1		*HANDLE BAR	Bent	0.00 F	*- F
7	1		*HANDLE BAR BALANCER LH	Scratched	0.00 F	*- F
8	1		*CLUTCH LEVER	Scratched	0.00 F	*- F
9	1		*SIDE FAIRING LH	Scratched	0.00 F	*- F
10	1		*SIDE FAIRING INNER GARNISH BLACK	Scratched	0.00 F	*- F
11	1		*CENTER FAIRING LOWER	Scratched	0.00 F	*- F
12	1		*FRONT FOOT REST LH	Scratched	0.00 F	*- F
13	1		*STICKER YAMAHA	Necessary	0.00 F	*- F
14	1		*FOOT GEAR LEVEL	Scratched	0.00 F	*- F
15	1		*FRONT BASKET	Scratched	0.00 F	*- F
F=Franchise part.						
Total Parts (S\$)					0.00	0.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >