

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 417800 Hotline: **6385 1171** 

Our reference:

20-02-9080

Date:

22/2/2020

INVOICE NO.

9080

See Toh Rong Yao

c/o Assure Auto Assist Pte Ltd 23 Tuas Avenue 18 Singapore 638902

Registration No.

**SMP4140P** 

We enclose our fee note for your kind attention, which remains payable irrespective of the outcome of this case.

S/No.	Description of Services Provided	Qty	Amount
1	Being vehicle damage assessment report, inspection, photographs, transport and miscellaneous.	1	\$ 459.00
		Total amount	\$ 459.00

Please kindly cross all cheques made payable to "Impact Analysis Consultant".

We thank you in anticipation for your prompt payment.

V

L. L. Tan (Ms)

Principal Consultant



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference: 20-02-9080

Date: 22/2/2020

c/o Assure Auto Assist Pte Ltd 23 Tuas Avenue 18 Singapore 638902

**Dear Sirs** 

RE: Road Traffic Accident on 26/1/2020

See Toh Rong Yao

In accordance with your instructions received in this office on 10/2/2020 , we made arrangements to examine the vehicle on 10/2/2020 at above-mentioned address. The following data was

recorded:

#### Vehicle details

Make	Hyundai	Registration	SMP4140P
Model	130	Chassis	TMAH3513VKJ114009
Colour	Grey	Gearbox	Auto
Odometer	4842km	Paintwork	Good
Steering	In order	Brakes	In order
Condition	Good		

### **Tyre Depths**

Front left	225/40R18	90% Goodyear
Front right	225/40R18	90% Goodyear
Rear left	225/40R18	90% Goodyear
Rear right	225/40R18	90% Goodyear

Status	REPAIRABLE
Magnitude	Medium
Legal status	Unroadworthy

### Impact Direction & Area of Damage:



Following our examination of the accident damage, we have calculated repair times and method, which are detailed on page 2 & 3. We would recommend a sum of \$2,353.94 and 4 working days for repair, which is sufficiently lower than the pre accident value to render the vehicle an economically and physically reliable proposition.

Subsidiaries of Impact Analysis Consultant:

- Impact Analysis Consulting Pte Ltd
   Impact Analysis Academy Pte Ltd
   IA Racking Solutions Pte Ltd
- IA Accounting & Consultancy Pte Ltd → Infoknights International Services (Philippines) → IABN Pte Ltd www.iaconsultingsg.com

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: 6385 1171

Our reference

20-02-9080

Date

22/2/2020

Page

2

# Section A: Damaged Parts Assessment

Part's Description	Qty	Condition As inspected	Repairer's Estimate	Our Adjustment
List Items:		Marin Callan State of State of		
Front bumper	1	deformed/holder torn	752.00	752.00
Front bumper side retainer @\$23.70	2	necessary	47.40	47.40
Front bumper reinforcement	1	repair	452.30	0.00
Front bumper tow cover	1	grazed	22.00	22.00
Front radiator grille	1	cut	201.50	201.50
Front radiator grille logo	1	necessary	28.90	28.90
Front radiator grille strip chrome	1	grazed	275.00	275.00
Front headlamp @\$1215.00	2	refix	2430.00	0.00
	Sub- Tota	ıl costs	4209.10	1326.80
Percenta	ge discount :	20%	841.82	265.36
s	ub-Total cost	ts for parts	3367.28	1061.44
Special Nett Items:				
Front bumper clips	1 set	necessary	50.00	50.00
Protection coating	1	necessary	550.00	550.00
Front number plate	1	cut	50.00	50.00
S	ub-Total cost	ts for parts	650.00	650.00
Parts Repair				
	*	*	0.00	0.00
	Sub- Tota	al costs	0.00	0.00
	Total costs	for parts	4017.28	1711.44

Subsidiaries of Impact Analysis Consultant:

• Impact Analysis Consulting Pte Ltd • Impact Analysis Academy Pte Ltd • IA Racking Solutions Pte Ltd

<sup>•</sup> IA Accounting & Consultancy Pte Ltd • Infoknights International Services (Philippines) • IABN Pte Ltd www.iaconsultingsg.com

No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780

Hotline: 6385 1171

Our reference 20-02-9080

Date 22/2/2020

3 Page

### **Section B: Labour Cost Calculation**

	Ho	urly rate	Manhr. Req.	Total
To dismantle, replace, cut, weld, knock out dents to straighten accident parts as-mentioned on the 'Parts Repair' column inclusive of replacement parts.		45.00	8	\$ 360.00
Putty & Spray painting to adjacent panels. Job allowance. Paint / material.	. Sub-contract work. \$		\$ 250.00	
Apply rust proofing on the adjacent panels.	1	Sub-con	tract work.	\$ 10.00
Wiring and bulb checking	\$	45.00	0.5	\$ 22.50
	\$		0	\$
	-	Total la	bour cost	\$ 642.50

Manhour rate and the number of manhours required for each repairing task are formulated based on individual workshop's operating cost and in-house@ IA Research Guidelines respectively.



No.25 Kaki Bukit Road 4 #06-46 Synergy @KB Singapore 41780 Hotline: **6385 1171** 

Our reference

20-02-9080

Date

22/2/2020

# **Section C: Summary Table of Total Repair Cost**

Description  Damaged Parts  Assessment (See section A)		Cost	
		\$1,711.44	
Part	-by-part		
Further discount	0%	\$0.00	
Recommended cost of parts replacement		\$1,711.44	(1)
Labour Cost Calculation (See section B)		\$642.50	(2)
Total Repair Cost (Round off to hundred)		\$2,353.94	(1) + (2)

We would recommend a sum of	\$2,353.94	and	4	working days for repair
No further items will be approved w	vithout our express	ed written agreem	nent. Any sign	ificant additional
items will be subject to a supplement	ntary report.			

V

Mechanical Engineer, Accident Expert Witness, Licensed Appraiser (Automobile)

B.Eng. (Hons, NUS)

Diploma.Mechanical Engineering

NTC-2 Automovite Technology

Sr.MIES, Institution of Engineers, Singapore (#20100091)

MATAI, Maryland Association of Traffic Accident Investigators

IAARS, International Association of Accident Reconstruction Specialists

PMC of Singapore Business Advisors & Consultants Council

ACTA certified Trainer, Singapore

SPRING- Recognised Certification for Management Consultants



















