



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGP 7362S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	BUMPER REAR	CRUMPLED	683.50	532.00
1	BUMPER RETAINER REAR LH	BROKEN	48.60	48.60
1	BUMPER RETAINER REAR RH	SERVICEABLE	48.60	-
1	BUMPER REAR INNER SPONGE	SERVICEABLE	68.50	-
2	BUMPER BRACKET REAR @\$105.00	SERVICEABLE	210.00	-
1	BOOT LID	DENTED	891.10	790.00
1	BOOT LID HANDLE OUTER	SERVICEABLE	275.60	-
1	BOOT LID BOARD INNER	SERVICEABLE	181.90	-
2	BOOT LID HINGE @\$386.90	BENT	773.80	148.00
1	REAR END PANEL	TO REPAIR SEE LABOUR	491.60	-
1	REAR END PANEL INNER GARNISH	SERVICEABLE	485.00	-
2	TAILLAMP @\$195.00	N/S SCRATCHED / O/S SERVICEABLE	390.00	195.00
1	BOOT LID LOCK	JAMMED	168.20	168.20
1	BOOT LID CABLE	SERVICEABLE	89.30	-
1	BOOT LID LOCK CATCH	SERVICEABLE	68.00	-
1	BOOT LID EMBLEM	NECESSARY	58.00	58.00
1	BOOT LID LOGO GROMMET	NECESSARY	58.00	58.00
	LESS 30% DISCOUNT		-	-599.34
			4,989.70	1,398.46
<u>SPECIAL NETT ITEMS</u>				
1	SET REVERSE SENSOR (SN)	SHORTED	450.00	200.00
1	BOOT LID TOP SPOILER (SN)	SERVICEABLE	850.00	-
1	BUMPER LOWER SKIRT (SN)	SERVICEABLE	850.00	-
1	NUMBER PLATE REAR (SN)	SERVICEABLE	48.00	-
			2,198.00	200.00
<u>LABOUR</u>				
	TOWING TO REPORT CENTRE & BACK TO WORKSHOP.	NOT NECESSARY	160.00	-

Report Ref No. CS/LPC20009896/Qqf3e2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	(LABOUR CHARGES) TO REPLACE, REAR BODY PARTS, WELDING REAR END PANEL, FITTING & ADJUSTMENT. INCLUSIVE OF THE REPAIR OF REAR END PANEL.		850.00	600.00
	TO SPRAY PAINTING FOR AFFECTED PORTION.		850.00	850.00
	TO REPLACE TAILLAMP, CHECK WIRING & LIGHTING. (NPA)	NOT NECESSARY	-	-
	TO SPRAY UNDERCOAT.		165.00	50.00
			2,025.00	1,500.00
GRAND TOTAL			9,212.70	3,098.46

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				2,300.00
---	--	--	--	-----------------

Report Ref No. CS/LPC20009896/Qqf3e2

OI SUN PIN

Asst. Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.