

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CT118016451/GCD3E2
Date: 13/09/2018

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSN3019611801
Claimant Vehicle No :	SDA83H	Insured Vehicle No :	GZ1584E
Date of Loss:	07/09/2018	Nature of Claim:	TP
			Claim No: SNM18D04346C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SDA83H	Engine No:	2ZR0418181
Make & Model:	TOYOTA WISH, 1.8 (A)	Chassis No:	ZGE200003035
Reg. Date:	12/05/2011 (Man. Year: 2009)	Odometer:	199522 km
Colour:	Silver		
Engine Capacity:	1797 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	07/09/2018		
Date Inspected:	10/09/2018	Inspected At:	N-51 Automotive Pte Ltd (HQ) BLK 2 KAKI BUKIT, #01-17/18 KAKI BUKIT AUTOHUB Singapore 417921
Estimated Period of Repair:	4.0 days		

Adjuster: XING GUO QIANG

Manager: CELINE FONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000.00 -\$4,000.00

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 12 Sep 2018)
Parts:	M1-MPV	TOYOTA WISH 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	LKK Auto Consultants Pte Ltd/SDA83H/13/09/2018 10:06	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

LKK Auto Consultants Pte Ltd/SDA83H/13/09/2018 10:06. Not valid without Reference section.
--

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

LKK Auto Consultants Pte Ltd/SDA83H/13/09/2018 10:06. Not valid without Reference section.
--

< END OF ESTIMATES >