



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2100402
3 ANSON ROAD #16-00	INV Date	18/01/2021
SPRINGLEAF TOWER	Reference	CC6/CTI20010233/Aga3q2
SINGAPORE 079909	Code	CTI

PROFESSIONAL SERVICE FEE

Vehicle No.	SMU 3219C
Insured Veh.	SJU 8009U
Claim No.	SNM20D203512/C02
Policy No.	DMPCSN3075451904
Accident Date	22/09/2020
Inspection Date	24/09/2020

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (7%)	28.00
Grand Total	428.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CC6/CTI20010233/Aga3q2 Date: 18/01/2021 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SJU 8009U	Veh. Inspected	SMU 3219C
Policy No.	DMPCSN3075451904	Coverage (\$)	0.00
Claim No.	SNM20D203512/C02	Excess (\$)	0.00
Assign From		Assign Date	24/09/2020
2. Vehicle Particulars & Condition			
Make & Model	OPEL ASTRA	c.c	999
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	W0LBE6EA9HG170602	Colour	GREY
Odometer	64161 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Front Tyre	225/45 R17	BRIDGESTONE	6 mm
R/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
L/H Rear Tyre	225/45 R17	BRIDGESTONE	6 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	22/09/2020	Inspection Date	24/09/2020
Survey held at	CAS GARAGE PTE LTD NO. 1 KAKI BUKIT AVE 6, #02-22 AUTOBAY 417883 KAKI BUKIT		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMU 3219C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT BONNET (N)	TO REPAIR SEE LABOUR	1,758.90	-
1	FRONT BONNET LOCK (N)	NOT NECESSARY	312.60	-
2	FRONT BONNET STOPPER @\$40.00 (N)	NOT NECESSARY	80.00	-
1	FRONT BUMPER (N)	DISTORTED	1,994.50	1,994.50
1	FRONT BUMPER TOW COVER (N)	DEFORMED	128.70	128.70
1	FRONT BUMPER LOWER LIP RH (N)	DEFORMED	185.90	185.90
1	FRONT BUMPER SIDE RETAINER RH -GUIDE (N)	NOT NECESSARY	136.90	-
1	FRONT BUMPER SIDE RETAINER RH -UPP (N)	CRACKED	106.80	106.80
1	FRONT BUMPER BRACKET RH -UPP (N)	NOT NECESSARY	192.50	-
1	FRONT BUMPER UNDER DUST COVER (N)	NOT NECESSARY	290.70	-
1	FRONT BUMPER BRACKET TOP CENTRE (N)	CRACKED	198.60	198.60
1	FRONT BRACE BRACKET CENTRE (N)	NOT NECESSARY	229.70	-
1	FRONT BRACE BRACKET RH (N)	NOT NECESSARY	118.90	-
1	FRONT BUMPER SPONGE (N)	CRACKED	254.80	254.80
1	FRONT BUMPER REINFORCEMENT UPP METAL (N)	BENT	798.60	798.60
1	FRONT REINFORCEMENT LOWER FIBRE (N)	CRACKED	374.20	374.20
4	FRONT BUMPER PARKING SENSORS @\$272.60 (N)	DAMAGED (1 PCS ONLY)	1,090.40	272.60
1	FRONT BUMPER PARKING SENSOR SEAL (N)	NECESSARY	48.00	48.00
1	FRONT PARKING SENSOR WIRE HARDNESS (N)	NOT NECESSARY	394.20	-
1	FRONT GRILLE ASSY (N)	CRACKED	800.90	800.90
1	FRONT GRILLE LOGO (N)	NECESSARY	160.20	160.20
1	FRONT LOWER CENTRE GRILLE (N)	NOT NECESSARY	202.90	-
1	FRONT LOW GRILLE RH (N)	NOT NECESSARY	132.10	-
1	HEADLAMP RH (ILUX) (N)	CRACKED	820.90	820.90
1	HEADLAMP BRACKET RH (N)	CRACKED	152.60	152.60
1	HEADLAMP LED CONTROL UNIT RH (N)	NOT NECESSARY	746.20	-
1	FOGLAMP RH (N)	NOT NECESSARY	434.90	-
1	FOGLAMP COVER RH (N)	CRACKED	120.80	120.80
1	FRONT FENDER RH (N)	DENTED	685.90	685.90

Report Ref No. CC6/CTI20010233/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT FENDER INNERSHIELD RH (N)	NOT NECESSARY	138.70	-
1	FRONT FENDER BRACKET RH (N)	NOT NECESSARY	192.80	-
1	FRONT FENDER SIGNAL LAMP RH (N)	NOT NECESSARY	146.90	-
1	RADIATOR SUPPORT PANEL TOP GARNISH RH (N)	NOT NECESSARY	152.80	-
1	RADIATOR SUPPORT PANEL TOP (N)	NOT NECESSARY	385.90	-
1	RADIATOR SUPPORT PANEL BOTTOM (N)	NOT NECESSARY	485.20	-
1	SUPPORT PANEL TOP GARNISH (N)	NOT NECESSARY	198.60	-
1	FRONT HEADLAMP PANEL RH (N)	NOT NECESSARY	185.90	-
1	FRONT RADIATOR (N)	NOT NECESSARY	1,424.80	-
1	FRONT RADIATOR FAN ASSY (N)	NOT NECESSARY	1,806.70	-
1	FRONT RADIATOR TOP MOUNTING (N)	NOT NECESSARY	18.90	-
1	FRONT RADIATOR BRACKET LOWER RH (N)	NOT NECESSARY	162.80	-
1	INTERCOOLER AIR GUIDE (N)	CRACKED	514.90	514.90
1	AC CONDENSER (N)	NOT NECESSARY	730.20	-
1	AC CONDENSER TOP SEAL (N)	NOT NECESSARY	112.50	-
1	AC CONDENSER AIR GUIDE TOP CENTRE (N)	NOT NECESSARY	158.90	-
1	AC CONDENSER AIR GUIDE RH (N)	NOT NECESSARY	134.80	-
1	AC AMBIENT SENSOR (N)	NOT NECESSARY	317.90	-
1	WHEEL BEARING WITH HUB RH (N)	NOT NECESSARY	389.50	-
1	KNUCKLE ARM RH (N)	NOT NECESSARY	385.20	-
1	FRONT SHOCK ABSORBER RH (N)	NOT NECESSARY	398.50	-
1	FRONT STABILIZER LINK RH (N)	NOT NECESSARY	194.50	-
1	FRONT LOWER ARM RH (N)	BENT	398.60	398.60
1	FRONT RIM RH (N)	CUT	985.60	985.60
	LESS 10% DISCOUNT		-2,297.34	-900.31
			20,676.06	8,102.79
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT NUMBER PLATE WITH CASING (SN)	NOT NECESSARY	50.00	-
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	30.00	30.00
1	SET FRONT FENDER INNERSHIELD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET COOLANT (SN)	NOT NECESSARY	60.00	-
			170.00	30.00

Report Ref No. CC6/CTI20010233/Aga3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO RENEW DAMAGED PARTS ,REPLACE ,BEAT ,WELD ,REALIGN AND ALIGNE ALL PARTS.INCLUSIVE OF THE REPAIR OF FRONT BONNET .		1,800.00	600.00
	TO RESPRAY AFFECTED AREAS.		1,800.00	600.00
	TO TUFFCOAT AFFECTED AREA.		200.00	40.00
	TO CONDUCT WIRING CHECKS ON FRONT HEADLAMP .		120.00	30.00
	TO REMOVE/REPLACE /REFIT CONDENSER AND TOP UP GAS.	NOT NECESSARY	120.00	-
	TO REMOVE/REPLACE FRONT SENSORS AND DISTANCE SETTLING.	NOT NECESSARY	150.00	-
	TO REMOVE UNDERCARRIAGE .		350.00	150.00
	TO PERFORM WHEEL ALIGNMENT .		150.00	80.00
			4,690.00	1,500.00
	GRAND TOTAL		25,536.06	9,632.79
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			7,700.00

Report Ref No. CC6/CTI20010233/Aga3q2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMU 3219C

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

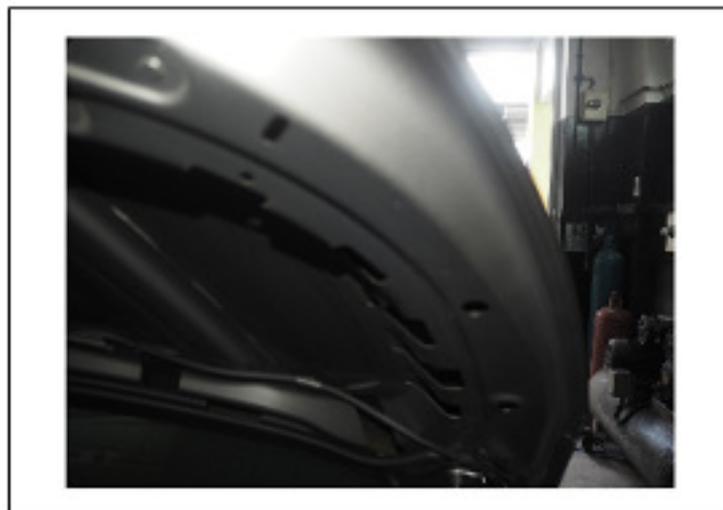



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMU 3219C

RE-INSPECTION







LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

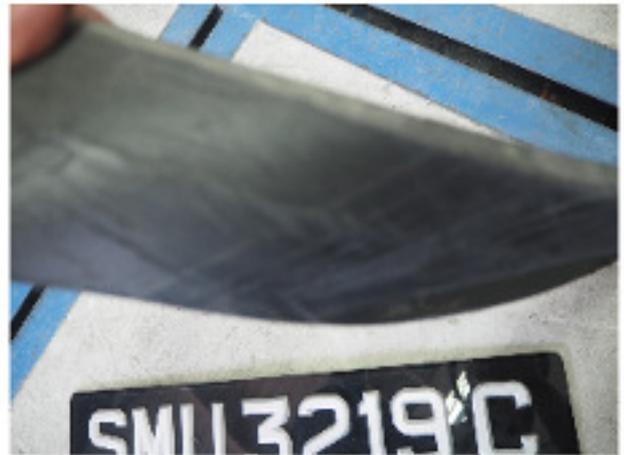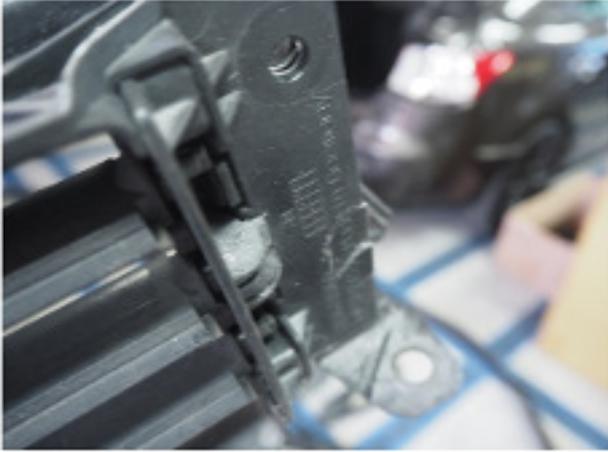



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SMU 3219C

RE-INSPECTION

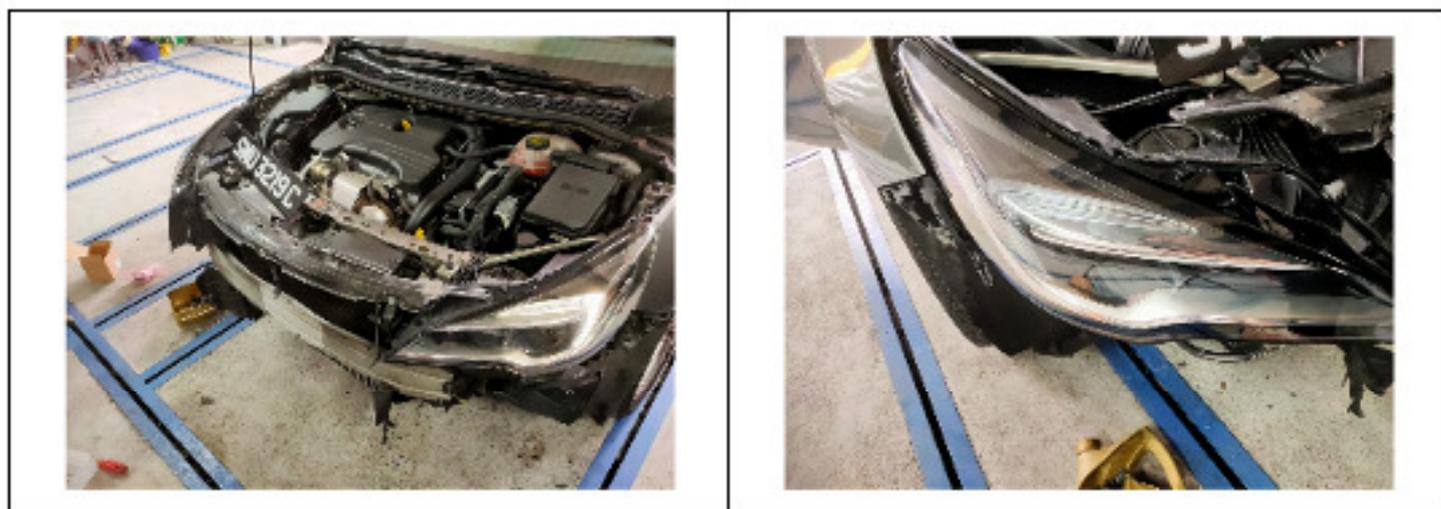



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

