

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG20010314/EYD3E2

Date: 19/11/2020

REFERENCE

Insured/Claimant:	TAN YONG JIAN	Policy No:	1800135548	
Date of Loss:	24/09/2020	Nature of Claim:	OD	Claim No: 9894165469SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMF5857B			
Make & Model:	MITSUBISHI ATTRAGE, 1.2 CVT (A)	Engine No:	3A92UHK0571	
Reg. Date:	19/11/2018 (Man. Year: 2018)	Chassis No:	MMBSTA13AJH004336	
Colour:	Blue	Odometer:	13102 km	
Engine Capacity:	1193 cc			
Market Value/New Car Price:	S\$53,000.00			
Sum Insured (S\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/55 R15	Rear Tyre Size:	185/55 R15
Front Left Side:	Bridgestone 5 mm	Rear Left Side:	Bridgestone 5 mm
Front Right Side:	Bridgestone 5 mm	Rear Right Side:	Bridgestone 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	16,468.93	11,701.17	4,767.76	28.95
Miscellaneous Items	0.00	0.00	0.00	
Labour	12,630.00	8,640.00	3,990.00	31.59
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	29,098.93	20,341.17	8,757.76	30.10
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	28,798.93	20,041.17	8,757.76	30.41
+ GST 7.00/7.00% (S\$)	2,015.93	1,402.88	613.05	30.41
Nett Amount (S\$)	30,814.86	21,444.05	9,370.81	30.41

INSPECTION

Date of Assignment: 25/09/2020
Date Inspected: 28/09/2020 Inspected At:

Cycle & Carriage KIA Pte Ltd (Pandan Gardens)
209 Pandan Gardens
Singapore 609339

Estimated Period of Repair: 15.0 days

Adjuster: CHEN TSUE YEE

Manager: YVONNE WONG YIN CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT NUMBER PLATE WITH FRAME	Not Necessary	50.00 FS	*- FS
2	1		*SUNDRIES	Necessary	50.00 FS	*20.00 FS
3	1		*FACE, FR BUMPER	Broken	703.00 FL	*703.00 FL
4	1		*COVER, HEADLAMP SUPT PANEL	Cut	62.00 FL	*62.00 FL
5	1		*GRILLE, FR UNDER	Broken	165.00 FL	*165.00 FL
6	1		*BRACKET, FR BUMPER, LH	Broken	13.00 FL	*13.00 FL
7	1		*BRACKET, FR BUMPER, RH	Broken	13.00 FL	*13.00 FL
8	1		*GARNISH, FR BUMPER, LH	Missing	127.00 FL	*127.00 FL
9	1		*MARK,THREE-DIA	Necessary	69.00 FL	*69.00 FL
10	1		*GRILLE, RADIATOR	Broken	554.00 FL	*554.00 FL
11	1		*HOOD	Dented	734.00 FL	*734.00 FL
12	1		*HINGE, HOOD, LH	Bent	56.00 FL	*56.00 FL
13	1		*HINGE, HOOD, RH	Bent	56.00 FL	*56.00 FL
14	1		*INSULATOR, HOOD	Crushed	177.00 FL	*177.00 FL
15	8		*CLIP, HOOD INSULATOR	Necessary	24.00 FL	*24.00 FL
16	1		*LATCH, HOOD	Bent	69.00 FL	*69.00 FL
17	1		*FENDER, FR LH	Dented	497.00 FL	*497.00 FL
18	1		*SHIELD, FR WHEELHOUSE, LH	Missing	98.00 FL	*98.00 FL
19	13		*CLIP, INNERSHIELD	Necessary	52.00 FL	*52.00 FL
20	1		*GARNISH, FR PILLAR, LH	Missing	30.00 FL	*30.00 FL
21	1		*GARNISH, FR FENDER	Missing	65.00 FL	*65.00 FL
22	1		*WHEELHOUSE, FR INR LH	Repair	364.00 FL	*- FL
23	1		*PANEL ASSY, FR END	Dented	1,055.00 FL	*1,055.00 FL
24	1		*PANEL, HEADLAMP SUPPORT, UPR	Repair	65.00 FL	*- FL
25	1		*SIDEMEMBER ASSY, FR LH	Repair	497.00 FL	*- FL
26	1		*EMBLEM ECO	Necessary	17.00 FS	*17.00 FS
27	1		*PANEL, AIR GUIDE, LH	Not Necessary	11.00 FL	*- FL
28	1		*COVER, ENG ROOM UNDER, FR	Not Necessary	99.00 FL	*- FL
29	1		*PANEL ASSY, FR DOOR, LH	Dented	996.00 FL	*996.00 FL
30	1		*HINGE, FR DOOR, UPR LH	Not Necessary	54.00 FL	*- FL
31	1		*HINGE, FR DOOR, LWR LH	Not Necessary	54.00 FL	*- FL
32	1		*TAPE, FR DOOR SASH, LH	Necessary	29.00 FL	*29.00 FL
33	1		*COVER, FR DECK, LH	Not Necessary	16.00 FL	*- FL
34	1		*BODY KIT, ATTRAGE	Broken	1,643.00 FS	*1,643.00 FS
35	1		*CONDENSER ASSY, A/C REFRIGE	Not Necessary	758.00 FL	*- FL
36	1		*PANEL, AIR GUIDE	Not Necessary	112.00 FL	*- FL
37	1		*RADIATOR ASSY	Not Necessary	967.00 FL	*- FL
38	1		*TANK ASSY, RADIATOR COND	Not Necessary	42.00 FL	*- FL
39	1		*FAN, COOLING, LH	Not Necessary	77.00 FL	*- FL
40	1		*SHROUD, COOLING FAN	Not Necessary	130.00 FL	*- FL
41	1		*MOTOR, COOLING FAN	Not Necessary	479.00 FL	*- FL
42	1		*LLC 4L	Not Necessary	26.00 FL	*- FL
43	1		*HEADLAMP ASSY, LH	Broken	660.00 FL	*660.00 FL
44	1		*HEADLAMP ASSY, RH	Broken	660.00 FL	*660.00 FL
45	1		*LAMP ASSY, FOG, FR LH	Cut	303.00 FL	*303.00 FL
46	1		*BOX ASSY, RELAY	Broken	139.00 FL	*139.00 FL
47	1		*COVER, RELAY BOX	Cut	64.00 FL	*64.00 FL
48	1		*INSULATOR, ENG MOUNTING	Not Necessary	203.00 FL	*- FL
49	1		*INSULATOR, T/M MOUNTING	Not Necessary	209.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	1		*ROD ASSY, ENG ROLL STOPPER	Not Necessary	155.00 FL	*- FL
51	1		*CROSSMEMBER, FR AXLE, NO.1	Bent	864.00 FL	*864.00 FL
52	1		*ARM ASSY, FR SUSP, LWR LH	Bent	337.00 FL	*337.00 FL
53	1		*STRUT, FR SUSP	Bent	452.00 FL	*452.00 FL
54	1		*DAMPER, FR SUSP STRUT	Not Necessary	24.00 FL	*- FL
55	1		*PAD, FR SUSP SPRING	Not Necessary	17.00 FL	*- FL
56	1		*SEAT, FR SUSP SPRING, UPR	Not Necessary	37.00 FL	*- FL
57	1		*BEARING, FR SUSP STRUT	Necessary	9.00 FL	*9.00 FL
58	1		*SUPPORT, FR SUSP STRUT	Not Necessary	17.00 FL	*- FL
59	1		*INSULATOR, FR SUSP STRUT	Necessary	83.00 FL	*83.00 FL
60	1		*INSULATOR, FR SUSP STRUT	Not Necessary	98.00 FL	*- FL
61	1		*NUT, CYLINDER BLOCK	Not Necessary	3.00 FL	*- FL
62	1		*STOPPER, FR SUSP STRUT	Necessary	27.00 FL	*27.00 FL
63	1		*KNUCKLE, LH	Bent	365.00 FL	*365.00 FL
64	1		*COVER, FR BRAKE DISC	Not Necessary	26.00 FL	*- FL
65	1		*BEARING, FR WHEEL HUB	Bent	121.00 FL	*121.00 FL
66	1		*SNAP RING, FR WHEEL HUB	Necessary	8.00 FL	*8.00 FL
67	1		*HUB ASSY, FR WHEEL	Bent	215.00 FL	*215.00 FL
68	1		*GEAR & LINK ASSY, STEERING	Not Necessary	1,444.00 FL	*- FL
69	1		*END ASSY, TIE ROD	Not Necessary	52.00 FL	*- FL
70	1		*END ASSY, TIE ROD	Not Necessary	52.00 FL	*- FL
71	1		*WHEEL, DISC	Cut	687.00 FL	*687.00 FL
72	1		*SENSOR, FR ABS	Torn	171.00 FL	*171.00 FL
73	1		*LH FRONT TIRE	Cut	380.00 FS	*380.00 FS
74	1		*FRAME, FR DECK, UPR OTR LH	Dented	511.00 FL	*511.00 FL
75	1		*SHAFT AS, FR AXLE DRIVE, LH	Bent	1,201.00 FL	*1,201.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	20,749.00	14,581.00
- List Item Discount on L Items 23.00/23.00% (\$\$)	4,280.07	2,879.83
Total Parts (\$\$)	16,468.93	11,701.17

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	RENEW ACCIDENT DAMAGED PARTS ON FRONT SUPPORT PANEL, FRONT BONNET, LH FRONT FENDER, LH FRONT DOOR, FRONT BODY KIT LH SIDE SKIRTING, CUT / WELD LH FRONT CHASSIS MEMBER, REPAIR RH FRONT FENDER	New	4,050.00	2,250.00
2	REMOVE AND INSTALL RADIATOR AND A/CON CONDENSER TO FACILITATE REPAIR WORK	New	100.00	0.00
3	TOP UP AIR CON GAS AND CHECK A/CON SYSTEM	New	80.00	0.00
4	TO MOUNT VEHICLE ON CELETTE BENCH TO CONDUCT CHASSIS ALIGNMENT	New	1,000.00	1,000.00
5	CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
6	TO CARRY OUT REPAIR ELECTRICAL HARNESS	New	250.00	250.00
7	APPLY BODY SEALANT	New	160.00	80.00
8	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
9	PERFORM RUST PREVENTION	New	120.00	40.00
10	PAINT WORK SPRAY FRONT SUPPORT PANEL, FRONT BONNET, FRONT BUMPER, FRONT BODY KIT, LH FRONT FENDER, LH FRONT DOOR, RH FRONT FENDER, LH FRONT A PILLAR. LH SIDE SKIRTING PANEL, LH CHASSIS MEMBER, LH FENDER HOUSING AND AFFECTED PORTION	New	4,200.00	2,800.00
11	RENEW FRONT U/CARRIAGE DAMAGES	New	450.00	450.00
12	TO CONDUCT COMPUTERIZE FULL WHEEL ALIGNMENT	New	120.00	120.00
13	LABOUR RENEW LH FRONT TIRE INCLUDING BALANCING	New	30.00	30.00
14	REMOVE AND TRANSFER LH FRONT DOOR GLASS, TRIM AND OTHERS ATTACHMENT TO NEW DOOR PANEL	New	120.00	120.00
15	REMOVE AND INSTALL ENGINE TO FACILITATE REPAIR WORK	New	450.00	0.00
16	CUT/WELD FRAME FRONT BACK LH	New	450.00	450.00
17	SPRAY PAINT FRONT END PANEL AND FRAME BACK LH	New	700.00	700.00
18	SPRAY PAINT LH SIDE MIRROR	New	200.00	200.00
Gross Labour Cost (S\$)			12,630.00	8,640.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >