

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20010375/DBA3Q2
Date: 23/09/2021**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100455765
Claimant Vehicle No :	SHA7241A	Insured Vehicle No :	SJP1486Y
Date of Loss:	26/09/2020	Nature of Claim:	TP
		Claim No:	4547596808SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHA7241A	Engine No:	G4LEKU297704
Make & Model:	HYUNDAI IONIQ HYBRID, 1.6 GLS DCT (A)	Chassis No:	KMHC851CVKU164557
Reg. Date:	02/07/2019 (Man. Year: 2019)	Odometer:	91532 km
Colour:	Blue		
Engine Capacity:	1580 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:		Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	

CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	West Lake 5 mm	Rear Left Side:	West Lake 5 mm
Front Right Side:	West Lake 5 mm	Rear Right Side:	West Lake 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	18,009.99	9,330.16	8,679.83	48.19
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,530.00	1,920.00	2,610.00	57.62
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	22,539.99	11,250.16	11,289.83	50.09
+ GST 7.00/7.00% (S\$)	1,577.80	787.51	790.29	50.09

Nett Amount (\$\$)	24,117.79	12,037.67	12,080.12	50.09
+ Loss of Use (7.0 x S\$50.00/day) (\$\$)		350.00		
+ Car Rental (7.0 x S\$125.19/day) (\$\$)		876.33		
+ Doc/Search Fee (\$\$)		7.45		
+ Other Costs (\$\$)		80.00		
Nett Liability (\$\$)		13,351.45		
Global Sum Settlement (\$\$)		13,300.00		

INSPECTION

Date of Assignment: 28/09/2020

Date Inspected: 28/09/2020

Estimated Period of Repair: 6.0 days

Inspected At: Bifrost Auto Pte Ltd (HQ)
176 Sin Ming Drive, #03-09
Singapore 575721

Adjuster: BRYAN TANI**Manager:** CHUA ZHEN LI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER COVER	Torn	418.30 FL	*418.30 FL
2	2		*FRONT BUMPER BRACKET (LH)	Not Necessary	56.00 FL	*- FL
3	1		*FRONT BUMPER RETAINER MOUNTING (LH)	Cracked / Broken	65.30 FL	*65.30 FL
4	10		*FRONT BUMPER CLIPS	Necessary	25.00 FL	*25.00 FL
5	1		*FRONT BUMPER GRILLE (LH)	Not Necessary	186.90 FL	*- FL
6	1		*FRONT BUMPER AIR DUCT (LH)	Not Necessary	153.80 FL	*- FL
7	1		*DAY LIGHT ,LH	Mtg Broken	642.50 FL	*642.50 FL
8	1		*DAY LIGHT WIRE ,LH	Not Necessary	585.50 FL	*- FL
9	1		*BUZZER ASSY -PIEZO (LH)	Not Necessary	388.00 FL	*- FL
10	1		*HEADLAMP SUPPORT PANEL ASSY	Cracked / Broken	949.30 FL	*949.30 FL
11	1		*HEADLAMP (LH)	Broken	3,987.30 FL	*1,993.65 FL
12	1		*FRONT FENDER (LH)	Dented	490.70 FL	*490.70 FL
13	1		*FRONT FENDER APRON PANEL (LH)	Not Necessary	756.20 FL	*- FL
14	1		*FRONT FENDER APRON PANEL UPPER (LH)	Not Necessary	229.60 FL	*- FL
15	1		*FRONT FENDER SHIELD (LH)	Deformed	164.70 FL	*164.70 FL
16	1		*FRT DOOR (LH)	Bent / Dented	1,797.20 FL	*1,797.20 FL
17	1		*FRT DOOR RUBBER	Not Necessary	250.00 FL	*- FL
18	1		*FRONT DOOR HINGE UPPER (LH)	Not Necessary	165.76 FL	*- FL
19	1		*FRONT DOOR HINGE LOWER (LH)	Not Necessary	153.70 FL	*- FL
20	1		*FRONT DOOR CHECK (LH)	Not Necessary	72.98 FL	*- FL
21	1		*FRONT DOOR MIRROR ASSY (LH)	Repair	1,391.70 FL	*- FL
22	1		*FRONT DOOR PROTECTOR (LH)	Cut	186.20 FL	*186.20 FL
23	1		*ROCKER PANEL OUTER GARNISH	Bent / Mtg Broken	715.60 FL	*715.60 FL
24	1		*FRONT WHEEL RIM (LH)	Distorted	1,124.20 FL	*1,124.20 FL
25	1		*FRONT WHEEL HUB ASSY (LH)	Damaged	678.50 FL	*678.50 FL
26	1		*FRONT WHEEL HUB CAP (LH)	Cut	289.80 FL	*289.80 FL
27	1		*FRONT SHOCK ABSORBER (ASSY) (LH)	Distorted	372.50 FL	*372.50 FL
28	1		*FRONT SHOCK ABSORBER MOUNTING (LH)	Not Necessary	206.90 FL	*- FL
29	1		*FRONT DRIVE SHAFT (LH)	Not Necessary	1,136.70 FL	*- FL
30	1		*FRONT DRIVE SHAFT EXTENSION LH	Not Necessary	1,125.80 FL	*- FL
31	1		*RACK & PINION ASSY	Not Necessary	1,087.40 FL	*- FL
32	1		*STG TIE ROD	Not Necessary	125.60 FL	*- FL
33	1		*STG TIE END	Not Necessary	94.70 FL	*- FL
34	1		*STABILIZER BAR	Not Necessary	326.80 FL	*- FL
35	1		*STABILIZER BAR LINK	Not Necessary	92.10 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
36	1		*FRONT SUSPENSION LOWER ARM (LH)	Distorted	596.80 FL	*596.80 FL
37	1		*KNUCKLE ARM (LH)	Distorted	663.60 FL	*663.60 FL
38	1		*EMBLEM -BLUE DRIVE (LH)	Necessary	26.60 FL	*26.60 FL
39	1		*FRONT DOOR COMFORT LOGO (LH)	Necessary	75.00 FS	*75.00 FS
40	1		*FRONT TYRE (LH)	Not Necessary	216.00 FS	*- FS
41	1		*FRONT BUMPER MOULDING CENTRE UPPER	Bent / Mtg Cracked	368.50 FL	*368.50 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)**22,439.74****11,643.95****- List Item Discount on L Items 20.00/20.00% (\$)**

4,429.75

2,313.79

Total Parts (\$)**18,009.99****9,330.16**

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	1,400.00	700.00
2	SPRAY PAINTING CHARGE	New	1,200.00	700.00
3	WIRING CHARGE	New	160.00	30.00
4	TUFF KOTE	New	140.00	40.00
5	TOWING CHARGE	New	80.00	0.00
6	TRANSFER OF DOOR MECHANISM FRONT	New	80.00	60.00
7	RE-SET FRT POWER WINDOW SYSTEM	New	200.00	0.00
8	FOUR WHEEL ALIGNMENT	New	120.00	60.00
9	REMOVE/REFIX UNDERCARRIAGE (FRT)	New	400.00	150.00
10	RE-SET FRT ABS SYSTEM	New	200.00	0.00
11	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE	New	550.00	180.00
Gross Labour Cost (S\$)			4,530.00	1,920.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >