



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2106042

36 ROBINSON ROAD
#16-01 CITY HOUSE
SINGAPORE 068877

INV Date 26/08/2021
Reference CC4/FCI20010522/Ees3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. SJZ 9146Z
Insured Veh. SHC 7079S
Claim No. D20003910MFSH
Policy No. D-20094921MFSH
Accident Date 26/09/2020
Inspection Date 01/10/2020

Description	Total
Third Party Express Settlement	600.00
Subtotal	600.00
GST (7%)	42.00
Grand Total	642.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Ref: CC4/FCI20010522/Ees3q2	
			Date: 26/08/2021	
			Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 7079S	Veh. Inspected	SJZ 9146Z	
Policy No.	D-20094921MFSH	Coverage (\$)	0.00	
Claim No.	D20003910MFSH	Excess (\$)	0.00	
Assign From	ERIC	Assign Date	01/10/2020	
2. Vehicle Particulars & Condition				
Make & Model	VOLKSWAGEN POLO	c.c	1197	
Engine No.	HIDDEN	Year of Reg.	2011	
Chassis No.	WWWZZZ6RZBU031717	Colour	BLACK	
Odometer	202489 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	SPORTS RIM	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	205/50 R16	ACHILLES	4 mm	
L/H Front Tyre	205/50 R16	ACHILLES	4 mm	
R/H Rear Tyre	205/50 R16	ACHILLES	4 mm	
L/H Rear Tyre	205/50 R16	ACHILLES	4 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S AND FRONT N/S PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	26/09/2020	Inspection Date	01/10/2020	
Survey held at	AUBURN AUTO PTE LTD 176 SIN MING DRIVE #04-18 SIN MING AUTOCARE SINGAPORE 575721			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			10 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJZ 9146Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT NUMBER PLATE	CUT	50.00	30.00
1	FRONT NUMBER TOW COVER	MISSING	159.83	48.95
1	RIGHT HEADLIGHT CLIP	NOT NECESSARY	158.00	-
1	FRONT NUMBER PLATE BASE GARNISH	NOT NECESSARY	222.12	-
1	FOG LIGHT COVER (RH)	MISSING	255.42	255.42
1	FRONT BUMPER UNDERTRAY COVER	NOT NECESSARY	388.86	-
1	FRONT GRILLE RIGHT (GRILLE ASSY)	BROKEN	250.51	250.51
1	FRONT GRILLE LEFT	NOT NECESSARY	250.51	-
1	FRONT DRIVING SENSOR	NOT NECESSARY	480.00	-
1	LEFT CHASSIS GARNISH	NOT NECESSARY	545.00	-
1	RIGHT CHASSIS GARNISH	NOT NECESSARY	545.00	-
1	LEFT SIDE HEADLIGHT	NOT NECESSARY	500.00	-
1	RIGHT SIDE HEADLIGHT	BROKEN	500.00	500.00
1	FRONT SIDE RETAINER	BROKEN	500.00	180.00
1	FRONT BUMPER RETAINER	NOT NECESSARY	499.99	-
1	FRONT DRIVE SIDE PANEL	NOT NECESSARY	800.87	-
1	FRONT SUPPORT	BROKEN	1,200.00	512.00
1	AIRCON CONDENSER	NOT NECESSARY	1,387.00	-
1	FRONT REINFORCEMENT BAR	DENTED	1,323.00	697.00
1	FRONT BUMPER	BROKEN	2,499.00	846.00
1	BONNET	DENTED	800.00	800.00
1	WIPER MOTOR	NOT NECESSARY	358.23	-
1	AIRCON SWITCH	NOT NECESSARY	398.22	-
1	AIRCON PIPE	NOT NECESSARY	252.67	-
1	RADIATOR	NOT NECESSARY	500.98	-
1	AIRCON COMPRESSOR	NOT NECESSARY	500.12	-
1	FRONT REINFORCEMENT BAR	NOT NECESSARY	1,500.00	-
1	WIPER TANK	CRUSHED	217.00	217.00
1	FAULTY WIRING	NOT NECESSARY	1,267.00	-
1	BUMPER BRACKET	NOT NECESSARY	1,200.00	-
1	FRONT RIGHT ABSORBER	BENT	1,249.00	338.00

Report Ref No. CC4/FCI20010522/Ees3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LEFT ABSORBER	BENT	1,249.00	338.00
1	FRONT RIGHT BOOT MUDGUARD (FENDER)	BROKEN	1,200.00	481.00
1	FRONT LEFT BOOT MUDGUARD (FENDER)	BROKEN	1,200.00	481.00
1	UNDERCARRIAGE (FRONT LOWER ARM RH & LH)	DENTED	1,500.00	540.00
1	BUMPER CLIP RIGHT	NOT NECESSARY	150.00	-
1	BUMPER CLIP LEFT	NOT NECESSARY	150.00	-
1	BUMPER STRIP	NOT NECESSARY	200.00	-
1	FRONT RIGHT RIM	BROKEN	200.00	200.00
1	FRONT RIGHT TYRE	CRUSHED	150.00	120.00
1	REAR LEFT DOOR SPEAKER	NOT NECESSARY	250.00	-
1	RIGHT SIDE FENDER	NOT NECESSARY	250.00	-
1	LEFT SIDE MIRROR	NOT NECESSARY	350.00	-
1	RIGHT MIRROR	NOT NECESSARY	350.00	-
1	UNDER TRAY COVER	NOT NECESSARY	350.00	-
1	RIGHT HEADLIGHT	NOT NECESSARY	400.00	-
1	CONDENSER	NOT NECESSARY	450.00	-
1	RADIATOR	NOT NECESSARY	450.00	-
1	REINFORCEMENT BAR SPONGE	NOT NECESSARY	450.00	-
1	FRONT LEFT DOOR REPLACE	TO REPAIR SEE LABOUR	2,000.00	-
1	REAR LEFT DOOR REPLACE	NOT NECESSARY	5,000.00	-
1	RIGHT SIDE MIRROR	NOT NECESSARY	1,200.00	-
1	LEFT SIDE MIRROR	NOT NECESSARY	1,200.00	-
1	LEFT SIDE FENDER	NOT NECESSARY	800.00	-
1	FRONT RIGHT DOOR REPLACE	DENTED	2,000.00	1,586.00
1	REAR RIGHT DOOR REPLACE	NOT NECESSARY	5,000.00	-
	LESS 10% DISCOUNT		-	-842.09
			47,257.33	7,578.79
	LABOUR			
	TOW.		50.00	50.00
	CHECKING OF WIRING LIGHTING AND RESETTING .		850.00	100.00
	REMOVE AND REFIT REAR UNDERCARRIAGE .		500.00	200.00
	WHEEL ALIGNMENT .		300.00	60.00

Report Ref No. CC4/FCI20010522/Ees3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REMOVE AND REPLACE DAMAGED PARTS	NOT NECESSARY	1,000.00	-
	APPLY UNDERCOATING ON REPAIRED AND REPLACED PANEL .		800.00	30.00
	WORKMANSHIP TO DISMANTLE ABOVE DAMAGED PARTS ,REPAIRS INCLUDING CUT AND WIELD ,REALIGN BODY STRUCTURE .		1,200.00	1,000.00
	RESPRAY INCLUDING POLISHING AND WAXING ON THE CHANGES BODY PARTS ,REPAIRED PORTORTIONS WHERE CONSISTENT TO THE ACCIDENT .		1,000.00	1,000.00
			5,700.00	2,440.00
GRAND TOTAL			52,957.33	10,018.79
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				4,500.00

Report Ref No. CC4/FCI20010522/Ees3q2

CHEN TSUE YEE

Automotive Assessor

HO LEONG CHUAN

Automotive Assessor

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJZ 9146Z

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

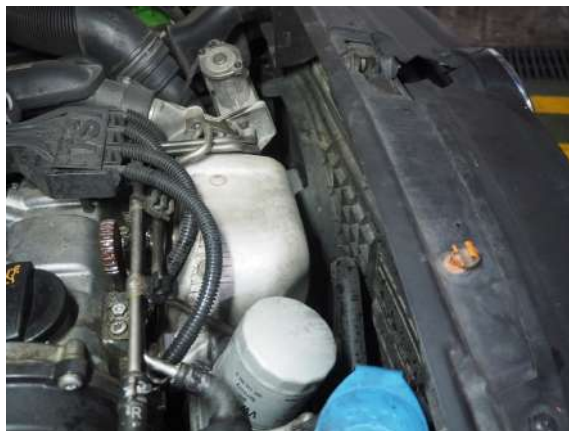



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJZ 9146Z

RE-INSPECTION

