Adjuster Report Page 1 of 4

### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/AIG20010545/EPA3Q2

D4FDGU700720

**Date:** 11/03/2021

**REFERENCE** 

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1900012008

Claimant
Vehicle No: SHD3495U

Insured Vehicle No: SJA5748U

Date of Loss: 01/10/2020 Nature of Claim: TP Claim No: 8598649700SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: SHD3495U

Make & Model: HYUNDAI I40, 1.7 L CRDI AT ABS AIRBAG 4DR Engine No:

(A)

Reg. Date: 29/12/2016 (Man. Year: 2016) Chassis No: KMHLB41UMHU097705

Colour: Blue Odometer: 488175 km

Engine Capacity: 1685 cc Market Value/New Car N/A

Price:

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES** 

Front Tyre Size: 205/60R16 Rear Tyre Size: 205/60R16
Front Left Side: Goodyear 5 mm Rear Left Side: Goodyear 5 mm
Front Right Side: Goodyear 5 mm
Rear Right Side: Goodyear 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,134.80	934.80	200.00	17.62
Miscellaneous Items	0.00	0.00	0.00	
Labour	930.00	760.00	170.00	18.28
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,064.80	1,694.80	370.00	17.92
Approved Total (Overridden) (S\$)		1,350.00		
(S\$)	2,064.80	1,350.00	714.80	34.62
+ GST 7.00/7.00% (S\$)	144.54	94.50	50.04	34.62
Nett Amount (S\$)	2,209.34	1,444.50	764.84	34.62
Global Sum Settlement (S\$)		0.00		

**INSPECTION** 

Date of Assignment: 01/10/2020

Date Inspected: 01/10/2020 Inspected At: ComfortDelGro Engineering Pte Ltd

(Loyang) 59 Loyang Drive Singapore 508969

Estimated Period of Repair: 2.0 days

https://singapore.merimen.com/claims/index.cfm?fusebox=MTRadjuster&fuseaction=g... 11/3/2021

Adjuster Report Page 2 of 4

Adjuster: CHEN TSUE YEE Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Adjuster Report Page 3 of 4

# **REPAIR DETAILS**

## **Recommended Parts**

No.	Qty	Part No.	Particulars	Condition	on Repairer's	
1	1		*COVER ASSY -RR BUMPE	Dented	1,106.00 FL	*1,106.00 FL
2	1		*COVER -RR BUMPER LWR	Not Necessary 228.00 FL		*- FL
3	10		*HYUNDAI BUMPER COVER CLIP	Not Necessary	22.00 FL	*-FL
4	1		*PROTECTOR MAT	Necessary	50.00 FS	*50.00 FS
F=Fra	nchise	part. S=SpcN	ett. L=ListItemDisc.			
Sub Total (S\$)					1,406.00	1,156.00
- List Item Discount on L Items 20.00/20.00% (S\$)				271.20	221.20	
				Total Parts (S\$)	1,134.80	934.80
			Report was unsubmitted du	ring this print-out.		

Adjuster Report Page 4 of 4

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Lab	our Items			
1	PANEL BEATING	New	300.00	280.00
2	SPRAYPAINT CHARGE	New	300.00	200.00
3	RENEW ADVERTISEMENT STICKER -BUMPER	New	50.00	50.00
4	RENEW ADVERTISEMENT STICKER -FENDER	New	200.00	200.00
5	REMOVE/REFIX REVERSE SENSOR ASSY	New	80.00	30.00
	Gross	Labour Cost (S\$)	930.00	760.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >