

## LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI20010614/QVD3E2

Date: 08/10/2020

### REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd.	Policy No: DMCVSNW00059372000	
Claimant Vehicle No : SJR1849Z	Insured Vehicle No : GBH5862E	
Date of Loss: 27/09/2020	Nature of Claim: TP	Claim No: SNM20D203575/C02/LEWLC

### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJR1849Z	
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 (A)	Engine No: 3ZZ4896908
Reg. Date:	11/06/2009 (Man. Year: 2009)	Chassis No: MR053ZEE106146779
Colour:	Silver	Odometer: 218680 km
Engine Capacity:	1598 cc	
Market Value/New Car Price:	N/A	
Sum Insured (S\$):	Market Value/New Car Price	

### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

### CONDITION OF TYRES

Front Tyre Size:	195/65 R15	Rear Tyre Size:	195/65 R15
Front Left Side:	Tourador 6 mm	Rear Left Side:	Tourador 6 mm
Front Right Side:	Tourador 6 mm	Rear Right Side:	Tourador 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

### INSPECTION

Date of Assignment:	02/10/2020	
Date Inspected:	05/10/2020 Inspected At:	Sheng Khoon Motor Service (HQ) 393 WOODLANDS ROAD BLK D4 YEW TEE IND EST Singapore 677972
Estimated Period of Repair:	4.0 days	

Adjuster: OI SUN PIN

Manager: VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$2,000.00 -\$3,000.00

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 08 Oct 2020)
<b>Parts:</b>	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SJR1849Z)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.
-----------------------------------------------

**< END OF ESTIMATES >**