

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CTI20010637/UVD3E2

Date: 15/10/2020

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMB1SNW00001292005
Claimant Vehicle No :	FBN5489T	Insured Vehicle No :	PA9834G
Date of Loss:	22/09/2020	Nature of Claim:	TP
		Claim No:	SNM20D203642C02/TOHHS

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBN5489T	Engine No:	G3H6E0010822
Make & Model:	YAMAHA NMAX155, 155cc	Chassis No:	MH3SG431000008372
Reg. Date:	24/10/2018 (Man. Year: 2018)	Odometer:	45141 km
Colour:	White		
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110-70-13	Rear Tyre Size:	130-70-13
Front Left Side:	Timsun 6 mm	Rear Left Side:	Timsun 6 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	171.00	83.80	87.20	50.99
Miscellaneous Items	0.00	0.00	0.00	
Labour	231.00	85.00	146.00	63.20
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	402.00	168.80	233.20	58.01
+ GST 7.00/7.00% (S\$)	28.14	11.82	16.32	58.00
Nett Amount (S\$)	430.14	180.62	249.52	58.01

INSPECTION

Date of Assignment:	03/10/2020	Inspected At:	Ban Hock Hin Co. Pte Ltd (HQ)
Date Inspected:	05/10/2020		No. 6 Defu Lane 4
			Singapore 539410
Estimated Period of Repair:	1.0 days		

Adjuster: MARCUS CHUA

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: (Last Synchronised: 14 Oct 2020)

Parts: N/A YAMAHA NMAX155 155cc (Model not available in database)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for FBN5489T)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOARD FOOTREST RH	Not Necessary	52.00 F	*- FL
2	1		*COVER SIDE CENTRE RH (WHITE)	Not Necessary	30.00 F	*- FL
3	1		*MUDGUARD FRONT (WHITE)	Broken	52.00 F	*52.00 FL
4	1		*STICKER (CISCO) MUDGUARD FRONT	Necessary	37.00 FS	*37.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	171.00	89.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	5.20
Total Parts (\$\$)	171.00	83.80

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	LABOUR - LABOUR QUOTED FOR DISMANTLING AND INSTALLATION OF PARTS	New	126.00	50.00
2	SPRAY LACQUER OF FRONT MUDGUARD	New	49.00	35.00
3	TRANSPORT CHARGES - BIKE TOWED BACK TO BHH	New	56.00	0.00
Gross Labour Cost (S\$)			231.00	85.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >