

6 tampines st 73, #01-03, singapore 528825

tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Claim Reference : Insured Vehicle No. : Thirly Party Veh No. : Officer-In-Charge : -

Our Reference

: KAAS/TA/6015/8713/TP/07.20

Date

: 15 July 2020

To: Asia Express Car Rental Pte Ltd

c/o 25 Kaki Bukit Road 4

#01-55, Synergy @ Kaki Bukit

Singapore 417800

## **VEHICLE APPRAISAL REPORT**

Name of Workshop

: Apex Motoring

Place of inspection

: 25 Kaki Bukit Road 4 #01-55, Synergy @ Kaki Bukit, Singapore 417800

Shuttle Hybrid 1.5X (A)

Date of Assignment

: 09 July 2020

Date of Accident

: 08 July 2020

Date of Inspection

: 09 July 2020

### PARTICULARS OF INSPECTED VEHICLE

Registration No.

: SLS 8713G

Chassis Frame No.

: GP7-1120320

Make / Model

: Honda

Engine No. (Logcard)

: LEB6325010

Year of Manufacture/Reg

: 2017

**Odometer Reading** 

: 228,031 KM

Colour

: Silver

Class / Type

: MPV

#### CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

**General Condition** 

: Excellent

Paintwork

: Excellent

Market Value

.

Scrap Value

. .

#### CONDITION OF TYRES ON VEHICLE

|       |   | Make/Size             | Thread Balance |
|-------|---|-----------------------|----------------|
| Front | L | YOKOHAMA 185 / 60 R15 | 7 mm           |
| Front | L | YOKOHAMA 185 / 60 R15 | 7 mm           |
| Rear  | R | YOKOHAMA 185 / 60 R15 | 7 mm           |
| Rear  | R | YOKOHAMA 185 / 60 R15 | 7 mm           |

<sup>\*</sup>The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148 reg no: 53058468m Our Reference Vehicle Number : KAAS/TA/6015/8713/TP/07.20

: SLS 8713G

## APPRAISEMENT SCHEDULE

| S/N | Qty    | Descriptions                       | Conditions  | Repairer's |                | Revised |                    |
|-----|--------|------------------------------------|-------------|------------|----------------|---------|--------------------|
|     |        |                                    |             | E          | Estimate       |         | Amount             |
|     |        | LIST ITEMS:-                       |             |            |                |         |                    |
| 1   | 1 pc   | rear bumper                        | broken      | \$         | 1,201.00       | \$      | 1,201.0            |
| 2   | 1 pc   | rear bumper I/h reflector w/ cover | deformed    | \$         | 152.00         | \$      | 152.0              |
| 3   | 1 pc   | rear bumper I/h side retainer      | necessary   | \$         | 67.00          | \$      | 67.0               |
| 4   | 1 pc   | rear bumper r/h side retainer      | necessary   | \$         | 67.00          | \$      | 67.0               |
| 5   | 1 set  | rear bumper clips                  | necessary   | \$ .       | 35.00          | \$      | 35.0               |
| 6   | 1 pc   | rear end panel                     | buckled     | \$         | 700.00         | \$      | 700.0              |
| 7   | 1 pc   | rear end panel top garnish         | dislodged   | \$         | 312.00         |         | reuse              |
| 8   | 1 pc   | tailgate                           | buckled     | \$         | 1,725.00       | \$      | 1,725.0            |
| 9   | 1 pc   | tailgate inner lock                | jammed      | \$         | 150.00         | \$      | 150.0              |
| 10  | 1 pc   | tailgate logo emblem               | necessary   | \$         | 75.00          | \$      | 75.0               |
| 11  | 1 pc   | tailgate " shuttle " emblem        | necessary   |            | 82.00          | \$      | 82.0               |
| 12  | 1 pc   | tailgate " hybrid " emblem         | necessary   | \$         | 57.00          | \$      | 57.0               |
| 13  | 1 pc   | tailgate chrome garnish            | unconfirmed | \$         | 560.00         | 100     | not affected       |
| 14  | 1 pc   | tailgate I/h lamp                  | cracked     | \$         | 545.00         | \$      | 545.0              |
| 15  | 1 pc   | tailgate inner trim board          | deformed    | \$         | 414.00         | \$      | 414.0              |
| 16  | 1 set  | tailgate inner trim board clips    | necessary   | \$         | 35,00          | \$      | 35.0               |
| 17  | 1 pc   | tailgate weatherstrip              | deformed    | \$         | 169.00         | \$      | 169,0              |
| 18  | 1 pc   | rear windscreen moulding           | necessary   | \$ .       | 88.00          | \$      | 88.0               |
|     |        | Less 20%                           |             | \$         | 6,434.00       | \$      | 5,562.0<br>1,112.4 |
|     |        |                                    | ,           | \$         | 6,434.00       | \$      | 4,449.6            |
|     |        | SPECIAL NETT ITEMS:-               |             |            |                |         |                    |
| 19  | 1 set  | reverse sensor                     | not working | \$         | 300.00         | \$      | 250.0              |
| 20  | 1 roll | rear windscreen sealant            | necessary   | \$         | 60.00          | \$      | 40.0               |
|     |        |                                    |             | \$         | 360.00         | \$      | 290.0              |
|     |        |                                    |             |            |                |         |                    |
|     |        | 24. Ye                             |             |            |                |         |                    |
|     |        |                                    |             |            |                |         |                    |
|     |        |                                    |             |            | and the second | njetiš. |                    |
|     |        |                                    |             |            |                |         |                    |
|     |        |                                    | Sub - Total | \$         | 6,794.00       | \$      | 4,739.6            |



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

reg no: 53058468m

Our Reference Vehicle Number : KAAS/TA/6015/8713/TP/07.20

: SLS 8713G

# APPRAISEMENT SCHEDULE

| S/N | Qty     | Descriptions  | Conditions  | Repairer's |          | Revised |          |
|-----|---------|---|-------------|------------|----------|---------|----------|
|     |         |   |             |            | Estimate |         | Amount   |
|     |         | B/F   |             | \$         | 6,794.00 | \$      | 4,739.60 |
|     |         | LABOUR & OTHER CHARGES:-                                      |             |            |          |         |          |
| 1   |         | To panel beat and renewal of all necessary damaged body parts |             | \$         | 1,200.00 | \$      | 1,000.00 |
| 2   |         | To check wiring and rewire                                    |             | \$         | 60.00    | \$      | 50.00    |
| 3   | ,       | To remove and reinstall tailgate components                   |             | \$         | 80.00    | \$      | 60.00    |
| 4   |         | To remove and reinstall rear windscreen                       |             | \$         | 150.00   | \$      | 120.00   |
| 5 , |         | To remove and reinstall rear boot upholstery                  | ,           | \$         | 120.00   | \$      | 100.00   |
| 6   |         | To remove and reinstall reverse sensor                        | 1,          | \$         | 140.00   | \$      | 100.00   |
| 7   |         | To remove and reinstall reverse camera                        | 4           | \$         | 150.00   | \$      | 120.00   |
| 8   | ,       | To apply anti-rust  |             | \$ ·       | 120.00   | \$      | 100.00   |
| 9   |         | To putty and spray-paint of affected areas                    |             | \$         | 1,000.00 | \$      | 800.00   |
|     |         |   |             | \$         | 3,020.00 | \$      | 2,450.00 |
|     |         | ,   | *           |            |          |         |          |
|     |         |   | -           |            |          |         |          |
|     |         |   |             |            |          |         |          |
|     |         |   |             |            |          |         |          |
|     |         |   | -           |            |          |         |          |
|     |         |   |             |            |          |         |          |
|     | ,       |   |             |            |          |         |          |
|     | mermene |   | Sub - Total | \$         | 9,814.00 | \$      | 7,189.60 |



6 tampines st 73, #01-03, singapore 528825 tel: 6746 2118 fax: 6746 1148

 
reg no: 53058468m


Our Reference Vehicle Number : KAAS/TA/6015/8713/TP/07.20

: SLS 8713G

### ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered Squarely to the Rear portion of the vehicle.



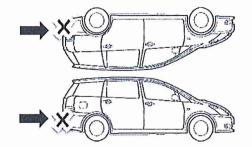



The general area of damages is at the

Rear portion

( Please refer to the parts list and photographs as attached for more information )

### ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs

**Apex Motoring** 

9.814.00 .

We have adjusted the cost to

7,189.60 and the repairer has agreed to undertake the repairs at a

**Contract Lump Sum of** 

\$ **5,750.00** to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of

working days.

54 photographs were taken at the time of static inspection.

This report is strictly done in a Without Prejudice Basis.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No.

6015

for our services rendered and

we thank you for engaging our services.

Conducted By:

Approved By:

**TERRENCE HONG** 

Dip Engineering / DECC (SP)

Certs Automotive Technology (NP)

Cert. Crash Investigation & Reconstruction

Cert SCI (General Insurance)

AMSAAA, AM SAE-A

**KELVIN TEO** 

Licensed Automotive Appraiser

Nitec in Automotive Technology

Cert, Crash Investigation & Reconstruction

Dip MS

MSAAA, AM SAE-A

NOTE: This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.