

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC4/AIG20010845/UGA3Q2**Date:** 02/11/2020REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 2070006938
Claimant
Vehicle No : SMH852L **Insured Vehicle No :** SMR7423T
Date of Loss: 07/10/2020 Nature of Claim: TP Claim No: 8829853018SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMH852L**
Make & Model: HONDA SHUTTLE HYBRID, 1.5 (A) Engine No: LEB7101312
Reg. Date: 10/01/2019 (Man. Year: 2018) Chassis No: GP72000909
Colour: Silver Odometer: 178927 km
Engine Capacity: 1496 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 185/60 R15 Rear Tyre Size: 185/60 R15
Front Left Side: West Lake 6 mm Rear Left Side: West Lake 6 mm
Front Right Side: West Lake 6 mm Rear Right Side: West Lake 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,437.84	3,814.72	10,623.12	73.58
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,360.00	1,830.00	2,530.00	58.03
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	18,797.84	5,644.72	13,153.12	69.97
Approved Total (Overridden) (S\$)		4,500.00		
Nett Amount (S\$)	18,797.84	4,500.00	14,297.84	76.06
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 08/10/2020
Date Inspected: 08/10/2020 Inspected At: Eco Automobile Claims & Repair Pte Ltd - Bartley Biz Center (HQ)
15 KAKI BUKIT ROAD 4, #01-53
BARTLEY BIZ CENTER
Singapore 417808
Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA**Manager:** Chong Pui Lin*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Badly Dented	1,425.00 FL	*1,193.40 FL
2	1		*TAILGATE CENTRE CHROME GARNISH	Not Necessary	425.00 FL	*- FL
3	1		*SET TAILGATE CENTRE CHROME GARNISH CLIPS	Not Necessary	40.00 FL	*- FL
4	2		*TAILGATE TOP HINGES	Not Necessary	188.40 FL	*- FL
5	1		*TAILGATE INNER LOCK	Twisted	278.00 FL	*155.20 FL
6	1		*TAILGATE LOCK ACTUATOR	Not Necessary	248.00 FL	*- FL
7	1		*TAILGATE INNER TRIM BOARD	Deformed / Cracked	482.00 FL	*482.00 FL
8	2		*TAILGATE DAMPER	Not Necessary	596.40 FL	*- FL
9	2		*TAILGATE RUBBER STOPPER	Not Necessary	11.60 FL	*- FL
10	1		*TAILGATE HONDA BADGE	Necessary	92.00 FL	*37.40 FL
11	1		*TAILGATE SHUTTLE EMBLEM	Necessary	98.00 FL	*60.00 FL
12	1		*TAILGATE HYBRID EMBLEM	Necessary	92.00 FL	*68.00 FL
13	2		*TAILGATE REFLECTORS	Not Necessary	790.00 FL	*- FL
14	1		*TAILGATE WIPER MOTOR	Not Necessary	492.00 FL	*- FL
15	1		*REAR FLOOR PANEL	Repair	1,250.00 FL	*- FL
16	1		*REAR FLOOR PANEL TOP BOARD	Not Necessary	298.00 FL	*- FL
17	1		*REAR FLOOR PANEL INNER TOOL TRAY	Not Necessary	238.00 FL	*- FL
18	2		*REAR SIDE TOOL TRAYS	Not Necessary	284.00 FL	*- FL
19	1		*REAR WINDSCREEN	Not Necessary	1,250.00 FL	*- FL
20	1		*REAR WINDSCREEN MOULDING	Necessary	172.00 FL	*172.00 FL
21	2		*RHS & LHS REAR FENEER	Not Necessary	1,565.00 FL	*- FL
22	2		*RHS & LHS REAR FENEER INNER SIDE TRIM	Not Necessary	448.00 FL	*- FL
23	2		*RHS & LHS REAR FENDER INNER SPLASH SHIELD	Not Necessary	198.00 FL	*- FL
24	1		*REAR BUMPER	Deformed/ Warped	1,242.00 FL	*1,150.00 FL
25	2		*REAR BUMPER SIDE RETAINERS	Not Necessary	288.00 FL	*- FL
26	2		*REAR BUMPER REFLECTORS	Not Necessary	304.00 FL	*- FL
27	2		*REAR BUMPER REFLECTOR COVER	Not Necessary	156.40 FL	*- FL
28	1		*REAR BUMPER INNER FOAM	Torn	42.00 FL	*42.00 FL
29	2		*RHS & LHS TAILLAMPS	Not Necessary	1,969.00 FL	*- FL
30	1		*REAR END PANEL	Dented	982.00 FL	*631.20 FL
31	1		*REAR END PANEL TOP GARNISH	Deformed / Twisted	261.00 FL	*168.20 FL
32	1		*REAR BOOT EDGE WEATHERSTRIP	Twisted	184.00 FL	*184.00 FL
33	1		*SET REAR BUMPER CLIPS	Necessary	60.00 FS	*50.00 FS
34	1		*REAR WINDSCREEN SEALANT	Necessary	100.00 FS	*40.00 FS
35	1		*SET REVERSE SENSOR	Shorted	280.00 FS	*200.00 FS
36	1		*REVERSE CAMERA	Serviceable	380.00 FS	*- FS
37	1		*SET TAILGATE INNER TRIM CLIPS	Not Necessary	60.00 FS	*- FS
38	1		*REAR END PANEL SEALANT	Necessary	100.00 FS	*50.00 FS
39	1		*REAR FLOOR PANEL SEALANT	Not Necessary	100.00 FS	*- FS
40	1		*TAILGATE WIPER BLADE	Not Necessary	72.00 FS	*- FS
41	1		*REAR LICENCE PLATE W/HOLDER	Not Necessary	75.00 FS	*- FS
42	2		*REAR LICENCE PLATE LAMPS	Not Necessary	99.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 17,715.80 4,683.40
- List Item Discount on L Items 20.00/20.00% (\$\$) 3,277.96 868.68

Total Parts (\$\$) 14,437.84 3,814.72

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS ,REPLACE DAMAGED PARTS AND COMPONENTS	New	1,800.00	600.00
2	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY,RESPRAY PAINT ON PARTS REPLACED AND REPAIRED AREAS	New	1,400.00	900.00
3	TO REMOVE AND REFIT WIRING AND CHECK ALL ELECTRICAL COMPONENTS AT DAMAGED AREAS FOR PROPER FUNCTIONS	New	200.00	20.00
4	TO REMOVE AND REPLACE /REFIX AR TRIMS ,GARNISH AND FITTINGS SO AS TO FACILITATE REPLAIRS AT REAR	New	250.00	80.00
5	TO REMOVE AND REPLACE REAR WINDSCREEN	New	140.00	120.00
6	TO REMOVE AND REPLACE REVERSE SENSORS AND CHECK FOR PROPER FUNCTION }	New	150.00	50.00
7	TO REMOVE AND REPLACE REVERSE CAMERA AND CHECK FOR PROPER FUNCTION }	New	150.00	0.00
8	TO PROVIDE ANTI-RUST TREATMENT ON AFFECTED AREAS	New	270.00	60.00
Gross Labour Cost (S\$)			4,360.00	1,830.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >