

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CC4/III20010872/UPA3Q2

Date: 18/11/2020

REFERENCE

Handling Insurer: India International Insurance Pte Ltd	Policy No:	MCOM0015
Claimant		
Vehicle No : FBN5529L	Insured Vehicle No :	SHC1422Z
Date of Loss: 29/09/2020	Nature of Claim: TP	Claim No: MCT20090451

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBN5529L	Engine No:	G3H6E0011000
Make & Model:	YAMAHA NMAX155, 155cc	Chassis No:	MH3SG431000008517
Reg. Date:	24/10/2018 (Man. Year: 2018)	Odometer:	34457 km
Colour:	White		
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110-70-13	Rear Tyre Size:	130-70-13
Front Left Side:	Timsun 6 mm	Rear Left Side:	Timsun 6 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	850.00	776.10	73.90	8.69
Miscellaneous Items	0.00	0.00	0.00	
Labour	910.00	525.00	385.00	42.31
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (\$\$)	1,760.00	1,301.10	458.90	26.07
+ GST 7.00/7.00% (\$\$)	123.20	91.08	32.12	26.07
Nett Amount (\$\$)	1,883.20	1,392.18	491.02	26.07
+ Loss of Use (3.0 x S\$20.00/day) (\$\$)		60.00		
+ Doc/Search Fee (\$\$)		7.45		
Nett Liability (\$\$)		1,459.63		

INSPECTION

Date of Assignment:	08/10/2020	
Date Inspected:	09/10/2020	Inspected At:
		Ban Hock Hin Co. Pte Ltd (HQ)
		No. 6 Defu Lane 4
		Singapore 539410
Estimated Period of Repair:	3.0 days	

Adjuster: MARCUS CHUA

Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 05 Nov 2020)	
Parts:	N/A	YAMAHA NMAX155 155cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBN5529L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BELLY PAN	Cut	34.00 F	*34.00 FL
2	1		*BOARD FOOTREST RH	Cut	52.00 F	*52.00 FL
3	1		*BOX REAR (GIVI)E450N BLACK W/O STOP LIGHT	Cut	222.00 F	*222.00 FL
4	2		*EMBLEM (YAMAHA) LOGO	Necessary	22.00 F	*22.00 FL
5	1		*HEADLAMP ASSY	Cut	308.00 F	*308.00 FL
6	1		*LEVER BRAKE RH	Scratched	18.00 F	*18.00 FL
7	1		*MIRROR RH	Cut	37.00 F	*37.00 FL
8	1		*PROTECTOR EXHAUST	Cut	38.00 F	*38.00 FL
9	4		*RIVET	Necessary	8.00 F	*8.00 FL
10	1		*STICKER (CISCO) COWLING FRONT LH	Necessary	37.00 FS	*37.00 FS
11	1		*STICKER (CISCO) COWLING FRONT RH	Necessary	37.00 FS	*37.00 FS
12	1		*STICKER (CISCO) MUDGUARD FRONT	Necessary	37.00 FS	*37.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	850.00	850.00
- List Item Discount on L Items 0.00/10.00% (S\$)	0.00	73.90
Total Parts (S\$)	850.00	776.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	SPRAY PAINTING COVER TO CISCO WHITE -FRONT MUDGUARD ,SIDE COVER UPPER & LOWER RH PANEL	New	420.00	240.00
2	TRANSPORT CHARGES -DELIVERY /COLLECTION	New	112.00	35.00
3	LABOUR	New	378.00	250.00
Gross Labour Cost (\$\$)			910.00	525.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >