

## LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

### VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.  
AIG Building, 78 Shenton Way, #09-16  
Singapore 079120

**Our File No:** CS/AIG20010972/R1VD3E2

**Date:** 19/11/2020

#### REFERENCE

Insured/Claimant:	TAN SU WAI	Policy No:	1800069446
Date of Loss:	10/10/2020	Nature of Claim:	OD
		Claim No:	1372322445SG

#### DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SMA7829X</b>	Engine No:	4J11YC2390
Make & Model:	mitsubishi OUTLANDER, 2.0 (A)	Chassis No:	GF7W0401722
Reg. Date:	20/06/2018 (Man. Year: 2018)	Odometer:	74387 km
Colour:	Black		
Engine Capacity:	1998 cc		
Market Value/New Car Price:	S\$88,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

#### CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

#### CONDITION OF TYRES

Front Tyre Size:	225/55 R18	Rear Tyre Size:	225/55 R18
Front Left Side:	Toyo 6 mm	Rear Left Side:	Toyo 6 mm
Front Right Side:	Toyo 6 mm	Rear Right Side:	Toyo 6 mm

*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,347.08	10,669.05	2,678.03	20.06
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,060.00	5,140.00	920.00	15.18
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>19,407.08</b>	<b>15,809.05</b>	<b>3,598.03</b>	<b>18.54</b>
<b>- Excess (S\$)</b>	<b>300.00</b>	<b>300.00</b>	<b>0.00</b>	<b>0.00</b>
<b>(S\$)</b>	<b>19,107.08</b>	<b>15,509.05</b>	<b>3,598.03</b>	<b>18.83</b>
<b>+ GST 7.00/7.00% (S\$)</b>	<b>1,337.50</b>	<b>1,085.63</b>	<b>251.87</b>	<b>18.83</b>
<b>Nett Amount (S\$)</b>	<b>20,444.58</b>	<b>16,594.68</b>	<b>3,849.90</b>	<b>18.83</b>

#### INSPECTION

Date of Assignment: 12/10/2020  
Date Inspected: 12/10/2020 Inspected At:

Cycle & Carriage Automotive Pte Ltd  
(Pandan Gardens)  
209 Pandan Gardens  
Singapore 609339

Estimated Period of Repair: 8.0 days

**Adjuster:** MOHD RASUL

**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT NUMBER PLATE WITH FRAME	Bent	50.00 FS	*50.00 FS
2	1		*SUNDRIES	Necessary	50.00 FS	*20.00 FS
3	1		*PNL, HEADLAMP SUPT, UPR RH	Bent	58.00 FL	*58.00 FL
4	1		*PANEL, HEADLAMP SUPPORT, UPR	Bent	182.00 FL	*182.00 FL
5	1		*PNL, HEADLAMP SUPT, UPR LH	Bent	58.00 FL	*58.00 FL
6	1		*PNL, HEADLAMP SUPT, UPR LH	Serviceable	58.00 FL	*- FL
7	1		*PANEL, HEADLAMP SUPPORT, LWR	Serviceable	146.00 FL	*- FL
8	1		*PANEL, HEADLAMP SUPPORT, LWR	Serviceable	155.00 FL	*- FL
9	1		*CONDENSER ASSY, A/C REFRIGE	Bent	857.00 FL	*857.00 FL
10	1		*RADIATOR ASSY	Bent	1,091.00 FL	*1,091.00 FL
11	1		*TANK ASSY, RADIATOR COND	Serviceable	103.00 FL	*- FL
12	1		*FAN, COOLING, LH	Serviceable	78.00 FL	*- FL
13	1		*FAN, COOLING, LH	Serviceable	78.00 FL	*- FL
14	1		*SHROUD, COOLING FAN	Serviceable	258.00 FL	*- FL
15	1		*MOTOR, COOLING FAN, LH (120W)	Serviceable	479.00 FL	*- FL
16	1		*MOTOR, COOLING FAN, LH (120W)	Serviceable	479.00 FL	*- FL
17	1		*LLC 4L	Necessary	26.00 FL	*26.00 FL
18	1		*BRACKET, RADIATOR GRILLE, RH	Serviceable	17.00 FL	*- FL
19	1		*BRACKET, RADIATOR GRILLE, LH	Serviceable	13.00 FL	*- FL
20	1		*HOOD	Bent	975.00 FL	*975.00 FL
21	1		*HINGE, HOOD, LH	Serviceable	68.00 FL	*- FL
22	1		*HINGE, HOOD, RH	Serviceable	68.00 FL	*- FL
23	1		*INSULATOR, HOOD	Deformed	133.00 FL	*133.00 FL
24	1		*WEATHERSTRIP, HOOD	Necessary	40.00 FL	*40.00 FL
25	1		*LATCH, HOOD	Bent	76.00 FL	*76.00 FL
26	1		*FENDER, FR LH	Buckled	688.00 FL	*688.00 FL
27	1		*FENDER, FR RH	Buckled	688.00 FL	*688.00 FL
28	1		*MOULDING, FR BUMPER, LH	Serviceable	116.00 FL	*- FL
29	1		*MOULDING, FR BUMPER, RH	Serviceable	116.00 FL	*- FL
30	1		*MOULDING, FR WHEEL ARCH, LH	Necessary	199.00 FL	*199.00 FL
31	1		*MOULDING, FR WHEEL ARCH, RH	Necessary	199.00 FL	*199.00 FL
32	1		*HEADLAMP ASSY, LH	Cracked	2,125.00 FL	*2,125.00 FL
33	1		*HEADLAMP ASSY, RH	Cracked	2,125.00 FL	*2,125.00 FL
34	1		*LAMP ASSY, FOG, FR LH	Serviceable	348.00 FL	*- FL
35	1		*LAMP ASSY, FOG, FR RH	Serviceable	348.00 FL	*- FL
36	1		*BRACKET, FR BUMPER SIDE, LH	Serviceable	18.00 FL	*- FL
37	1		*BRACKET, FR BUMPER SIDE, RH	Serviceable	18.00 FL	*- FL
38	1		*FACE, FR BUMPER	Cracked	859.00 FL	*859.00 FL
39	1		*EXTENSION, FR BUMPER	Deformed	426.00 FL	*426.00 FL
40	1		*GARNISH, FR BUMPER, LH	Deformed	75.00 FL	*75.00 FL
41	1		*GARNISH, FR BUMPER, RH	Serviceable	75.00 FL	*- FL
42	1		*COVER, FR BUMPER	Cracked	294.00 FL	*294.00 FL
43	1		*GARNISH, FR BUMPER SIDE	Serviceable	48.00 FL	*- FL
44	1		*GARNISH, FR BUMPER SIDE	Serviceable	48.00 FL	*- FL
45	1		*GARNISH, FR BUMPER SIDE	Cracked	220.00 FL	*220.00 FL
46	1		*GARNISH, FR BUMPER SIDE	Cracked	220.00 FL	*220.00 FL
47	1		*GARNISH, FR BUMPER SIDE	Cut	112.00 FL	*112.00 FL
48	1		*GARNISH, FR BUMPER SIDE	Deformed	112.00 FL	*112.00 FL
49	1		*REINF, FR BUMPER SIDE, RH	Bent	69.00 FL	*69.00 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
50	2		*REINFORCEMENT, FR BMPR SIDE	Serviceable	44.00 FL	*- FL
51	1		*REINF, FR BUMPER SIDE, LH	Bent	60.00 FL	*60.00 FL
52	1		*REINFORCEMENT, FR BUMPER	Bent	134.00 FL	*134.00 FL
53	1		*BAR, FR BUMPER GUARD	Serviceable	130.00 FL	*- FL
54	1		*BAR, FR BUMPER GUARD	Serviceable	130.00 FL	*- FL
55	1		*REINFORCEMENT, FR BUMPER	Bent	503.00 FL	*503.00 FL
56	1		*PANEL,HEADLAMP SUPPORT,RH	Bent	58.00 FL	*58.00 FL
57	1		*PANEL,HEADLAMP SUPPORT,LH	Bent	58.00 FL	*58.00 FL
58	1		*GRILLE ASSY,RADIATOR	Cracked	569.00 FL	*569.00 FL
59	1		*COVER,HEADLAMP SUPT PANEL	Cracked	50.00 FL	*50.00 FL
60	1		*HORN,THEFT PROTECTION	Bent	92.00 FL	*92.00 FL
61	4		*TAPE,TAILGATE	Necessary	16.00 FL	*16.00 FL
62	1		*PLUG,BODY	Missing	6.00 FL	*6.00 FL
63	10		*CLIP	Necessary	20.00 FL	*20.00 FL
64	10		*CLIP	Necessary	30.00 FL	*30.00 FL
65	1		*PIPE,A/C CONDENSER OUTLET	Bent	262.00 FL	*262.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$)</b>	<b>17,304.00</b>	<b>13,835.00</b>
<b>- List Item Discount on L Items 23.00/23.00% (\$)</b>	3,956.92	3,165.95
<b>Total Parts (\$)</b>	<b>13,347.08</b>	<b>10,669.05</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	RENEW ACCIDENT DAMAGED PARTS ON FRONT SUPPORT PANEL, FRONT BONNET, FRONT BUMPER, RH FRONT FENDER, LH FRONT FENDER, REPAIR RH FRONT DOOR, REPAIR LH FRONT DOOR	New	2,250.00	1,800.00
2	REMOVE AND INSTALL RADIATOR AND A/CON CONDENSER TO FACILITATE REPAIR WORK	New	100.00	100.00
3	TOP UP AIR CON GAS AND CHECK A/CON SYSTEM	New	80.00	80.00
4	PAINT WORK SPRAY FRONT SUPPORT PANEL, FRONT BONNET, FRONT BUMPER, RH FRONT FENDER, LH FRONT FENDER, LH FRONT DOOR, RH FRONT DOOR AND AFFECTED PORTION	New	2,800.00	2,450.00
5	APPLY BODY SEALANT	New	120.00	40.00
6	CHECK WIRING AND CHASSIS ELECTRICAL SYSTEM	New	30.00	30.00
7	PERFORM RUST PREVENTION	New	80.00	40.00
8	TO CARRY OUT DIAGNOSTIC CHECK USING HI-SCAN PRO TEST USING HI-SCAN PRO TEST	New	120.00	120.00
9	RE-APPLY ZERTONA PAINT PROTECTION	New	480.00	480.00
<b>Gross Labour Cost (S\$)</b>			<b>6,060.00</b>	<b>5,140.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >