



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLL 537M

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	DISTORTED	1,065.90	762.30
1	FRONT BUMPER SIDE RETAINER LH	CRACKED	156.40	45.50
1	FRONT BUMPER LOWER SKIRT	TORN	650.00	420.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	458.50	-
1	FRONT BUMPER FOGLAMP LH	NOT NECESSARY	520.00	-
1	FRONT BUMPER FOGLAMP COVER LH	NOT NECESSARY	274.00	-
1	HEADLAMP LH -LED	CRACKED	1,959.90	1,959.90
1	HEADLAMP BRACKET LH	NOT NECESSARY	114.60	-
1	BONNET	TO REPAIR SEE LABOUR	1,207.00	-
1	FRONT FENDER LH	BADLY DENTED	940.60	466.20
1	FRONT FENDER EMBLEM -HYBRID	NECESSARY	205.00	82.50
1	FRONT FENDER INNER SHIELD	TORN	238.90	238.90
1	FRONT WHEEL ARCH GARNISH LH	MISSING	414.00	248.50
1	FRONT ROCKER PANEL GARNISH LH	TO REPAIR SEE LABOUR	477.10	-
1	FRONT SUPPORT PANEL	NOT NECESSARY	613.00	-
1	FRONT SHOCK ABSORBER LH	NOT NECESSARY	498.40	-
1	FRONT WHEEL HUB LH	BENT	368.00	368.00
1	FRONT WHEEL HUB BEARING LH	NECESSARY	364.00	245.50
1	FRONT KNUCKLE ARM LH	BENT	485.00	485.00
1	FRONT LOWER ARM LH	BENT	512.00	399.50
1	FRONT ANTI ROLL BAR LINK LH	NOT NECESSARY	258.00	-
	LESS 20% DISCOUNT		-2,356.06	-1,144.36
			9,424.24	4,577.44
<b><u>SPECIAL NETT ITEMS</u></b>				
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	HEADLAMP CLIPS (SN)	NOT NECESSARY	50.00	-
1	SET FRONT BUMPER SENSOR (SN)	NOT NECESSARY	250.00	-
1	SET FRONT FENDER INNER SHIELD CLIPS (SN)	NECESSARY	50.00	50.00
1	FRONT FENDER SEALANT (SN)	NOT NECESSARY	100.00	-

Report Ref No. CS/SMO20011003/Uyd3q2



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT WHEEL ARCH CLIPS (SN)	NOT NECESSARY	50.00	-
1	FRONT RIM LH (SN)	CUT	1,000.00	600.00
1	FRONT TYRE LH (SN)	NOT NECESSARY	800.00	-
			2,350.00	700.00
	<b>LABOUR</b>			
	CHECK WIRING AND LIGHTING SYSTEM.		100.00	20.00
	WHEEL ALIGNMENT.		100.00	60.00
	PANEL BEATING ON AFFECTED AREA.INCLUSIVE OF THE REPAIR OF BONNET AND FRONT ROCKER PANEL GARNISH LH.		1,500.00	550.00
	TO REMOVE AND REFIT UNDERCARRIAGE ITEMS.		250.00	120.00
	SPRAY PAINTING ON AFFECTED AREA.		1,000.00	800.00
	APPLY ANTI RUST ON AFFECTED AREA.		100.00	30.00
			3,050.00	1,580.00
<b>GRAND TOTAL</b>			<b>14,824.24</b>	<b>6,857.44</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>5,400.00</b>

Report Ref No. CS/SMO20011003/Uyd3q2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.