

PRESTIGE APPRAISER SERVICES

Insurance Loss Adjusters and Licensed Appraiser Regn. 652868584L

Blk 131 Rivervale Street #05-872 S'pore 540131 Tel:65528323 Fax:64574321

Our ref : PS/002/06/19

Date : 25th June 2019

Mr Naung Latt Maw
c/o 160 Sin Ming Drive
#02-17 Sin Ming Auto City
Singapore 575722

Dear Sir,

Re : **THIRD PARTY CLAIM**

We refer to your instruction to appraise the vehicle **SJR 5318 M** on 03rd June 2019.

A static inspection was conducted during our survey and our report is enclosed for your perusal. The estimated repair cost submitted by **Messrs. Yee Auto Service** for **\$28,789.48** as per our attached schedule have been inspected thoroughly each and every item and revised by us against the actual damages found on the vehicle which have been recommended by us accordingly.

The repairer has agreed to undertake repairs at our revised amount of **\$16,100.00 lump sum** corresponding to supply of parts, labour charges and spray-painting. However, we have not given instruction to authorize the repairs.

Under normal circumstances, the estimated period of repairs would be **NINE (9) days**. Photographs of the damaged vehicle taken by us during our inspection are enclosed.

We are reverting the matter to you for a decision.

Please do not hesitate to contact us if you need any clarification.

Assuring you of our best services.

Yours faithfully,

PRESTIGE APPRAISER SERVICES


LOUIS S C NG CAE AMIMI
Dip. MTM. Automotive Engineer
Licensed Appraiser

Encl.

PRESTIGE APPRAISER SERVICES

VEHICLE INSPECTION REPORT

To: Mr Naung Latt Maw
c/o 160 Sin Ming Drive
#02-17 Sin Ming Auto City
Singapore 575722

Date : 25th June 2019
Our Ref : PS/002/06/19
Policy No :
Sum Insured :
Excess : T/P Claim

Assigned By : Mr Naung Latt Maw
Assignment Date : 03rd June 2019
Accident Date : 01st June 2019
Inspection Date : 03rd June 2019
Workshop Name : Yee Auto Service
Survey Conducted At : 160 Sin Ming Drive
#02-17 Sin Ming Auto City
Singapore 575722

PARTICULARS OF VEHICLE

Registration No	: SJR 5318 M	Mileage	: 142023km
Make/Model	: Toyota Camry	Engine No	: HIDDEN
Type Of Body	: Motorcar	Chassis No	: MR053BK4107046504
Year Of Manu./Regn.	: 2009	Passenger Cap.	: 4 Passengers
Colour	: Pearl White	Others	: -

CONDITION OF TYRES

R/H SIDE

L/H SIDE

Front Tyre	: 6mm 215/60R16 Dunlop	6mm 215/60R16 Dunlop
Rear Tyre	: 6mm 215/60R16 Dunlop	6mm 215/60R16 Dunlop

The above represent the estimated remaining life of the tyre treads.

PRE-ACCIDENT CONDITION (Static tests only)

Handbrake	: Serviceable	Body Work	: Good
Footbrake	: Serviceable	Paint Work	: Good
Steering	: Serviceable	Others	: -

POINT OF IMPACT

The vehicle sustained impacts on the front & rear portion.

GENERAL DESCRIPTION OF DAMAGES

Front: The front support panel, bumper assy, fenders, bonnet were dented.

Rear: The rear body panel, bumper assy, floorboard panel, fenders, bootlid were dented/distorted.

For details of damages please refer to schedule attached.

REMARKS :

This survey was conducted strictly without prejudice.

PRESTIGE APPRAISER SERVICES

Vehicle No : SJR 5318 M

Our Ref :

PS/002/06/19

Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.	
	<u>LIST ITEMS</u>				
1	front bumper X Repair	dented	\$ 1,028.08	\$	1,028.08
1	front bumper beam X SVC	dented	598.30		598.30
1	front bumper sponge X SVC	damaged	290.00		290.00
2	front bumper bracket X SVC	dented	147.00		147.00
2	front bumper side retainer X SVC	dented	197.00		197.00
8	front bumper clip X SVC	necessary	64.00		64.00
1	front bumper grille X SVC	dented	165.20		165.20
1	R/H fog lamp X SVC	holder damaged	448.52		448.52
1	L/H fog lamp X SVC	holder damaged	448.52		448.52
1	R/H fog lamp garnish X SVC	holder damaged	144.20		144.20
1	L/H fog lamp garnish X SVC	holder damaged	144.20		144.20
1	bonnet X SVC	dented	1,490.30		1,490.30
1	front support panel	dented - repair	762.93		-
1	brace panel X SVC	dented	196.83		196.83
1	front grille ✓	holder fractured	638.80	549.8	638.80 ✓
1	front grille emblem ✓	necessary	87.30	60	87.30 ✓
3	front grille clip ✓	necessary	18.00		18.00 ✓
1	R/H headlamp X SVC	dented/distorted	1,083.30		1,083.30
1	L/H headlamp X SVC	dented/distorted	1,083.30		1,083.30
1	rear bumper ✓	dented	1,159.50	561.6	1,159.50 ✓
1	rear bumper reinforcement ✓	dented	683.60	381.1	683.60 ✓
2	rear bumper bracket X SVC	dented	237.80		237.80
2	rear bumper side retainer X SVC	dented	231.80		231.80
2	rear bumper reflector X SVC	holder damaged	331.70		331.70
8	rear bumper clip ✓	necessary	64.00	50	64.00 ✓
1	rear body panel ✓	dented	725.90	619.1	725.90 ✓
1	rear body panel top garnish ✓	dented	434.00	380.4	434.00 ✓
4	rear body panel top garnish clip ✓	necessary	51.60	30	51.60 ✓
1	R/H taillamp ✓	holder damaged	855.60	485.1	855.60 ✓
1	L/H taillamp ✓	holder damaged	855.60	485.1	855.60 ✓
2	taillamp panel	dented - repair	386.20		-
1	bootlid X SVC	dented/distorted	1,251.90		1,251.90
2	boot hinge	dented - repair	343.90		-
1	boot weatherstrip X SVC	distorted	295.60		295.60
1	boot top lock X SVC	dented	289.60		289.60
1	boot lower lock X SVC	dented	135.00		135.00
1	boot emblem ' 2.0 ' X SVC	necessary	68.90		68.90
1	boot emblem ' LOGO ' X SVC	necessary	76.00		76.00
1	boot outer garnish	serviceable	569.60		-
1	R/H boot reflector X SVC	stud damaged	554.80		554.80
1	L/H boot reflector X SVC	stud damaged	554.80		554.80
1	boot inner garnish X SVC	dented/distorted	425.60		425.60
1	spare wheel panel	dented - repair	1,299.50		-
1	exhaust chrome pipe X SVC	dented	245.30		245.30
1	exhaust muffler	dented - repair	955.90		-
			22,119.48		17,801.45
		Less 25%	-		4,450.36
	Balance c/f		\$ 22,119.48	\$	13,351.09

3620.2

PRESTIGE APPRAISER SERVICES

Vehicle No : SJR 5318 M

Our Ref : PS/002/06/19

Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.
		Balance b/d	\$ 22,119.48	\$ 13,351.09
1set	<u>S/NETT ITEM</u> reverse sensor X SVC	damaged	500.00	300.00
	<u>Labour Charges & Misc</u> To dismantle & replace damaged parts, panel beat where necessary.		2,800.00	600 2,400.00
	To putty, apply primer & spray-paint on the affected portion.		2,500.00	600 2,200.00
	To apply rust-proofing on repaired, replaced panel.		350.00	60 280.00
	To remove/refit rear boot compartment garnish to facilitate repairs.		180.00	X 150.00
	To remove/renew exhaust muffler.		220.00	X 180.00
	To check wiring functions.		120.00	30 100.00
			\$ <u>28,789.48</u>	\$ <u>18,961.09</u>
				1290

4005.15


-20%: 3200

Note: The repairer has agreed to undertake the repairs at our adjusted amount of **\$16,100.00 lump sum** corresponding to supply of parts, labour and spray-painting charges.

5 days

Under normal circumstances, the estimated repair period would be **NINE (9)** days.
Pursuant to your instruction we have **not** authorised repairs on your behalf.

PRESTIGE APPRAISER SERVICES


 LOUIS S C NG CAE AMIMI (UK)
 Licensed Appraiser
 Dip. MTM. Automotive Engineer